


Operation Manual

PRODUCT NAME

IO-Link Direct input type Step Motor Controller (Servo 24VDC)

Model / Series / Product Number

 JXCL1



SMC Corporation

Table of Contents

1. Safety Instructions	4
2. Outlines of Product	6
2.1 Features	7
2.3 Product configuration	9 9
(2) Mounting the controller(3) Wiring and Connection(4) Supply of power(5) IO-Link master configuration	9 9
(6) Establishment of IO-Link communication (7) Setup of the operation parameters	on10 10
3. Specifications	11
3.1 Specifications	12 13
(1) Screw mounting (JXCL17-□)	14 15
(2) Grounding(3) Mounting location	15
4. Initial Setting	17
4.1 IO-Link master configuration	17
5. External Connections	18
5.1 PWR: Power supply connector	onnector18 18 18 19
6. Details of Power Supply Plug	20
6.1 PWR: Power supply plug specifications 6.2 Electrical Wiring Specifications 6.3 Power Supply Plug Wiring (1) Wiring of power supply (C24V, M24V, 0' (2) Wiring of the stop switch (EMG)	20 21 V)21
6.4 Wiring of stop circuit(1)Stop (example of recommended circuit) (2) Stop (relay contact (1))	22)22



(3) Motor power shutdown (relay contact (2))	24	
7. IO-Link communication plug	25	
7.1 IO-Link communication plug specification		
8. LED display	26	
8.1 LED display 8.2 LED and Controller Status		
9. Operation methods	27	
9.1 Outline	27 27	
10. Memory map	28	
10.1 Process data	to IO-Link master) to JXCL1 controller)353535	28 31
10.4 Fail safe		
11. Settings and Data Entry	41	
11.1 Step Data		
11.2 Basic parameters 11.3 Return to origin parameter		
11.4 Drive parameter		
12. Operations	48	
12.1 Return to Origin	48	
12.2 Positioning Operation		
12.3 Pushing Operation		
(1) Pushing operation is successfully performed.		
(2) Pushing operation fails (empty pushing) (3) Movement of the workpiece after the completi		cess
12.4 Controller signal response time		
12.5 Methods of interrupting operation	50	
13. Operation Examples	51	
13.1 Positioning Operation		
13.2 Pushing Operation		
14. Operation Instructions	53	
14.1 Overview of the Operation Instructions	E2	
	33	
14.2 Operation procedure for Operation by Step No [1] Power on and Return to Origin position	53	



[2] Positioning operation	54
[3] Pushing Operation	
[4] HOLD	
[5] Reset	
[6] Stop [7] Area output	
14.3 Operation procedure for Operation by numerical in	
15. Options	59
15.1 Actuator cable [5m or shorter]	
15.2 Actuator cable [8 to 20m]	59
15.3 Actuator cable for with lock [5m or less]	
15.4 Actuator cable for with lock [8 to 20m]	
15.5 Power supply plug	
15.6 IO-Link communication plug	
15.7 Controller Communication cable	
15.8 Teaching box	62
16. Alarm for Motor Control	63
16.1 Alarm group signals	63
16.2 Alarms and countermeasures	64
17. Precautions for wiring and cable	69
18. Electric Actuators/Common Precautions	70
18.1 Design and selection	70
18.2 Mounting	71
18.3 Handling Precautions	
18.4 Operating environment	
18.5 Maintenance Precautions	
18.6 Precautions for actuator with lock	74
19. Controller and Peripheral Devices/Specifi	c Product
Precautions	75
19.1 Design and selection	75
19.1 Design and selection19.2 Handling Precautions	75 76
19.1 Design and selection	75 76 77
19.1 Design and selection19.2 Handling Precautions	75 76 77
19.1 Design and selection	75 76 77 77
19.1 Design and selection	75 76 77 77 78
19.1 Design and selection 19.2 Handling Precautions 19.3 Mounting 19.4 Wiring 19.5 Power supply 19.6 Grounding	75 76 77 77 78
19.1 Design and selection 19.2 Handling Precautions 19.3 Mounting 19.4 Wiring 19.5 Power supply 19.6 Grounding 19.7 Maintenance	75 76 77 77 78 78





JXCL1/Controller

1. Safety Instructions

These safety instructions are intended to prevent hazardous situations and/or equipment damage. These instructions indicate the level of potential hazard with the labels of "Caution," "Warning" or "Danger." They are all important notes for safety and must be followed in addition to International Standards (ISO/IEC)*1), and other safety regulations.

*1) ISO 4414: Pneumatic fluid power - General rules and safety requirements for systems and their components ISO 4413: Hydraulic fluid power - General rules and safety requirements for systems and their components IEC 60204-1: Safety of machinery - Electrical equipment of machines - Part 1: General requirements ISO 10218-1: Robots and robotic devices - Safety requirements for industrial robots - Part 1:Robots



Danger indicates a hazard with a high level of risk which, if not avoided, will result in death or serious injury.

Warning indicates a hazard with a medium level of risk which, if not avoided, could result in death or serious injury.

Caution indicates a hazard with a low level of risk which, if not avoided, could result in minor or moderate injury.

Marning

1. The compatibility of the product is the responsibility of the person who designs the equipment or decides its specifications.

Since the product specified here is used under various operating conditions, its compatibility with specific equipment must be decided by the person who designs the equipment or decides its specifications based on necessary analysis and test results. The expected performance and safety assurance of the equipment will be the responsibility of the person who has determined its compatibility with the product. This person should also continuously review all specifications of the product referring to its latest catalog information, with a view to giving due consideration to any possibility of equipment failure when configuring the equipment.

- 2. Only personnel with appropriate training should operate machinery and equipment.

 The product specified here may become unsafe if handled incorrectly. The assembly, operation and maintenance of machines or equipment including our products must be performed by an operator who is appropriately trained and experienced.
- 3. Do not service or attempt to remove product and machinery/equipment until safety is confirmed.
 - 1. The inspection and maintenance of machinery/equipment should only be performed after measures to prevent falling or runaway of the driven objects have been confirmed.
 - 2. When the product is to be removed, confirm that the safety measures as mentioned above are implemented and the power from any appropriate source is cut, and read and understand the specific product precautions of all relevant products carefully.
- 3. Before machinery/equipment is restarted, take measures to prevent unexpected operation and malfunction.
- 4. SMC products cannot be used beyond their specifications. They are not developed, designed, and manufactured to be used under the following conditions or environments. Use under such conditions or environments is not allowed.
 - 1. Conditions and environments outside of the given specifications, or use outdoors or in a place exposed to direct sunlight.
 - 2. Use for nuclear power, railways, aviation, space equipment, ships, vehicles, military application, equipment affecting human life, body, and property, combustion equipment, entertainment equipment, emergency shut-off circuits, press clutches, brake circuits, safety equipment, etc., and use for applications that do not conform to standard specifications such as catalogs and operation manuals.
 - 3. Use for interlock circuits, except for use with double interlock such as installing a mechanical protection function in case of failure. Please periodically inspect the product to confirm that the product is operating properly.





JXCL1/Controller

1. Safety Instructions

!Caution

SMC develops, designs, and manufactures products to be used for automatic control equipment, and provides them for peaceful use in manufacturing industries.

Use in non-manufacturing industries is not allowed.

Products SMC manufactures and sells cannot be used for the purpose of transactions or certification specified in the Measurement Act of each country.

The new Measurement Act prohibits use of any unit other than SI units in Japan.

Limited warranty and Disclaimer/Compliance Requirements

The product used is subject to the following "Limited warranty and Disclaimer" and "Compliance Requirements".

Read and accept them before using the product.

Limited warranty and Disclaimer

- 1. The warranty period of the product is 1 year in service or 1.5 years after the product is delivered, whichever is first.*²⁾
 - Also, the product may have specified durability, running distance or replacement parts.
 - Please consult your nearest sales branch.
- 2. For any failure or damage reported within the warranty period which is clearly our responsibility, a replacement product or necessary parts will be provided.
 - This limited warranty applies only to our product independently, and not to any other damage incurred due to the failure of the product.
- 3. Prior to using SMC products, please read and understand the warranty terms and disclaimers noted in the specified catalog for the particular products.
 - *2) Vacuum pads are excluded from this 1 year warranty.
 - A vacuum pad is a consumable part, so it is warranted for a year after it is delivered.
 - Also, even within the warranty period, the wear of a product due to the use of the vacuum pad or failure due to the deterioration of rubber material are not covered by the limited warranty

Compliance Requirements

- 1. The use of SMC products with production equipment for the manufacture of weapons of mass destruction (WMD) or any other weapon is strictly prohibited.
- 2. The exports of SMC products or technology from one country to another are governed by the relevant security laws and regulations of the countries involved in the transaction. Prior to the shipment of a SMC product to another country, assure that all local rules governing that export are known and followed.



2. Outlines of Product

2.1 Features

Features of the controller.

•IO-Link compatible

IO-Link operation is available by connecting with IO-Link. Information can be written to and read from the controller.

Actuator control

Positioning operation and operation at a specific speed and force for the actuator are possible by controlling the Step motor (servo 24VDC).

Specified force operation

Control the pushing force or the pressing force of the actuator.

Separated power supply

Power supply input are separated into the motor power supply, the control power supply, and the IO-Link communication power supply. Even if the power supply for the motor is turned OFF, the information from the encoder position is retained whilst the control power supply and the IO-Link communication power supply are ON, and IO-Link communication and serial communication are available.

Return to origin

Returning to origin is possible by a signal from IO-Link communication.

Alarm detection function

Abnormal conditions are automatically detected. Alarms are output via IO-Link communication. The alarm history can be stored in the controller memory.

Positioning / pushing operation is available with step data and numerical operation mode
 It is possible to operate the actuator by using the saved step data and by numeric data operation instruction by using IO-Link communication.

In the step data operation mode, the operation is instructed by manipulating the memory which is relevant to input/output port such as DRIVE signal and INP signal. The actuator operates in accordance with the step data operating pattern of the specified step data.

In the numerical operation mode, the operation is executed by specifying the relevant numeric data.

"AREA" signal

The controller has an "AREA" signal that turns ON if the actuator position is within the range specified by "Area 1" and "Area 2" in the step data.

●Data input method

It is possible to perform status monitoring, reset alarms and set Step data via IO-Link communication, ACT controller software or teaching box. In addition the ACT controller software or teaching box can be used for parameter setup and trial run.

Easy mode and Normal mode

There are two available modes for the controller setting software and the teaching box. In Easy mode, you can start the operation by only setting the speed, position, etc. In Normal mode, further detailed setup can be performed.

!Caution


When the device is set up or failure occurs, please refer the operation manual of the actuator and the teaching box as well as this operation manual.

Keep this operation manual accessible for reference when necessary.




2.2 How to Order

How to order is shown below.

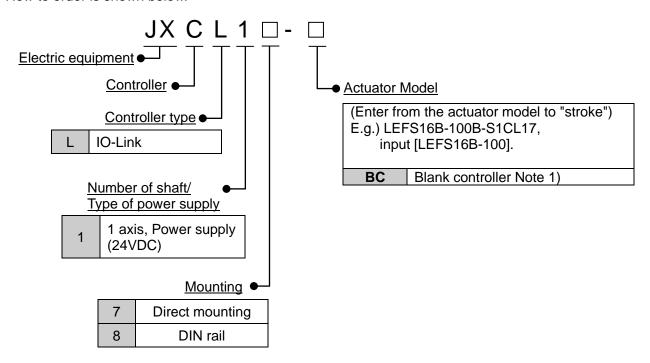


Note 1) Controllers with blank controller specifications (BC) are products to which actuator-specific data has not been written. To use them with this product, it is necessary to write data specific to the actuator to be used in the combination using dedicated software (ACT Controller2, JXC-BCW).

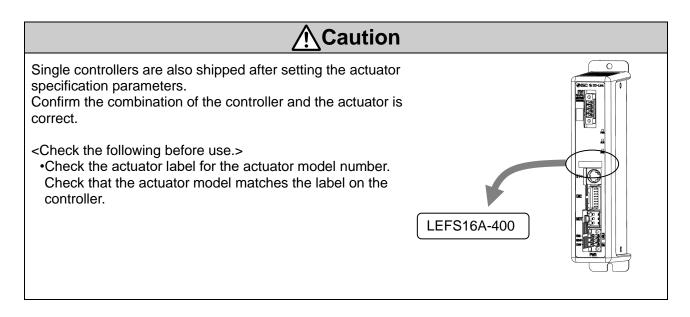



2.3 Product configuration

An example of the controller structure is shown below.

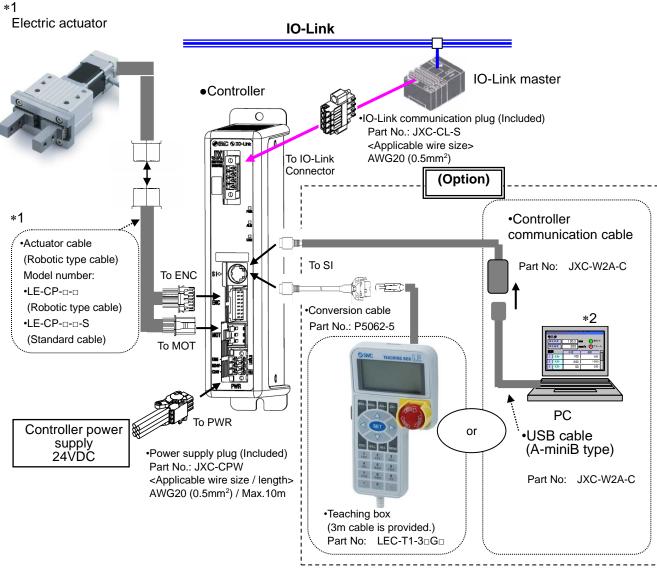

- *1. These items are included when ordered using the part number for an actuator set.
- *2. Latest version of the controller setting software must be used.

Software can be downloaded from SMC website. http://www.smcworld.com/

∕!**∖**Warning

Refer to **5. External Connections** for wiring.

Refer to 17. Precautions for wiring and cable when handling the wiring and cables.

Connect the PC and the communication cable for the controller settings with a USB cable.

Do not connect any devices other than the teaching box to the conversion cable.

Also, do not connect the teaching box directly to the PC.

If the controller is connected to a device other than the specified device or if it is connected incorrectly, the controller or PC may catch fire or be damaged.




2.4 Start up procedure


Install, wire, set and operate the controller referring to the procedure below when the product is used for the first time.


(1) Checking the contents of the package

After unpacking everything, check the description on the label to identify the controller and the number of accessories.

Product name	Quantity
Controller (JXCL1□-□)	1 pc.
Power supply plug (JXC-CPW)	1 pc.
IO-Link communication plug (JXC-CL-S)	1 pc.
Actuator *1	1 pc.

 

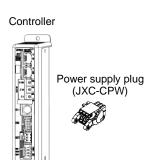

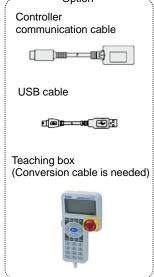

[Options]

- Controller communication cable(Part No: JXC-W2A-C)
- •USB cable (Part No: LEC-W2-U)
- •Teaching box (Part No: LEC-T1-3*G*)

If any parts are missing or damaged, please contact your distributor.

(2) Mounting the controller

Refer to section 3.4 Mounting for instructions on how to mount the controller.

(3) Wiring and Connection

Connect the cables to the controller.

Refer to **5. External Connections** for the wiring of the connectors.

(4) Supply of power

Supply power 24VDC to the JXC controller.

If the condition is normal, LED on the front of the controller turns ON as shown on the table below

Items	LED condition	Status
PWR	Green LED is ON	Supply power
ALM	OFF	No alarm

Refer to 8. LED display for the explanation of LED lamps.

If the red [ALM] LED on the front of the controller (JXC) is ON, an alarm has been triggered.

^Caution

When an alarm is generated

Refer to a corresponding memory of IO-Link or connect a PC or teaching box to the SI serial I/O connector and check the details of the alarm. Then, remove the cause of the error referring to the 18. Alarm for Motor Control.

* Please refer to the manuals of the controller setting software or the teaching box for details of the alarms.



(5) IO-Link master configuration

It is necessary to set the JXC controller to the IO-Link master.

First, supply power to the IO-Link master and the power supply L+/L- for communication with IO-Link. Then, install the IODD (I/O Device Description) file for JXCL1 in the IO-Link master configuration tool for setting the JXC controller to the master.

The IODD file can be downloaded from the SMC website.

(6) Establishment of IO-Link communication

When the setting of the IO-Link master and JXCL1 controller is completed and the IO-Link communication is established, the LED's on the front of the controller will be set as shown in the table below.

IO-Link communication starts when the power supply L+/L- for IO-Link communication and the C24V control power are supplied to the JXC controller.

Items	LED condition	Status
PWR	Green LED is ON	Supply power
ALM	OFF	No alarm
COM	Green LED flashing	IO-LINK communication established

Refer to **8. LED display** for the explanation of the LED's.

Communication between IO-Link master and controller is not established when the COM red LED is on.

Communication between the IO-Link master and the JXC controller is not established. Refer to 20. Troubleshooting.

Check if the communication speed of the IO-Link master and the JXC controller and the information of the host computer are correctly set.

(7) Setup of the operation parameters

Set up the step data (the operation pattern to specify the target position, speed, etc.) by using the controller setting software, the teaching box, or IO-Link communication.

When the step data (SMC parameters) is to be changed via IO-Link communication, be sure to upload all parameters from the JXCL1 controller before making the change.

When the step data is changed using the controller setting software or teaching box, turn off the IO-Link communication power supply L+/L- connected to the JXC controller and turn it on again to reflect the SMC parameters.

■PC (Normal mode)



■Teaching box



Please refer to the operation manual for the controller setting software and the teaching box for setting.

Refer to 10.2.2(2) SMC parameters.

(8) Test run

Refer to **10. Memory map** for the assignment of the memory.

Input signals by IO-Link communication for checking the operation. Refer to **15. Operation Instructions** for the operation.



3. Specifications

3.1 Specifications

Basic specifications of the product.


Item	Specifications		
Compatible motor	Step motor (servo 24 VDC)		
Power supply	Power supply vo	Itage: 24 VDC±10%	
Current consumption		100 mA or less (Controller) Refer to the specification of actuator to be connected for total power consumption.	
Compatible encoder	Incremental A/B	phase (800 pulse/rotation)	
Memory	EEPROM		
	LED	Details	
LED display	PWR	Power supply	
	ALM	Alarm status	
	СОМ	IO-Link communication status.	
Locked	With unlocking terminal		
Cable length	Actuator cable: 20 m or less		
Cooling method	Air-cooling type		
Operating temperature range	0°C to 40°C (version S1.*/S2.*/V1.*/V2.*) 0°C to 55°C (Version S3.*/V3.* or later) No freezing		
Operating humidity range	90% RH or less (No condensation)		
Insulation resistance	Between the external terminals and case 50 M Ω (500 VDC)		
Weight	190 g (Direct mounting type) 210 g (DIN rail mounting type)		


[IO-Link communication]

Items	Specification
Protocol	IO-Link (Version1.1)
Communication speed	COM3(230.4kbps)
Communication cable	4 wire unshielded cable (conductor resistance 3 ohms or less, line capacitance 3 nF or less, length 20 m or less).
IO-Link port Class	Class A
Setup file	IODD file (Download from SMC web site).
Process data length	Input 14 bytes / output 22 bytes
Process data minimum cycle time	2.4 ms
Vendor ID	0x0083
Device ID	0x00013E
Network topology	1:1
SIO mode	Not applicable

3.2 Parts Description

Details of the parts of the controller.

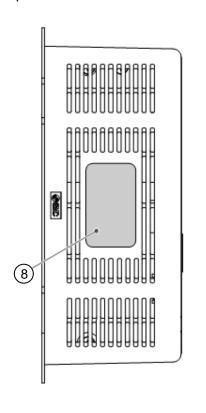

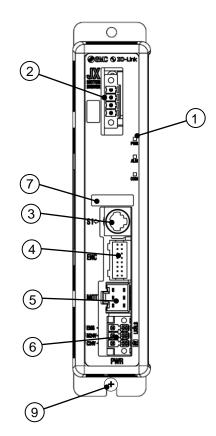



No.	Display	Name	Details	
1	-	Display	LED's to indicate the controller status.	
2	-	IO-Link communication connectors	For connection to the IO-Link communication	
3	SI	Serial I/O connector (8 poles)	Connector for the teaching box (LEC-T1) or the controller communication cable (JXC-W2A-C).	
4	ENC	Encoder connector (16 poles)	Connect to the actuator cable.	
5	MOT	Motor driving connector (6 poles)	Connect to the actuator cable.	
6	PWR	Power supply connector (5 poles)	Connect to the controller power supply (24VDC) using the power supply plug. Control power (+), Stop signal (+), Motor power (+), Lock release (+), Common power (-)	
7	-	Applicable actuator part number label	Label indicating the actuator part number which can be connected to the controller.	
8	-	Controller part number label	Label indicating the controller part number.	
9	-	FE	Functional Ground When the controller is mounted, tighten screws and connect the grounding cable.	

3.3 External Dimensions


The appearance of this product is as shown in the diagram below:


(1) Screw mounting (JXCL17-□)

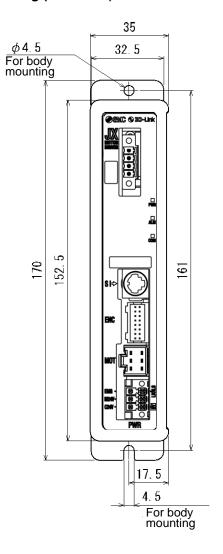

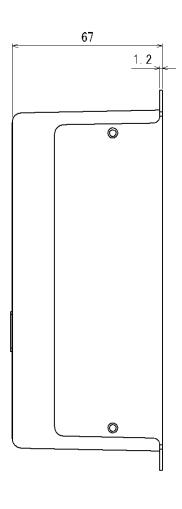

(2) DIN rail mounting (JXCL18--)

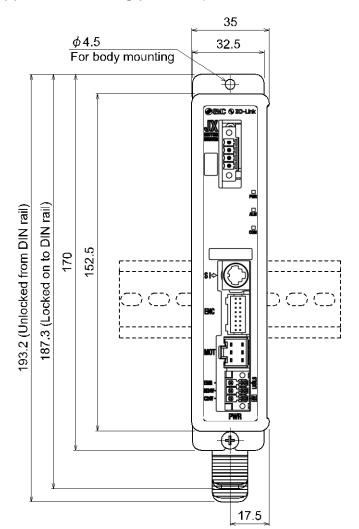

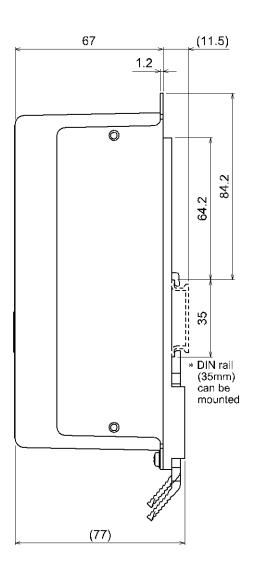


3.4 Mounting

(1) Mounting

The controller can be direct mounted using screws or mounted on a DIN rail. Details of the controller mounting options are shown below.


[1]Thread mounting (JXCL17)

(Mounting with two M4 screws)

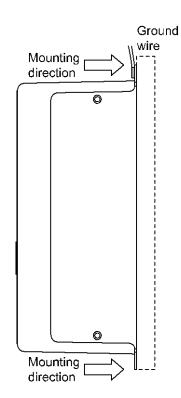


[2]DIN rail mounting (JXCL18)

(Mounting with DIN rail)

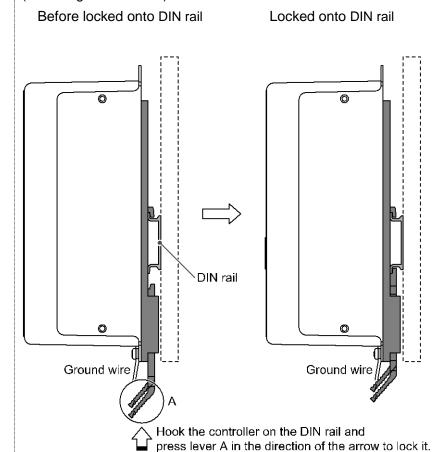

(2) Grounding

Place the grounding cable with crimped terminal between the M4 screw and shakeproof washer as shown below and tighten the screw.

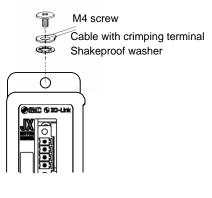

Controller

ACaution


The M4 screw, cable with crimped terminal and shakeproof washer must be prepared by the user. The controller must be connected to Ground to reduce noise.



A Caution

- (1) A dedicated Ground connection must be used. Grounding should be to a D-class ground (ground resistance of 100Ω or less).
- (2) The cross sectional area of the grounding cable shall be 2mm² minimum.

The Grounding point should be as near as possible to the controller. Keep the grounding cable as short as possible.

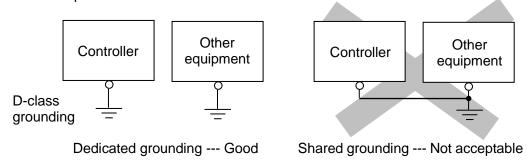

(3) Mounting location


Design the size of the control panel and the installation type so that the temperature surrounding the controller is within the operating temperature range.

Mount the controller vertically on the wall with 30mm or 50 more of space on the top and bottom of the controller as shown below.

Allow 60mm or more of space between the front of the controller and the cover of the control cabinet to allow access to the connectors.

Leave enough space between the controllers so that the operating temperatures of the controllers stay within the specification range.

Avoid mounting the controller near a vibration source, such as a large electromagnetic contactor or circuit fuse breaker on the same panel, or keep it away from the controller.

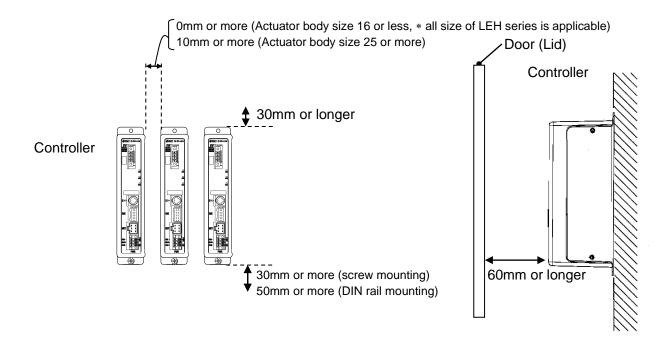

ACaution

If the mounting surface for the controller is not flat or is uneven, excessive stress can be applied to the case, which can cause failure. Mount on a flat surface.

4. Initial Setting

4.1 IO-Link master configuration

■IODD file

The IODD file is used for mapping the JXC controller to the IO-Link master.

The IODD file is a device definition file which provides all properties and parameters required for establishing operation and communication of the JXC controller.

The IODD includes the main IODD file and a set of image files such as vendor log, device picture and device icon.

Refer to the operation manual for the IO-Link master for installing the IODD file.

The IODD file for the JXCL1 can be downloaded from the SMC Web site.

•URL: http://www.smcworld.com

Documents / Download→Instruction Manuals →SMC-JXCL17JXCL18_*******.zip

•Contents of SMC-JXCL1 v**.zip

IODD file: SMC-JXCL17JXCL18-******-IODD1.1.xml

Device symbol: SMC-JXCL17JXCL18-pic.png Device icon: SMC-JXCL17JXCL18-icon.png

Vendor logo: SMC-logo.png

^Caution


When the parameters are to be changed using IO-Link communication, upload all parameters from the JXCL1 controller before making the change.

SMC parameter settings ("basic parameter" "Origin parameter" "Drive parameter" "Step data") are different depending on the connected actuator. The initial value for the IODD is a default value only. When parameters are changed using IO-Link communication, it is necessary to upload the parameters for the connected actuator from the JXCL1 controller to reflect the parameters to the IO-Link master setting tool.

5. External Connections

An example of standard wiring of the controller is shown for each connector.

5.1 PWR: Power supply connector

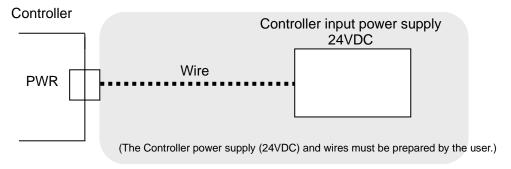


* Refer to 6. PWR: Power supply plug specifications for wiring.

!Caution


For the controller input power supply, use a power supply with a capacity that is not less than the "maximum power (or instantaneous maximum power)" specified for the electric actuator.

5.2 MOT: Motor connector, ENC: Encoder connector


Connect the controller and the actuator with the actuator cable (LE-CP- \square)

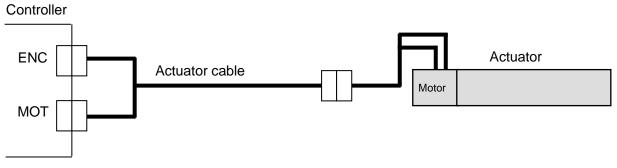

5.3 SI: Serial I/O Connector

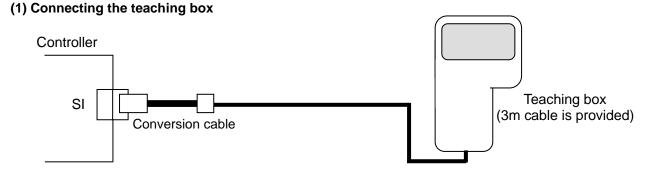

(2) Connection with a PC

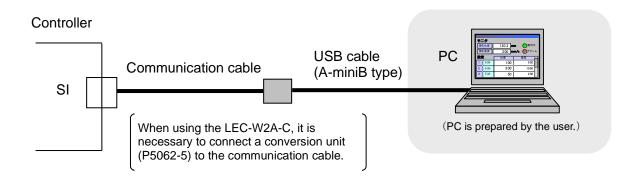


5.4 IO-Link communication connector

Connect one JXCL1 controller to the IO-Link master port.

The IO-Link communication cable and IO-Link master must be prepared by the user.


IO-Link communication starts when the power supply L+/L- for IO-Link communication and control the C24V power are supplied to the JXC controller.

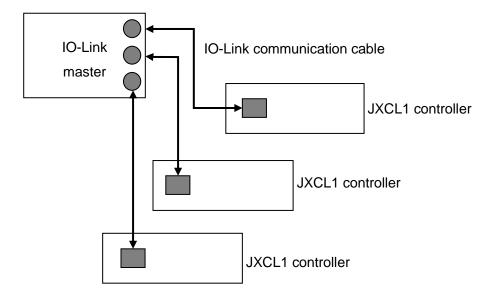

6. Details of Power Supply Plug

6.1 PWR: Power supply plug specifications

The specifications of the power supply plug supplied with the controller are shown below.

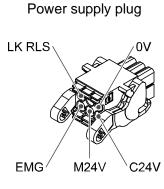

Pin No.	Terminal	Function	Functional explanation
1	C24V	Power supply (+)	The positive control power.
2	M24V	Motor power (+)	The positive power for the actuator motor to be supplied via the controller.
3	EMG	Stop (+)	The positive power for Stop signal
4	0V	Common power (-)	The negative common power for M24V, C24V, EMG and LK RLS.
5	-	NC	N/A
6	LK RLS	Unlocking (+)	The positive power for lock release.

^{*} Equivalent to Phoenix Contact: DFMC1, 5/3-ST-LR

6.2 Electrical Wiring Specifications


Prepare the electrical wiring according to the following specifications (to be prepared by the user).

Item	Specifications
Applicable wire size	Single, stranded wire → AWG20 (0.5mm²) / Max. 10m * The rated temperature of the insulation coating should be 60°C or more. The O.D. should be Ø2.5mm or less.
Stripped wire length	ø2.5mm or less 8mm
Wire length	10 m or less

<u> </u>
Do not connect multiple wires to one terminal.

After wiring the power supply plug, connect it to PWR power connector of the controller.

* Refer to 6.3 Power Supply Plug Wiring for wiring.

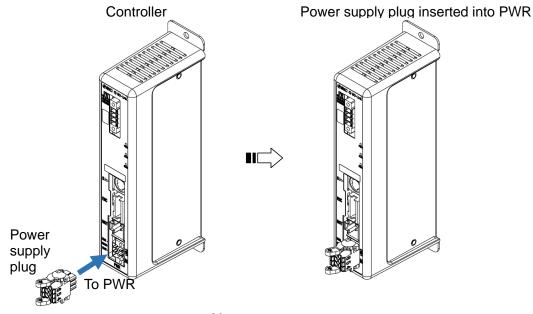


6.3 Power Supply Plug Wiring

Connect the power supply plug to the 24VDC controller power supply according to instructions (1) (2) and (3) and then insert it into the PWR connector of the controller.

(1) Wiring of power supply (C24V, M24V, 0V)

 Connect the positive of the 24VDC controller power supply to the C24V and M24V and connect the negative of that power supply to the 0V terminal.



■Open/close lever

Press the open / close lever with a dedicated screwdriver and insert the wire into the wire entry.

Dedicated screw driver (Recommended)
 Phoenix Contact
 (Product No.SZS0.4 x 2.0)

(2) Wiring of the stop switch (EMG)


Stop switch must be installed by the user to stop the actuator in abnormal situations. Refer to **6.4 Wiring of stop circuit for wiring.**

(3) Wiring of the lock release (LK RLS)

Install an unlocking switch for adjustment or recovery during an emergency of the locking actuator.

* Switch (24V DC, contact capacity 0.5A or more) is provided by customer.

One terminal of the lock release switch should be connected to the 24VDC power supply and the other should be connected to the LK RLS terminal. When this is switched on, the lock will be released.

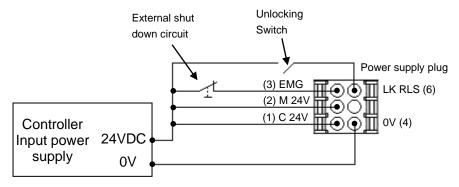

⚠Caution

- (1) It is unnecessary to connect LK RLS terminal when the actuator does not have locking mechanism.
- (2) The LK RLS terminal is only used for adjustment and emergency return. It must not be energized during normal operation.


6.4 Wiring of stop circuit

The actuator stops its operation when the external stop switch or the stop switch of the teaching box is activated.

(1)Stop (example of recommended circuit)

When the controller recognizes the connection of the teaching box, the stop of the teaching box is activated.

(Circuit example)

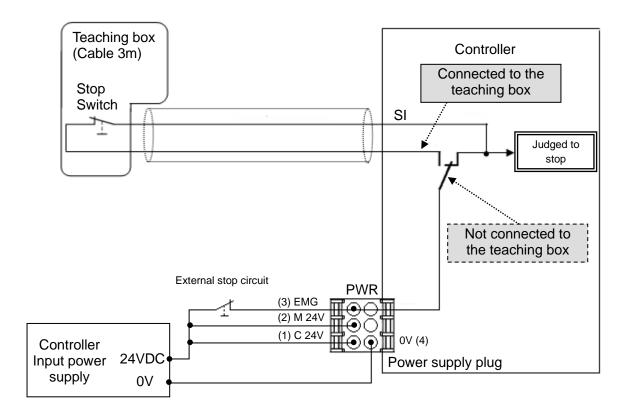


Marning

The teaching box's stop switch is effective only for the controller that is connected to it.

(2) Stop (relay contact (1))

If the system where this controller is installed has a stop circuit for the whole system, or if the system has multiple controllers with individual power supply, relay contacts should be made between the 24VDC controller power supply and the EMG terminal of the power supply plug.

(Circuit example)

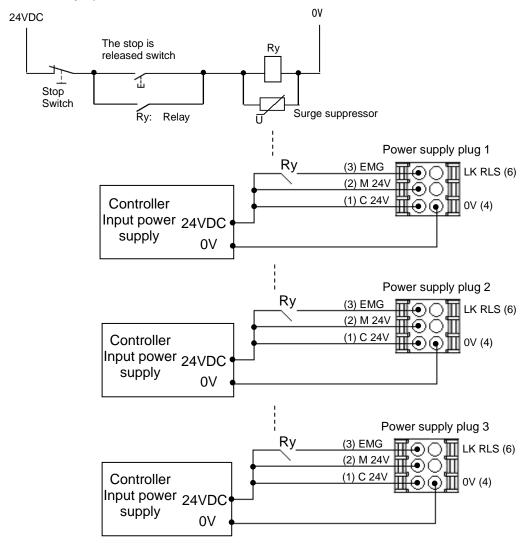


Caution

When shutdown is input, the controller stops with maximum deceleration, then the motor is turned OFF.

(3) Motor power shutdown (relay contact (2))

If it is necessary to have a circuit to shutdown the motor power externally, relay contacts should be made between the 24VDC controller power supply and the M24V and EMG terminal of the power supply plug.

(Circuit example)

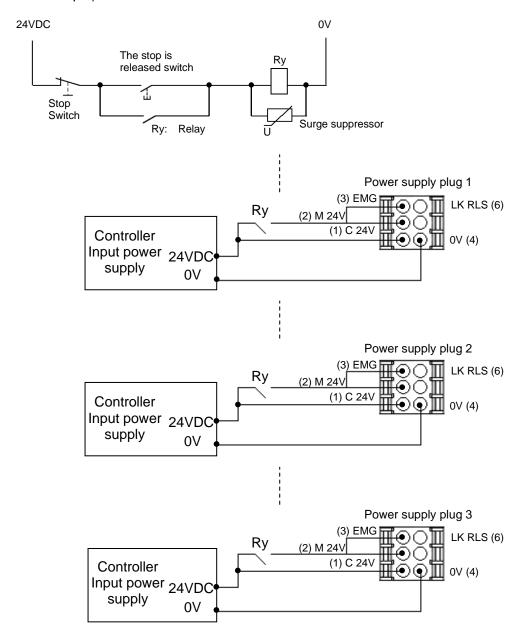

<u>∕</u> Warning

 
- (1) Relay contacts should be made between the 24VDC controller power supply and the M24V and EMG terminal of the power supply plug. The actuator may make unexpected movement.
- (2) Do not perform return to origin (SETUP) when motor drive power (M24V) is disconnected. The controller cannot recognize the correct origin point if a return to origin instruction is made with the motor drive power (M24V) disconnected.
- (3) Do not energize the LK RLS terminal while the motor drive power (M24V) is disconnected.



7. IO-Link communication plug

7.1 IO-Link communication plug specification

Specifications for the IO-Link communication plug.



Pin No.	Terminal	Functions
1	L+	+24 VDC for IO-Link communication power supply. IO-Link communication starts when the power supply L+/L- and C24V control power are supplied to the JXC controller.
2	N.C.	Not connected
3	L-	0 VDC for IO-Link communication power supply
4	C/Q	IO-Link signal.

* Phoenix Contact product number: FMC1,5/4-STF-3,5 or equivalent.


7.2 Electric Wiring Specifications

Prepare the wiring according to the following specifications (to be prepared by the user).

Description	Specification
Applicable wire size	Single wire, stranded wire ⇒ AWG24-16 (0.2-1.5 mm²) * The rated temperature of the insulation coating should be 60°C or more. The O.D. should be Ø2.5 mm or less. * Conductor resistance 3 ohms or less * Conductor capacitance 3 nF or less
Stripped wire length	φ2.5mm or less 48-10mm
Cable length	20 m or less

Do not connect multiple wires to one terminal.

After wiring the IO-Link communication plug, connect it to the IO-Link connector on the controller.

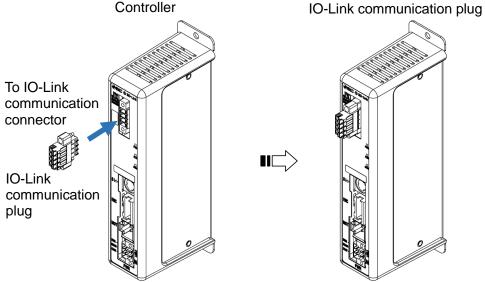

⚠ Caution

Do not connect or disconnect the IO-Link communication plug while IO-Link communication or power is connected.

Otherwise, the circuit in the controller may be damaged.



8. LED display

8.1 LED display

Refer to the table below for details of the LED status.

LED	Details					
PWR	Power supply status.	OFF	Power is not supplied Red ALM is on when an alarm is generated.			
	Status.	Green LED is ON	Power is supplied			
ALM	Controller alarm status.	OFF	Normal operation			
		Red LED is ON	Alarm generated			
0011	IO-Link communication status (*1)	Green LED is ON	IO-Link communication is not established IO-Link communication error C/Q line not connected			
СОМ		OFF	IO-Link power supply L+/L- is not connected or C24V power supply is not connected			
		Green LED is flashing	No error in IO-Link communication			

^{*1)} IO-Link communication starts when the power supply L+/L- and the C24V control power are supplied to the JXC controller.

8.2 LED and Controller Status

Refer to the table below for the LED and the controller status.

Controller status		LED description				
Cont	Toller Status	PWR	ALM	COM		
When power is supplied		Green LED is ON	LED is OFF	_		
	Normal communication	_	_	Green LED is flashing		
IO-Link communication (*1)	Communication not established IO-Link communication error C/Q line not connected	_	LED is OFF	Green LED is ON		
	Power supply (L+/L-) not connected	_	Red LED is flashing	LED is OFF		
	Power supply C24V is not connected	LED is OFF	LED is OFF	LED is OFF		
	Controller system error generated	LED is OFF	Red LED is ON	_		
Motor controller	Controller system error generated	Green LED is ON	Red LED is ON	_		
	Writing to controller EEPROM	Green LED is flashing	_	—		

^{-:} LED display is unstable

<u>∕!</u>\Caution

Do not turn OFF the power supply for the controller or disconnect and connect the cable while data is being written to EEPROM (PWR LED (green) is flashing).

* This is to avoid the possibility of incorrect / corrupt data (step data, parameter)



^{*1)} IO-Link communication starts when the power supply L+/L- and the C24V control power are supplied to the JXC controller.

9. Operation methods

9.1 Outline

The controller is able to operate the connected actuator using "Operation by Step No." or "Operation by numerical instruction" via IO-Link communication.

Operation by Step No.: Operation using the preset step data.

Operation by numerical instruction: Operation by specifying the position and speed numerically.

Operation items which cannot be expressed numerically will use the contents of the selected step data.

9.2 Operation by Step No.

Instructions and monitoring of the movement of the actuator are possible by reading/writing the memory bits corresponding to the input/output port signals (e.g. DRIVE, INP) using a IO-Link master (or PLC).

When an operation is based on the preset step data, select the step data No. then activate the DRIVE signal.

12 parameters can be instructed using step data (Movement mode, Speed, Position, Acceleration, Deceleration, Pushing force, Trigger LV, Pushing speed, Moving force, Area 1, Area 2, In position).

Refer to 11.1 Step data.

Refer to 14.2 Operation procedure for Operation by Step No..

9.3 Operation by numerical instruction

When numerical data relating to the actuator speed, position etc. is sent, the actuator will execute this data provided it is within the allowable range of values.

In the operation by numerical instruction, it is necessary to specify 12 operational items as operation by step No.

Movement mode, Speed, Position, Acceleration, Deceleration, Pushing force, TriggerLV, InPosition are all instructed numerically.

Pushing speed, Moving force, Area 1 and Area 2 use the contents of the selected step data.

The other 8 step data items become invalid (Movement mode, Speed, Position, Acceleration, Deceleration, Pushing force, TriggerLV, InPosition).

Provide numerical data to the numerically instructed items, and then select the number of the step data used for other items using the IN0-IN5 signal. Then, set the start flag ON(1) to start the operation.

Refer to 11.1 Step data.

Refer to 14.3 Operation procedure for operation by numerical instruction.

Preparatory operations such as turning the servo on and performing a return to origin are required before the actuator may execute numerical data.

9.4 Position/speed monitor

Reads the current position and current speed for monitoring. Refer to **10. Memory map** for the current position and speed.



10. Memory map

10.1 Process data

10.1.1 Process data input (from JXCL1 controller to IO-Link master)

(1) Process data input list

Byte No.	Signal name Description		
0,1	Controller status flag	Flag to indicate the controller (actuator) status	-
2-5	Position	Current actuator position	0.01mm
6,7	Speed	Current actuator speed.	mm/s
8,9	Pushing F	Current actuator pushing force	%
10-13	Target Pos	Target position of the actuator	0.01mm

(2) Process data input details

• Byte 0,1h: Controller status signal

Byte No.	Bit	Signal name	Description			
	0	OUT0	When the operation is started and "DRIVE" is turned OFF, the step No. executed by "DRIVE" will be refreshed/updated			
	1	OUT1	by the combination of "OUT0" to "OUT5" (binary digit).			
	2	OUT2	(E.g.) Step data No.3 is output OUT5 OUT 4 OUT 3 OUT 2 OUT 1 OUT 0 OFF OFF OFF OFF ON ON			
	3	OUT3	<u> </u>			
0	4	OUT4	(1) When "RESET" is turned ON, these signals turn OFF. (2) During the alarm, these signals output the alarm group.			
	5	OUT5	(3) During the pushing operation, if the actuator runs over the defined pushing width, these signals turn OFF.			
	6	INIT	After C24V power is supplied, this signal turns on when there are no problems with the controller and the motor drive circular is ready to operate. Once this signal is ON, it does not turned off until the power supply is disconnected.			
	7	-	-			
	0			This terminal is ON during the movement of the actuator (during the positioning operation, etc.).		
		BUSY	∕ !\Caution			
1		5 5501	During the pushing operation without movement (no movement but the actuator generating the pushing force), "BUSY" is OFF.			
	1	SVRE	When the servo motor is OFF, "SVRE" is OFF. When the servo motor is ON, "SVRE" is ON.			
	2	SETON	When the actuator is in the SETON status (the position information is established), this signal turns ON. When the position status is not established, this signal is OFF.			

Byte No.	Bit	Signal name	Description			
			The condition when "INP" turns ON depends on the actuator action. •Return to origin Turns ON at the origin when within the ±"default in position" in the Basic parameters. •During positioning operation Turns ON when the current position is within "Step data position +/- positioning range". •During pushing operation Turns ON when the pushing force exceeds the value set in the step data "Trigger LV".			
1	3	INP	After the pushing operation is completed, even if it switches automatically to energy saving mode, "INP" remains ON. When movement starts again from the pushing stopped state, pushing operation is repeated with the normal pushing force. (E.g.) Step data "force" is 100% Step data "Trigger LV" is 80% The energy saving setting of the actuator is 40% The actuator model determines the energy saving settings. Please refer to the manual of the actuator for more details. Pushing force (%) INP output [ON] Tligger LV			
			When the actuator is within the output range between Area1 and			
	4	AREA	Area2 in the step data, this terminal will turn ON. The area output setting range changes depending on the active step data.			
	5	WAREA	When the actuator is within the output range between "W area 1 and W area 2" of basic parameter, this terminal will turn ON.			
	6	ESTOP	During activation of the Teaching Box stop switch, this signal is ON. During the normal operation, it is OFF. This is synchronized to the input for the EMG signal on the controller PWR connector.			
	7	ALARM	ALARM turns on when an IO-Link "event" occurs in the JXC controller. •Alarm for Motor Control has been generated. •C24V has not been supplied to the controller. A generated "event" can be confirmed using Device Status (Index 0x0024,SubIndex 0x00) and Detailed Device Status (Index 0x0025,SubIndex 0x01/0x02) in the device parameters for IO-Link communication. When an alarm relating to the motor control is generated, the contents can be checked in the current alarm in the SMC parameters (Index 0050,SubIndex 0x01-0x04). ALARM is off when no "event" has been generated.			

The table below shows the changes in the output signal with respect to the state of the controller.

Status Output signal	BUSY	INP	SVRE	Lock	SETON	OUT0to5
During stopping when "SVON" is OFF after turning ON the power supply to the controller	OFF	OFF	OFF	Lock	OFF	OFF
During stopping when "SVON" is ON after turning ON the power supply to the controller	OFF	OFF	ON	Unlock	OFF	OFF
During returning to origin	ON	OFF	ON	Unlock	OFF	OFF
The actuator is at the origin. On completion of "SETUP"	OFF	ON(*1)	ON	Unlock	ON	OFF
During movement by positioning/pushing operation	ON	OFF	ON	Unlock	ON	ON(*2)
The actuator is paused by "HOLD"	OFF	OFF	ON	Unlock	ON	ON(*2)
On completion of the positioning operation	OFF	ON(*4)	ON	Unlock	ON	ON(*2)
Stopped due to pushing a workload in pushing operation	OFF	ON	ON	Unlock	ON	ON(*2)
Stopped due to no detection of workload during a pushing operation	OFF	OFF	ON	Unlock	ON	OFF
During stopping when "SVON" is OFF after returning to the home position	OFF	OFF(*4)	OFF	Lock	ON	ON(*3)
EMG signal stop from the PWR connector when the actuator is at the origin	OFF	OFF(*4)	OFF	Lock	ON	OFF

^{*1} The signal turns ON when the actuator is within the range defined in the basic parameter setup.

Byte 2-5: Current position

Byte No.	Signal name	Description	Unit
2	Position(HH)	Current position of the actuator is shown in a multiple of	
3	Position(HL)	0.01mm. (*5)	0.04
4	Position(LH)	E.g.) 800.00[mm](80000d=13880h) is output.	0.01mm
5	Position(LL)	Byte2-5: Current position = 00013880h	

Byte 6,7: Current speed

Byte No.	Signal name	Description	Unit
6	Speed(H)	Current speed of the actuator is shown in a multiple of 1mm/s.	4
7	Speed(L)	E.g.) 300[mm/s](300d=012Ch) is output. Byte6,7: Current speed = 012Ch	1mm/s

Byte 8,9: Current pushing force

Byte No.	Signal name	Description	Unit
8	Pushing F(H)	Current pushing force of the actuator is shown in	40/
9	Pushing F(L)	multiples of 1%	1%

Byte 10-13: Target position

Byte No.	Signal name	Description	Unit
10	TargetPos(HH)	Target position of the actuator is shown in multiples of	
11	TargetPos(HL)	0.01mm when numerical data can be read.	0.01mm
12	TargetPos(LH)	E.g.) When 800.00[mm](80000d=13880h) is input. (*5)	0.0
13	TargetPos(LL)	Byte10-13: Target position = 00013880h	

^{*5} Please refer to 21. Handling of sent/received data for handling of the data



^{*2} The signal is updated on the transition of (ON \rightarrow OFF) of the DRIVE signal.

^{*3} Retains the previous state.

^{*4} The signal turns ON when the actuator is "In position" according to the step data.

10.1.2 Process data output (from IO-Link master to JXCL1 controller)

(1) Process data output list

Byte No.	Signal name	Description	Unit
0,1	Controller control flag	Controller control signal	-
2	Run	Execution flag for numerically instructed operation	-
3	Move	Operating mode (for numerically instructed operation)	-
4,5	Speed	Speed (for numerically instructed operation)	1mm/s
6-9	Target Posn	Position (for numerically instructed operation)	0.01mm
10,11	Accel	Acceleration (for numerically instructed operation)	1mm/s ²
12,13	Decel	Deceleration (for numerically instructed operation)	1mm/s ²
14,15	PushingF	Pushing force (for numerically instructed operation)	1%
16,17	TriggerLV	TriggerLV (for numerically instructed operation)	1%
18-21	InPosition	InPosition (for numerically instructed operation)	0.01mm

(2) Process data output details • Byte 0: Controller control signal

Byte No.	Bit	Signal name	Description			
	0	IN0	The step data No. instruction the drive will be specified by the combination of "IN0" to "IN5" (binary digit).			
	1	IN1	E.g.) Step data No.3 has been assigned			
			IN5 IN4 IN3 IN2 IN1 IN0			
	2	IN2	OFF OFF OFF ON ON			
	3	IN3	∴ Caution			
0	4	IN4	Be sure to decide the step data No. via the "IN*" signal before turning "DRIVE" ON.			
	5	IN5	Otherwise, the actuator might operate with unexpected step data.			
	6	_	Set always OFF(0)			
	7	Safe speed	When the "Safe speed" flag is ON, the operation will start with limited speed range when the operation is executed. This is valid for all operation instructions. The flag is invalid if it is turned on during operation. The Safe speed value is different depending on the actuator type.			

Byte No.	Bit	Signal name	Description
	0	HOLD	If "HOLD" is turned ON during operation, the speed decreases at maximum deceleration set in the basic parameters until the actuator stops. The remaining stroke will be on hold as long as "HOLD" is ON and when "HOLD" is turned OFF, the actuator restarts and travels for the remaining stroke. •When "DRIVE" or "SETUP" is ON DRIVE ON ON HOLD ON HOLD ON HOLD ON SETUP OFF Speed Caution (1) Do not turn on "SETUP", "DRIVE", "JOG+/JOG-" or Start flag when "HOLD" is ON. The actuator may make unexpected movement. (2) The signals are rendered invalid whilst "HOLD" is in operation.
			"SVON" signal turns the servo motor ON. When "SVON" is ON, the servo motor will be turned ON. When it is OFF, the servo motor will be turned OFF.
	1	SVON	(1) When "SVON" is ON for the first time after supplying power to the controller, the actuator moves several mm to improve the control accuracy. (2) When "SVON" is OFF, turn OFF "DRIVE" and "SETUP".
1	2	DRIVE	An instruction to start the step No. operation. DRIVE reads IN0 to IN5 when it is turned on and will start the data for the instructed step number. (*6) Then, when "DRIVE" is turned OFF, the number of the active step data will be output via the "OUT0" to "OUT5" signals.
	3	RESET	"RESET" is a signal to reset the alarm and the operation. After "RESET", the speed decreases at maximum deceleration of the basic parameter until the actuator stops. "INP" and "OUT0" to "OUT5" will be turned OFF (however, if the actuator is stopped within the in-position range, "INP" will turn ON).
	4	SETUP	When "SVRE" is ON, the "SETUP" operation (return to origin operation) will be performed. During the "SETUP" operation, "BUSY" will turn ON. After completion of the "SETUP" operation, "SETON" and "INP" will turn ON.
	5	JOG(-)	Jogging in the (-) direction. The actuator moves when the signal is ON and stops when the signal is OFF. When the "FLGTH" (signal for switching Jogging and Inching) is ON, movement towards the (-) side is made according to the "JOG(-)" signal. "INP" and "OUT0" to "OUT5" are OFF during Jogging/Inching. When Jogging/Inching is completed, "INP" will turn ON, but "OUT0" to "OUT5" will remain OFF. The speed for jogging or inching can be changed using the JOG speed set value: Index 0x0045, SubIndex 0x01" of operation parameter.
	6	JOG(+)	Jogging in the (+) direction. Operation is the same as "JOG(-)". with "-" changed to "+"
	7	FLGTH	FLGTH switches the function (Jogging and Inching) of Jogging signal "JOG(-)" and "JOG(+)". Inching starts when this signal is ON and when the Jogging signal turns ON. Moving distance for inching is based on the set value of the "travel distance" in the operation parameter: Index 0x0045, SubIndex 0x05". The speed is based on "JOG speed: Index 0x0045, SubIndex 0x01" like jogging. Jogging starts when this signal is OFF. VE" is turned ON while operating, it might lead to unexpected operation.

^{*6} Turn ON "DRIVE" while stopping. If "DRIVE" is turned ON while operating, it might lead to unexpected operation.

- 32 -



Byte 2: Start flag

Byte No.	Bit	Signal name	Description
2	0	Run	An instruction to start the operation by numerical instruction. When the start flag "Run" moves to ON status from OFF status, operation starts based on the step data specified by IN0-IN5 with the descriptions of Byte 3-21. When the Start flag "Run" moves to OFF status from ON status, the base step No. is output to the OUT signal. (*7, *8, *9) As the description of Byte3-21 is always reflected for numerically instructed operation of JXCL, enter numeric values to Byte3-21.
	1-7	_	Set always OFF(0)

Byte 3: Movement mode

Byte No.	Bit	Signal name	Description		
3	0-1	Move	10Movement modebit0=ON:ABS (Absolute)011:ABS (Absolute)bit1=ON:INC (Relative)102:INC (Relative)bit1,0= Simultaneous OFF or ON: Invalid00Invalid(*7 *10)		
	2-7		Set always OFF(0)		

Byte 4,5: Speed

Byte No.	Signal name	Description	
Byte No.		Input range	Min. unit
4	Speed (H)	4 to Design are restored Maximum and add (17, 144)	1mm/s
5	Speed (L)	1 to Basic parameters"Maximum speed" (*7, *11)	

Byte 6-9: Position

Byte No.	Signal name	Description	
Byte No.	Signal name	Input range	Min. unit
6	Target Pos (HH)		
7	Target Pos (HL)	Basic parameter"Stroke(-)" - "Stroke (+)"	0.01 mm
8	Target Pos (LH)	(*5, *7, *11)	0.01 111111
9	Target Pos (LL)	(- , , ,	

Byte 10,11: Acceleration

Byte No.	Signal name	Description	
Byte No.		Input range	Min. unit
10	Accel (H)	1 Pagio parameters "May ACC/DEC" (+7 +11)	1 mm/c2
11	Accel (L)	1 ~ Basic parameters "Max ACC/DEC" (*7, *11)	1 mm/s ²

● Byte 12,13: Deceleration

Duto No	Signal name	Description	
Byte No.		Input range	Min. unit
12	Decel (H)	1 Pagis parameters "May ACC/DEC" (+7 +11)	1 mm/c2
13	Decel (L)	1 ~ Basic parameters "Max ACC/DEC" (*7, *11)	1 mm/s ²

- *5 Please refer to 21. Handling of sent/received data for handling of the data.
- *7 Change the numerical data input flag and the numerical data only when the start flag is OFF.

 If the numerical data input flag or the numerical data are changed when the start flag is ON, it may lead to unexpected operation.
- *8 Turn ON the start flag from OFF only when stopped. If the numerical data input flag or the numerical data is changed while operating, it may lead to unexpected operation.
- *9 To avoid unintentionally changing the numerical data, it is recommended to turn OFF the start flag after starting an operation.
- *10 Do not input numbers other than [1(ABS)] and [2(INC)].
- *11 The actuator model determines the limit for the input values. If they are outside the specification range, there is a possibility of operation abnormality or product failure. Please refer to the manual of the actuator for more details.



● Byte 14,15: Pushing force

Byte No.	Signal name	Description	
Byte No.		Input range	Min. unit
14	PushingF (H)	.7.144	1%
15	PushingF (L)	*7 *11	1 70

● Byte 16,17 :Trigger LV

Duto No	Signal name	Description	
Byte No.		Input range	Min. unit
16	Trigger LV (H)	(17.144)	1 mm/s ²
17	Trigger LV (L)	(*7 *11)	1 111111/5-

Byte18-21: In-Position

5 - y 10 10 - 11 11 11 11 11 11 11 11 11 11 11 11 1				
Duto No	Cianal name	Description		
Byte No.	Signal name	Input range	Min. unit	
18	InPosition (HH)		0.01 mm	
19	InPosition (HL)	(.7.44)		
20	InPosition (LH)	(*7 *11)	0.01 111111	
21	InPosition (LL)			

^{*5} Please refer to 21. Handling of sent/received data for handling of the data.

^{*7} Change the numerical data input flag and the numerical data only when the start flag is OFF. If the numerical data input flag or the numerical data are changed when the start flag is ON, it may lead to unexpected operation.

^{*11} The actuator model determines the limit for the input values. If they are outside the specification range, there is a possibility of operation abnormality or product failure. Please refer to the manual of the actuator for more details.

10.2 Parameter

10.2.1 Direct parameter (Page 1)

Address	Parameter name	Data size	Access *1	Description
0x07	VendorID(MSB)	1byte	ם	Vendor ID: 0x0083 (131 [dec])
0x08	VendorID(LSB)	1byte	R	
0x09	DeviceID(MSB)	1byte		
0x0A	DeviceID	1byte	R	Device ID: 0x00013E (318[dec])
0x0B	DeviceID(LSB)	1byte		

^{*1} R: Read W: Write

10.2.2 ISDU parameter

(1) Device parameter

Index	Sub Index	Parameter name	Data type *2	Access *1	Description	Data storage
0x0002	0x00	SystemCommand	UINT8	W	Refer to (1-1)	N
0x000C	0x00	DeviceAccessLocks	UINT16	R/W	Refer to (1-2)	N
0x0010	0x00	VendorName	STR64	R	SMC Corporation	N
0x0011	0x00	VendorText	STR64	R	www.smcworld.com	N
0x0012	0x00	ProductName	STR64	R	JXCL17/JXCL18	N
0x0013	0x00	ProductID	STR64	R	JXCL17/JXCL18	N
0x0014	0x00	ProductText	STR64	R	Step Motor Controller	N
0x0015	0x00	SerialNumber	STR8	R	Controller Serial No	N
0x0016	0x00	HardwareRevision	STR64	R	HW-V*.**	N
0x0017	0x00	FirmwareRevision	STR64	R	FW-V*.**	N
0x0018	0x00	ApplicationSpecificTag	STR32	R/W	Characters between 16 and 32 can be set. Refer to the table below for the initial value.	Y
0x0024	0x00	DeviceStatus	UINT8	R	Refer to (1-3)	N
0x0025	0x01 0x02	DetailedDeviceStatus	STR3	R	Refer to (1-4)	N

^{*1} R: Read, W: Write

(1-1) System Command (Index:0x0002, Sub Index:0x00) The following commands are available in the JXCL1 controller.

Command	Command name	Description
0x05	ParamDownloadStore	Back-up of the parameter set data. When the JXC controller receives a command, the JXC controller will upload the parameter set data in the controller to the master.

 ^{*2} UINT8: Unsigned Integer(1byte), UINT16: Unsigned Integer(2bytes), STR**: String(Max**bytes)
 *3 Y: Included in the data storage N: Not included in the data storage

Refer to **10.3 Data strorage** for Data strage.

(1-2) Device AccessLocks (Index:0x000C, Sub Index:0x00)

Locking and unlocking of the data storage function can be set in the JXC controller. Refer to **10.3 Data strorage** for Data strage.

Value	Description
0 (Default)	Unlock the data storage function (data storage function is enabled)
2	Lock the data storage function (data storage function is disabled)

Lock the data storage:

The JXC controller data storage function is disabled by locking the data storage function (Data storage) in the JXC controller.

When a data storage backup (read the parameter set data) or restore (rewrite the parameter set data) is instructed while the data storage function is locked, a reply for rejection of access is returned.

(1-3) Device Status(Index:0x0024, Sub Index:0x00)

The status of the device (JXC controller) can be checked.

The table below shows details of the JXC controller status based on a read value.

Value	Status of JXC controller
0	Operating normally
2	Abnormality has occurred (outside of the specification range)

(1-4) Detailed Device Status (Index:0x0025, Sub Index:0x01,0x02)

Details of the device status (JXC controller) can be checked.

The table below shows the readable status of the JXC controller status.

Sub Index	Event	Event Event code (Byte1,2)		Event class
0x01	Alarm has been 0x1810 generated to the motor (Event not present: 0x0000)		0xE4 (Event not present: 0x00)	Warning
0x02	Control power supply C24V is not supplied	0x1820 (Event not present: 0x0000)	0xE4 (Event not present: 0x00)	Warning

(2) SMC parameters

The JXC controller has parameters designated for SMC which can be set using IO-Link communication:

These are Basic parameter, Origin parameter, Drive parameter (for setting jogging speed and inching distance), Alarm, and Step data.

Refer to (2-1) (2-2) (2-3) for the parameters.

Refer to 11.2-11.4 Parameter for further details of Basic, Origin and Drive parameters.

Refer to 11.1 Step data for further details of Step data.

Some of the SMC parameters will be reflected in the IO-Link master when the data storage function is used.

The parameters stored by the data storage function are parameters indicated with "Y" in section (2-1) and (2-2).

ACaution

When the parameters are to be changed using IO-Link communication, upload all parameters from the JXCL1 controller before making the change.

The set values for SMC parameters ("Basic parameter" "Origin parameter" "Drive parameter" "Step data") are different depending on the connected actuator. The initial value for IODD is a default value only. When parameters are changed using IO-Link communication, it is necessary to upload the parameters of the connected actuator from the JXCL1 controller to reflect the parameters to the IO-Link master setting tool.

(2-1) Basic / Origin / Drive parameter

Index	Sub Index	Para	meter name	Data type *1	Access *2	Input range	Unit	Activation *3	Data *4 storage
	0x01		Cntroller ID	UINT8	R/W	1-32	-	0	Y
	0x02		IO pattern	UINT8	R/W	Fixed value	-	-	Υ
	0x03		ACC/DEC pattern	UINT8	R/W	Fixed value	-	-	Υ
	0x04		S-motion rate	UINT8	R/W	Fixed value	-	ı	Y
	0x05		Stroke(+)	INT32	R/W	*5	0.01mm	•	Y
	0x06		Stroke(-)	INT32	R/W	*5	0.01mm	•	Y
0x0040	0x07	Basic Parameter0	Max speed	UINT16	R/W	*5	mm/s	•	Y
	0x08		Max ACC/DEC	UINT16	R/W	*5	mm/s²	•	Y
	0x09		Def In position	UINT32	R/W	*5	0.01mm	•	Y
	0x0A		ORIG offset	INT32	R/W	*5	0.01mm	•	Y
	0x0B		Max force	UINT8	R/W	*5	%	•	Y
	0x0C		Para protect	UINT8	R/W	1,2	-	•	Y
	0x0D		Enable SW	UINT8	R/W	1,2	-		Υ

	0x01		Unit name	STR16	R/W	Fixed value	-	-	Υ
	0x02		W-AREA1	INT32	R/W	*5	0.01mm	•	Υ
0x0041	0x03	Basic Parameter1	W-AREA2	INT32	R/W	*5	0.01mm		Υ
	0x04		ORG correct	INT32	R/W	Fixed value	-	-	Υ
	0x05		Sensor type	UINT16	R/W	Fixed value	-	-	Υ
	0x01		Option set1	UINT16	R/W	Fixed value	-	-	Υ
0x0042	0x02	Basic parameter2	Undefined parameter11	UINT16	R/W	Fixed value	-	-	Υ
	0x03		Undefined parameter12	UINT16	R/W	Fixed value	-	-	Υ
	0x01		ORIG direction	UINT8	R/W	1,2	-	0	Υ
	0x02		ORIG mode	UINT8	R/W	1,2	-		Υ
	0x03		ORIG limit	UINT8	R/W	*5	%		Υ
	0x04		ORIG time	UINT8	R/W	Fixed value	0.1sec	-	Υ
0x0043	0x05	Origin parameter0	ORIG speed	UINT16	R/W	*5	mm/s		Υ
	0x06	parametero	ORIG ACC/DEC	UINT16	R/W	*5	mm/s²		Υ
	0x07		Creep speed	UINT16	R/W	Fixed value	mm/s	-	Υ
	0x08		ORIG sensor	UINT8	R/W	0,1,2	-	•	Υ
	0x09		ORIG SW Dir	UINT16	R/W	Fixed value	-	-	Υ
0×0045	0x01	Drive	JOG speed	UINT16	R/W	*5	mm/s	•	Υ
0x0045	0x05	parameter	Move distance	UINT32	R/W	*5	0.01mm		Υ

^{*1} UINT8: Unsigned Integer(1byte), UINT16: Unsigned Integer(2bytes), INT32: Signed Integer(4bytes), STR**: String(MAX**bytes)

*2 R: Read, W: Write

(2-2) Current Alarm

Index	Sub Index	Parameter name	Data type *1	Access *2	Description	Unit	Data storage *4
	0x01	Alarm1	UINT8	R	0: No alarm.		
0,0050	0x02	Alarm2	UINT8	R	Others: Alarm code		N
0x0050	0x03	Alarm3	UINT8	R	Refer to 16.2 Alarms and	-	IN
	0x04	Alarm4	UINT8	R	<u>countermeasures</u>		



^{*3 &}quot;•" = Effective as soon as it is recorded into the controller, "o" = Become effective after restarting the controller

[&]quot;-" = The parameter cannot be changed (fixed value)

^{*4} Y: Parameter stored using data storage function, N: Parameter not stored using data storage function Refer to 10.3 Data strorage for Data strage.

*5 Different depending on the actuator type. Refer to the operation manual for the actuator.

(2-3) Step data

(2-3) Ste	Sub Index		ameter name	Data type *1	Access *2	Input range	Unit	Activation *3	Data storage *4
	0x01		Move	UINT16	R/W	0,1,2	-	•	Y
	0x02		Speed	UINT16	R/W	*5	mm/s		Υ
	0x03		Position	INT32	R/W	*5	0.01mm		Υ
	0x04		Accel	UINT16	R/W	*5	mm/s ²	•	Υ
	0x05		Decel	UINT16	R/W	*5	mm/s²	•	Υ
0x0064	0x06	Step data No.0	PushingF	UINT16	R/W	0,1-Max force *5	%		Υ
	0x07		TriggerLV	UINT16	R/W	0,1-Max force *5	%		Υ
	0x08		PushingSpd	UINT16	R/W	1-Max speed *5	mm/s		Υ
	0x09		MovingF	UINT16	R/W	*5	%		Υ
	0x0A		Area1	INT32	R/W	*5	0.01mm		Υ
	0x0B		Area2	INT32	R/W	*5	0.01mm		Υ
	0x0C		InPosition	INT32	R/W	*5	0.01mm		Υ
0x0065	0x01- 0x0C		Same parameter as Step data No.0	↑ Ditto	R/W	↑ Ditto	↑ Ditto	↑ Ditto	Y
0x0066	0x01- 0x0C	Step data No.2	Same parameter as Step data No.0	↑ Ditto	R/W	↑ Ditto	↑ Ditto	↑ Ditto	Y
0x0067	0x01- 0x0C		Same parameter as Step data No.0	↑ Ditto	R/W	↑ Ditto	↑ Ditto	↑ Ditto	N
:	:	:	:	:			:	:	N
0x00A3	0x0C	No.63	Same parameter as Step data No.0	Ditto	R/W	↑ Ditto	↑ Ditto	↑ Ditto	N

^{*1} UINT8: Unsigned Integer (1byte), UINT16: Unsigned Integer(2bytes), INT32: Signed Integer(4bytes)

^{*2} R: Read、 W: Write

^{*3 &}quot;=" = Effective as soon as it is recorded into the controller, "o" = Become effective after restarting the controller

[&]quot;-" = The parameter cannot be changed (fixed value)

^{*4} Y: Parameter stored using data storage function, N: Parameter not stored using data storage function Step data stored using data storage function is up to No.0-2.

Refer to 10.3 Data strorage (P.40) for Data strage.

^{*5} Different depending on the actuator type. Refer to the operation manual for the actuator.

10.3 Data storage

The data storage function stores the IO-Link device parameters data in the IO-Link master. Refer to **10.2.2. (2) SMC parameters**.

(1) Storage of the changed parameter data

The JXC controller parameters specified can be stored in the data storage server of the IO-Link master.

In order to store the parameter, write "ParamDownloadStore (command code: 0x05)" to the system command of Index:0x0002,SubIndex:0x00. The parameters will be sent by the JXC controller.

When a system command is sent, the JXC controller will send the changed parameter data to the IO-Link master. When the IO-Link receives the data, it stores the data in the data storage server of the IO-Link master.

When a block parameter function of the IO-Link master tool is enabled and all the parameters are set in a batch, "ParamDownloadStore" is automatically sent to the system command as a part of the block parameter sequence.

^Caution

When step data or actuator parameters are changed using an ACTController or teaching box, turn the IO-Link power supply L+/L- to the JXC controller off and on again before storing the parameter to the IO-Link master data storage server.

If the power supply L+/L- is not turned off and on again, the changed parameters are not reflected to the SMC parameters in the IO-Link communication parameters of the JXC controller.

(2) Restoration of parameters changed during a JXC controller replacement

When a JXC controller is replaced with one of the same model number, the specified parameters stored in the IO-Link master are automatically downloaded to the new JXC controller. The stored parameters overwrites the default parameters of the JXC controller so that the existing controller parameters are reflected in the replacement controller .

Replace the JXC controller after confirming that the model number of the JXC controller to replace is the same as the JXC controller to be replaced.

Moreover, if the JXC controller is replaced with JXCL1*-BC (The blank controller), replace the JXC controller after writing the parameters for the connected actuator by JXC-BCW.

In Data storage, after replacing, only a part of parameters is downloaded to the JXC controller. The other parameters needed to drive the motor of the connected actuator are not downloaded.

10.4 Fail safe

Once IO-Link communication is established, if an <u>IO-Link communication error occurs</u> or the <u>IO-Link power supply is disconnected</u>, the connected actuator is stopped based on the operation instructions shown below.

Numerically instructed operation, Step No. instructed operation, inching, return to origin	Jogging
Stop after moving a specified distance	Immediate stop

If an alarm relating to the motor control has not been generated, the actuator is able to operate when IO-Link communication is recovered. The process data during communication recovery is as follows.

Process data during IO-Link communication recovery						
Process data output Process data output						
Based on the process data output from the IO-Link master	Based on the process data output from the IO-Link master					

11. Settings and Data Entry

In order to move the actuator to a specific position, it is necessary to setup the patterns of operations with a PC (with the controller setting software) or the teaching box or record data. This setup data input by the software or teaching box will be recorded in the memory of the controller.

Step data is possible to be set in Vendor specific area.

Refer to 10.2.2. (2) SMC parameters for details

For the controller setting software and the teaching box, there are two available modes (the Easy mode and the Normal mode).

You can select the appropriate one depending on the operation.

Easy mode

In Easy mode, the step data can be made easily by entering only a limited number of settings.

* The combination of settings you need to set up will change depending on the type of actuator. (A combination of setting data can be selected).

Normal mode

In Normal mode, a more detailed setup can be made (conditions for actuator and controller, etc.) than in Easy mode.

Three kinds of setting data can be changed in this mode; "All setteings of Step data", "Basic parameter" and "Return to origin parameter".

In addition to the three types of data settings, the ACT Controller2 controller setting software allows the user to set [extended functions].

⚠ Caution

When step data or actuator parameters are changed using an ACTController or teaching box, turn the IO-Link power supply L+/L- for the JXC controller off and on again.

If the power supply L+/L- is not turned off and on again, the changed parameters are not reflected to the SMC parameters in the IO-Link communication parameters of the JXC controller.

⚠ Caution

When the parameters are to be changed using IO-Link communication, upload all parameters from the JXCL1 controller before making the change.

Set values of SMC parameters ("Basic parameter" "Origin parameter" "Drive parameter" "Step data") are different depending on the connected actuator. The initial value for IODD is a default value only. When parameters are changed using IO-Link communication, it is necessary to upload the parameters of the connected actuator from the JXCL1 controller to reflect the parameters to the IO-Link master setting tool parameters.



11.1 Step Data

A "step data" is the setting data mainly describing the movement of the actuator. Total 64 step data (12 attributes per step) can be handled with this controller. Each step data will become effective as soon as it is recorded into the controller.

E.g.) Step data on the PC (controller setting software) screen [Normal mode]

No.	Movement mode	Speed mm/s	Position (mm)	Acceleration mm/s ²	Deceleration mm/s ²	Pushing force %	Trigger LV %	Pushing speed mm/s	Moving force %	Area 1 (mm)	Area 2 (mm)	In pos (mm)
0	Absolute	100	20.00	1000	1000	0	0	0	100	18.00	22.50	0.5
1	Absolute	50	10.00	1000	1000	70	60	5	100	6.0	12.0	1.5
		1								1	1 1	
63	Absolute	20	5.00	500	500	0	0	0	100	3.0	8.0	1.2

Step data should be written while the electric actuator is stopped.

In the case of the electric rotary table LER series, the unit system is applied from "mm" to " $^{\circ}$ (degree)". e.g.) Velocity, pushing speed = [$^{\circ}$ /s], position, area 1,2, position determination width = [$^{\circ}$], acceleration, deceleration = [$^{\circ}$ /s²]

Details of Step Data

	Details of Step Data Description						
Controller setting software	Teaching box (TB)	IO-Link	Range	Explanation			xplanation
No.	Step No.	-	0 to 63	Number of	the step da	ta.	
				Specifies th	e co-ordina	ate sys	tem for the target position.
				Software	ТВ	PLC	Details
Movement	Movement		3 types	Blank	Disable	0	The step data is ineffective.
mode	mode mode ^N	Move	(Refer to the table on the right)	Absolute	Absolute	1	The target position will be defined in relation to the absolute origin point.
				Relative	Relative	2	The target position will be defined relative to the current position.
Speed	Speed	Speed	Minimum value to "Maximum speed" of basic parameter (*1)	The speed	to move to	the tar	rget position. (Unit: mm/s)
Position	Position	Position	Basic parameter "Stroke (-)" - "Stroke (+)"	The target p	position (un	iit: m	m)
Acceleration	Acceleration	Accel	1 ~ Basic parameters "Maximum acceleration/ deceleration speed"	Sets the acceleration to reach to travel speed. (Unit: mm/s²)			
Deceleration	Deceleration	Decel	1 ~ Basic parameters "Maximum acceleration/ deceleration speed"	Sets the de	celeration f	rom tr	avel speed to stop. (Unit: mm/s²)
			0 or minimum value to	The setting to define the pushing operation or the positioning operation. For the positioning operation, the value specifies the force as a percentage of the maximum force (Unit: %). * The maximum force depends on the actuator. Please refer to the manual and the rated force of the actuator.			
Pushing force	Pushing force	PushingF	"maximum Pushing force "	Value	Moveme mode		Details
			of basic parameter (*1)	0	Positionir operation	-	The actuator moves to the position specified in the "Position".
			,	1 to 100	Pushing operation		The actuator moves to the position specified in the "Position" and then, performs a pushing action with a force not more than the set force.

^{*1} The range varies depending on the actuator. Please refer to the manual of the actuator for more details.



Trigger LV	Trigger LV	TriggerLV	Minimum value to "maximum Pushing force " of basic parameter (*1)	■Effective only for the pushing operation (the value for the "Pushing force" is between 1 to 100). "Trigger LV" is the setting to define the conditions where "INP" will turn ON. When the actuator generates a force greater than this value, "INP" will turn ON. This parameter is set according to the value of the pushing force or lower. (Unit: %) For the positioning operation, this value is ignored.			
Pushing speed	Pushing speed	Pushing Spd	(Pushing speed ≤ speed) (*1)	■Effective only for the pushing operation (when the value for the "Pushing force" is from 1 to 100). This defines the movement speed during the pushing operation. If this Speed is too high, it may cause damage to the actuator or work piece due to impacts. Therefore, enter a value within the range appropriate for the actuator. (Unit: mm/s) Please refer to the actuator manual for the appropriate range of the speed. For the positioning operation, this value is ignored.			
Moving force	Moving force	MovingF	(*1)	The setting to define the maximum torque during the positioning operation. (Unit: %) Moving force generated is automatically adjusted within the maximum torque range according to the load. Using a value smaller than the default setting may result in tact variation and cause alarms. * To change the setting, please refer to the actuator's operation manual.			
Area 1	AREA 1	Area1	Basic parameter "Stroke (-)" - "Stroke (+)"	The setting to define the conditions where "AREA" will turn ON. (Unit: mm) If the current position is within the range between Area1 and Area2,			
Area 2	AREA 2	Area2	Basic parameter "Stroke (-)" - "Stroke (+)"	the "AREA" signal will turn ON. * If Area1 > Area2, the alarm "Step Data ALM1" will be activated. (However, no alarm is generated if "Area1" = "Area2" = 0, the "AREA" signal will be OFF).			
				and the position * Positioning op	f this will be different between the pushing operation ning operation. Deration: Positioning range (Unit: mm) Detaition: Pushing distance (Unit: mm)		
				Movement mode	Details		
In position	In position	InPosition	(*1)	Positioning operation	This is the setting to define the conditions where "INP" will turn ON. When the actuator enters within this range from the target position, "INP" will turn ON. (It is not necessary to change this from the initial value). If it is required to receive a signal before the actuator completes the positioning operation, this value should be larger. * "INP" will turn ON. Target position - in position ≤ actuator position ≤ target position + in position		
				Pushing operation	This is the setting to define the distance pushed by the actuator during the pushing operation. When the actuator has exceeded this distance, the pushing operation will end. In this case, "INP" will not turn ON.		

^{*1} The range varies depending on the actuator. Please refer to the manual of the actuator for more details.



11.2 Basic parameters

The "Basic parameter" is the data to define the operating conditions of the controller, conditions of the actuator, etc.

Details of basic parameters

Activation: "■" = Effective as soon as it is recorded into the controller

"o" = Become effective after restarting the controller

"-" = The parameter cannot be changed (fixed value)

Description			- = The parameter cannot be changed (lixed value		
Controller setting software	Teaching box	IO-Link	Range	Explanation	Activation
Controller ID	Controller ID	Controller ID	1 to 32	Identification number (axis) parameter of serial communication that this controller communicates with the PC or the teaching box is set.	0
IO pattern	IO pattern	IO pattern	Fixed value	This is the fixed value for this controller. (* Do not change the setting) The value for this should be 64 (Standard).	-
ACC/DEC pattern	ACC/DEC pattern	ACC/DEC pattern	Fixed value	This is the fixed value for this controller. (* Do not change the setting) This defines the trapezoidal acceleration/deceleration parameter.	-
S-motion rate	S-motion rate	S-motion rate	Fixed value	This is the fixed value for this controller. (* Do not change the setting)	-
Stroke (+)	Stroke (+)	Stroke(+)	(*1)	This defines the positive (+) side limit of the position. (Unit: mm) Any value greater than the [stroke(+)] value cannot be entered in the "Position" field data of step parameter setup.	
Stroke (-)	Stroke (-)	Stroke(-)	(*1)	This defines the positive (+) side limit of the position. (Unit: mm) Any value less than the [stroke(-)] value cannot be entered in the "Position" field data of step parameter setup.	
Max speed	MAX speed	Max speed	(*1)	This defines the maximum limit of the speed. (Unit: mm/s) Any value greater than the [Max speed] value cannot be entered in the "Speed" field data of step parameter setup.	
Max ACC/DEC	MAX ACC/DEC	Max ACC/DEC	(*1)	This defines the maximum limit of the ACC/DEC. (Unit: mm/s²) Any value greater than the [Max ACC/DEC] value cannot be entered in the "Accel" field data of step parameter setup.	•
Def In position	Def In position	Def In position	(*1)	This defines the range to activate the INP output when the actuator is within it after the return to origin operation. (Unit: mm)	•
ORIG offset	ORIG offset	ORIG offset	(*1)	This defines the position of the actuator after the return to origin operation. (Unit: mm) The ORIG offset is 0 (mm). M	•

N. 4 - 1 - 1 - 1	NAA V 6	NA	(.4)	The manifestory force for the marking a granting (Unit 0())	
Max force	MAX force	Max force	(*1)	The maximum force for the pushing operation. (Unit: %)	-
Para protect	Para protect	Para protect	1 to 2	Sets the range in which parameter and step data can be changed. 1. Basic parameter + Step data (Basic parameter + Return to origin parameter + Step data) 2. Basic parameter (Basic parameter + Return to origin parameter)	•
Enable SW	Enable SW	Enable SW	1 to 2	This defines the status of the Enable switch of the teaching	
Unit name	Unit name	Unit name	Fixed value	Indication of actuator type compatible with the controller	
W-AREA1	W-AREA1	W-AREA 1	Basic parameter "Stroke (-)" - "Stroke (+)"	"W-AREA" signal will turn ON. (Unit: mm) If the current position is within the range between the	
W-AREA2	W-AREA2	W-AREA 2	Basic parameter "Stroke (-)" - "Stroke (+)"	W-AREA1 and W-AREA2, "WAREA" will turn ON. * If W-AREA1 >W-AREA2, the "Parameter ALM" alarm will be activated. However if W-AREA1= W-AREA2 = 0, "WAREA" will be OFF and no alarm will be generated.	•
ORG Correct	Link Offset	ORG Correct	Fixed value	This is the fixed value for this controller. (The initial value is "0".) (* Do not change the setting)	-
Sensor type	Sensor type	Sensor type	Fixed value	This is the fixed value for this controller. (* Do not change the setting)	-
Option set 1	Option 1	Option set1	Fixed value	This is the fixed value for this controller.	
Undefined parameter 11	Undefine No. 11	Undefined parameter 11	Fixed value	This is the fixed value for this controller. (The initial value is "0".) (* Do not change the setting)	-
Undefined parameter 12	Undefine No. 12	Undefined parameter 12	Fixed value	This is the fixed value for this controller. (The initial value is "0".) (* Do not change the setting)	-

^{*1} The range varies depending on the actuator. Please refer to the manual of the actuator for more details.

^{*2 &}quot;Maximum speed" should be set to the maximum speed of the electric actuator. The controller is limited to control not to exceed this set value, so a lower setting may result in a slower response time.

11.3 Return to origin parameter

The "Return to origin parameter" is the setting data for the return to origin operation.

Details of Return to origin parameter

Activation: "■" = Effective as soon as it is recorded into the controller

"O" = Become effective after restarting the controller

"-" = The parameter cannot be changed (fixed value)

	Description				
Controller setting software	Teaching box	IO-Link	Range	Explanation	Activation
ORIG direction	ORIG direction	ORIG direction	1 to 2	Sets the direction of return to origin operation. 1. CW 2. CCW	0
ORIG mode	ORIG mode	ORIG mode	1 to 2	The setting for the return to origin operation. 1. Pushing origin operation [Stop] 2. Limit switch origin [Sensor]	•
ORIG limit	ORIG limit	ORIG limit	(*1)	A pushing force level at which to set the origin. (Unit: %)	
ORIG time	ORIG time	ORIG time	Fixed value	This is the fixed value for this controller. (* Do not change the setting)	-
ORIG speed	ORIG speed	ORIG speed	(*1)	The allowable speed to move to origin.(Unit: mm/s)	
ORIG ACC/DEC	ORIG ACC/DEC	ORIG ACC/DEC	(*1)	The acceleration and deceleration during finding origin.	
Creep speed	Creep speed	Creep speed	Fixed value	This is the fixed value for this controller. (* Do not change the setting)	-
ORIG sensor	ORIG sensor	ORIG sensor	0 to 2	The setting for ORIG sensor. 0. The origin sensor is not effective. [Disable] 1. The origin sensor is N.O type. [N.O]. 2. The origin sensor is N.C type. [N.C.]	•
Origin SW Dir	Origin SW DIR	ORIG SW Dir	Fixed value	This is the fixed value for this controller. (* Do not change the setting)	-
Undefined parameter No. 21	Undefine No. 21	Undefined parameter 21	Fixed value	This is the fixed value for this controller. (* Do not change the setting)	-

^{*1} The range varies depending on the actuator. Please refer to the manual of the actuator for more details.

11.4 Drive parameter

The Drive parameter [Operation parameter] is data for setting jogging and inching movement. This parameter can only be set using IO-Link communication.

Details of Drive parameter

Activation: "■" = Effective as soon as it is recorded into the controller

"O" = Become effective after restarting the controller

"-" = The parameter cannot be changed (fixed value)

Description Only IO-Link	Range	Explanation			
JOG speed	MAX speed (*1)	The speed of Jogging / Inching is set by this setting. (Unit: mm/s) Jogging: JOG(+/-) , Inching: JOG(+/-) + FLGTH	•		
Move distance	Actuator Stroke (*1)	The distance of Inching is set by this setting. (Unit: mm) Inching: JOG(+/-) + FLGTH	•		

^{*1} The range varies depending on the actuator. Please refer to the manual of the actuator for more details.



12. Operations

12.1 Return to Origin

 
After entering the setting data, it is necessary to perform a return to origin operation (to establish the origin point) before starting the positioning or pushing operation. (To ensure the position of origin)

■Return to origin


The actuator moves in the return to origin direction (* this direction is dependent on the actuator) from the initial position at the moment of power-on: Refer to (1) in the figure below.

When the actuator reaches the end of travel limit it pauses for a short time. The controller recognizes the position as the end of travel limit of the actuator. Then, the actuator moves at a low speed in the direction opposite to the return to origin direction: Refer to (2) in the figure below.

The position after the travel becomes the origin.



(E.g.) Return to Origin position reference example

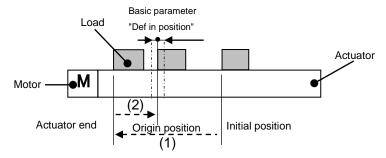

^Caution


This direction is dependent on the actuator.

12.2 Positioning Operation


Step data "Pushing force" is set to 0.

The actuator moves to the target position specified by the step data "Position".

•(E.g.) Positioning Operation

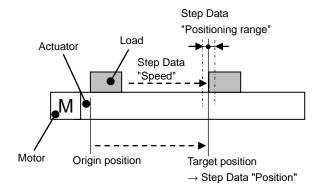

•(E.g.) Positioning operation [Speed/Position]

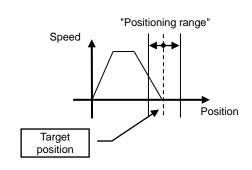


12.3 Pushing Operation

The pushing operation is active when the value of the "Pushing F%" in the Step data is set to "1" or more. Similar to the positioning operation, the actuator moves according to the settings of "Position" and "Speed" in the step data and then, when it reaches the target position, it starts the pushing process. The actuator pushes the load with a force no more than the maximum force set in the "Pushing force" of the step data.


(1) Pushing operation is successfully performed.

During the pushing operation, if the pushing force is kept higher than the value specified by "Trigger LV" of the step data for a certain time, "INP" will turn ON. Even after the completion of the pushing operation, the actuator will keep generating the force set in the step data.

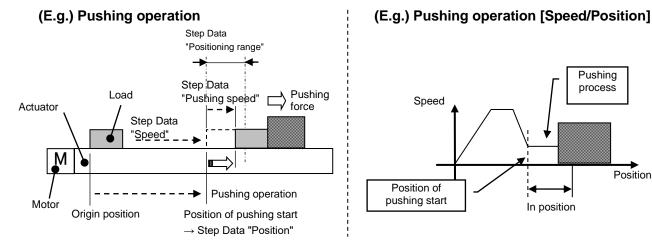

(2) Pushing operation fails (empty pushing).

If the pushing process is not completed even after the actuator runs over the range specified in the step data from the target position (the starting point of the pushing process), the operation will be completed. In this case, "INP" will turn OFF.

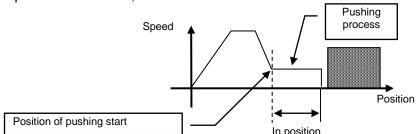


(3) Movement of the workpiece after the completion of the pushing process

[1] The workpiece moves in the pushing direction.

After completion of the pushing operation, if the reaction force from the workpiece becomes smaller, the actuator may move with a force smaller than that specified in the "Trigger LV" of the step data.

In this case, "INP" will turn OFF and the actuator moves within the positioning range according to the balance of the force.

If the pushing force is kept higher than the value specified by "Trigger LV" of the step data for a certain time again, "INP" will turn ON.

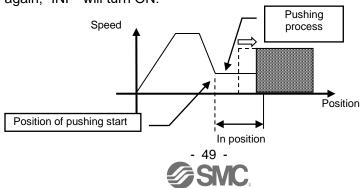

Pushing


process

Position

[2] Movement of the workpiece in the direction opposite to the pushing direction (The actuator is pushed back since the reaction force from the workpiece is too large.)

After completion of the pushing operation, if the reaction force from the workpiece becomes larger, the actuator may be pushed back. In this case, while "INP" remains ON, the actuator will be pushed back to the point where the reaction force and the actuator pushing force are balanced (pushed back toward the target position).

If the actuator is pushed back over the target position, the alarm (ORIG ALM) will be activated.

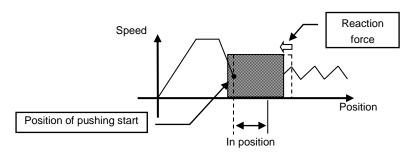

12.4 Controller signal response time

The controller signal response delay includes the following factors.

- (1) Controller signal scan delay
- (2) Delay due to signal analysis
- (3) Delay of command analysis

Set the time more than twice the communication cycle time for the interval between the signals, when the signals are continuously input, as PLC processing delays and controller scanning delays can occur.

12.5 Methods of interrupting operation

There are 3 methods of interrupting operation and stopping the actuator during positioning operation and pushing operation, as shown below. The state after the interruption is different, therefore use the method appropriate to the application.

Stopping by "EMG" signal

If the "EMG" signal is turned OFF during operation, after the actuator decelerates and stops, the servo will turn OFF, and the stopped position is not held.

(For an actuator with lock, it will be held by the lock function).

Stopping by "RESET" signal

If the "RESET" signal is turned ON during operation, after the actuator decelerates and stops, the stopped position is held.

(The servo does not turn OFF).

Stopped by "HOLD" signal

The actuator decelerates to stop when the "HOLD" signal is ON during operation.

(The servo does not turn OFF).

⚠ Caution

If instructed to stop by the "EMG" or "RESET" signal, all "OUT" signals will turn OFF.



13. Operation Examples


13.1 Positioning Operation

E.g.) Move an actuator from the origin to 100mm point at 50mm/s. (Step No.1 instruction)

Next, move the actuator from the 50mm point to 100mm point by moving it 5 times continuously,
10mm at a time, at a speed of 50mm/s. (Step No. 2)

■[Normal mode] Step data (E.g.)

No.	Movement mode	Speed mm/s	Position (mm)	Acceleration mm/s ²	Deceleration mm/s ²	Pushing force %	Threshold Force Value %	Pushing speed Speed mm/s	Moving	Area 1 (mm)	Area 2 (mm)	In pos (mm)
0	i	1	-	1	-	-	-	-	į	ı	ı	-
1	Absolute	100	50.00	1000	1000	0	0	0	100	0	0	0, 1
2	Relative	50	10.00	1000	1000	0	0	0	100	0	0	0, 1

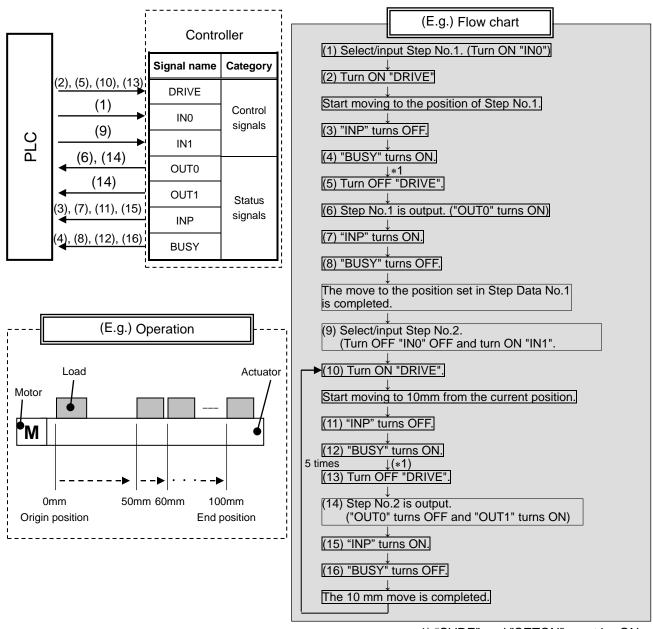

*1) "SVRE" and "SETON" must be ON.



13.2 Pushing Operation


E.g.) Move the actuator from the origin to a point 100 mm away at 100 mm/s. (Step Data No.1 is used for this operation).

From the 100 mm point, the actuator must start a pushing operation of 10 mm/s speed and 50% or less force.(the pushing distance is up to 5 mm).

Then, the actuator should move from the position where the pushing operation was completed (where "INP" turned ON) to a point 50 mm away at 50 mm/s. (Step Data No.2 is used for this operation).

■[Normal mode] Step data example

No.	Movement mode	Speed mm/s		Acceleration mm/s ²	Deceleration mm/s ²	Pushing force %	Threshold Force Value %	Pushing speed mm/s	Moving force %	Area 1 (mm)	Area 2 (mm)	In pos (mm)
0	i	-	-	-	-	-	-	-	i	-	-	-
1	Absolute	100	100.00	1000	1000	50	40	10	100	0	0	5
2	Absolute	50	50.00	1000	1000	0	0	0	100	0	0	0, 1

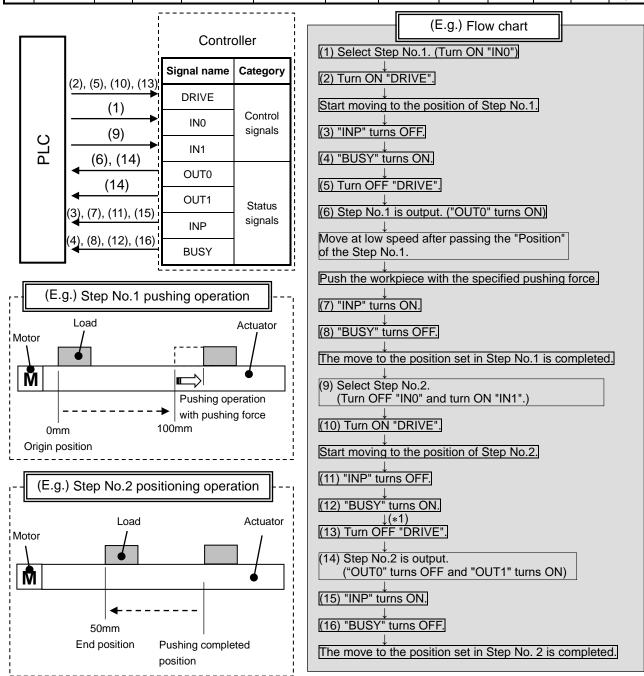

*1) "SVRE" and "SETON" must be ON.



14. Operation Instructions

14.1 Overview of the Operation Instructions

Shows operation instruction method of each function shown in **9. Operation methods**.

14.2 Operation procedure for Operation by Step No.


Refer to the following "Procedures" and "Timing charts" for details of the Return to Origin, operation mode procedures and the signal timing. Refer to **10.1 Memory map** for the memory allocation of signals.

[1] Power on and Return to Origin position

- Procedure -
- (1) Turn the power supply ON.
- (2) Turn ON "SVON".
- (3) "SVRE" turns ON.
 - * The time when "SVRE" turns ON depends on the type of actuator and the customers application.
 - * The actuator with lock is unlocked.
- (4) Turn ON "SETUP".
- (5) "BUSY" turns ON. (The actuator starts the operation.) After "BUSY" turns ON, "SETUP" will turn OFF.
- (6) "SETON" and "INP" will turn ON. Return to origin is completed when "INP" turns ON.



Timing chart/Return to origin

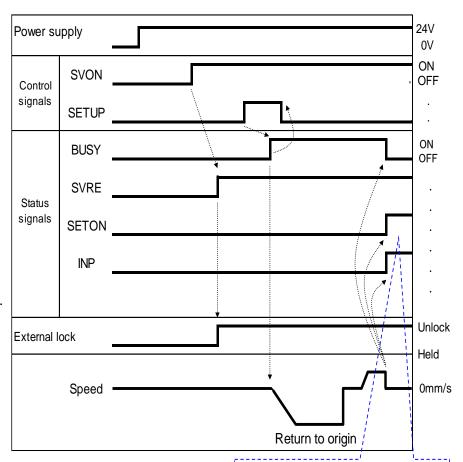


INP signal is ON when the current position is within the step data position range. Otherwise, the signal is OFF

[2] Positioning operation

- Procedure -


- (1) Input step data No. ("IN0" to "IN5")
- (2) Turn ON the "DRIVE". ("INP" turns OFF.) Scan the specified step data number (from "IN0" to "IN5").
- (3) "BUSY" turns ON. (and the positioning movement starts.)
 - * After "BUSY" turns ON, if "DRIVE" is turned OFF, the step data number will be output (from "OUT0" to "OUT5").
- (4) When "INP" turns ON and "BUSY" turns OFF, the positioning operation will be completed.

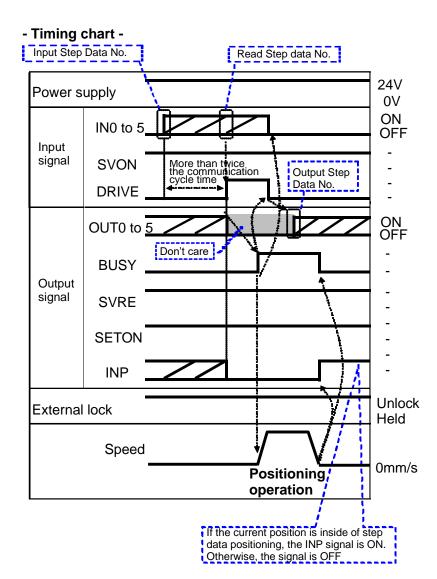

[3] Pushing Operation - Procedure -

- (1) Input step data No. ("IN0" to "IN5")
- (2) Turn ON the "DRIVE". ("INP" turns OFF.)
- →Scan the step data number (from "IN0" to "IN5").
- (3) "BUSY" is ON when pushing starts.
 - * After "BUSY" turns ON, if "DRIVE" is turned OFF, the step data number will be output (from "OUT0" to "OUT5").
- 4) When "INP" turns ON and "BUSY" turns OFF, the pushing operation will be completed (the actuator generates the force larger than that specified in "Trigger LV" of the step data).

- Timing chart -

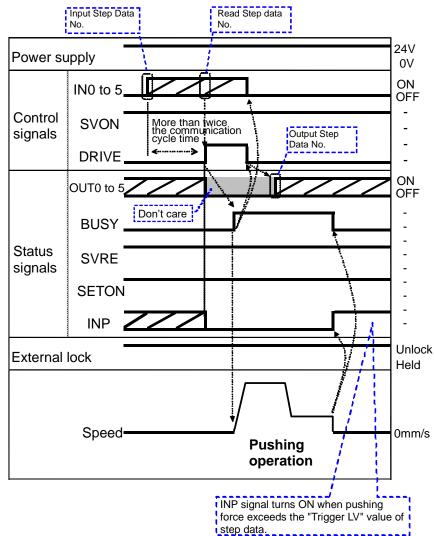


[4] HOLD

- Procedure -

- (1) During operation ("BUSY" is ON), turn ON "HOLD".
- (2) "BUSY" turns OFF. (The actuator stops.)
- (3) Turn OFF "HOLD".
- (4) "BUSY" turns ON. (The actuator restarts.)

- Timing chart -

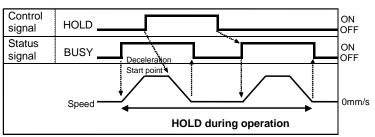


[5] Reset

-Procedure- [Driving Reset]

- (1) During operation ("BUSY" is ON), "RESET" is turned ON.
- (2) "BUSY" and "OUT0" to "OUT5" are OFF.
- (3) The actuator decelerates to stop (controlled).

- Timing chart / Driving Reset -

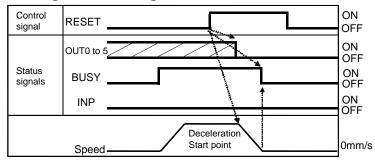

* INP is ON when stop position is within the positioning range.

-Procedure- [Alarm Reset]

 
- (1) Alarm generated
 - "ALARM" turns ON.

Alarm group is output to "OUT0" to "OUT3".

For memory to be checked and detailed, Please refer to 10. Memory map 16.1 Alarm group signals

- 16.2 Alarms and countermeasures
- (2) Turn ON "RESET".
- (3) "ALARM" turns OFF, "OUT0" to "OUT3" turn OFF. (The alarm is deactivated.)

- Timing chart / Alarm Reset -




[6] Stop

- Procedure -

- (1) During operation ("BUSY" is ON), turn OFF "EMG". (Stop command)
- (2) "ESTOP" turns ON.
- (3) "BUSY" turns OFF. (The actuator stops.) "SVRE" turns OFF.
 - * The actuator with lock is locked.
- (4) Turn ON "EMG".(The stop release command)
- (5) "ESTOP" turns OFF. "SVRE" turns ON.
 - * The actuator with lock is unlocked.

- Timing chart -

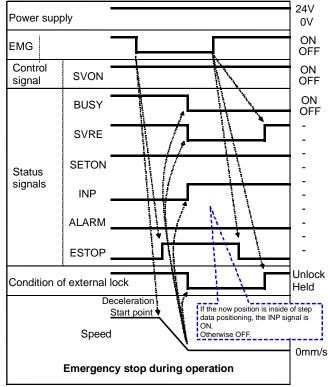


* When "EMG" is OFF, the stop is activated.



[7] Area output

- Procedure -
- Step data No.1 operation
- (1) Input step data No. ("IN0" to "IN5")
- (2) Turn "DRIVE" ON.
 - → Receive the step data no.1 (from "IN0" to "IN5").
- (3) "BUSY" turns ON. (The actuator starts the operation.) "INP" turns OFF.
 - * After "BUSY" turns OFF, if the "DRIVE" is turned OFF, the step data No.1 ("OUT0" to "OUT5") will be output.
- (4) "AREA" of step data No.1 turns ON. (at 150mm from the origin point)
- (5) "BUSY" turns OFF. (The actuator stops.) "INP" turns ON.
- Step data No.2 operation
- (6) Input step data No. ("IN0" to "IN5")
- (7) Turn ON "DRIVE".
 - → Read step data No. 2 ("IN0" to "IN5")
- (8) "AREA" turns OFF.
 - "BUSY" turns ON. (The actuator starts the operation.)
 - "INP" turns OFF.
 - * After "BUSY" turns OFF, if "DRIVE" turns OFF, the step data No.2 ("OUT0" to "OUT5") will be output.
- (9) "AREA" of step data No.2 turns ON. (at 170mm from the origin point)
- (10) "AREA" of step data No.2 turns OFF. (at 130mm from the origin point)
- (11) "BUSY" turns OFF. (The actuator stops.) "INP" turns ON.

- Timing chart -

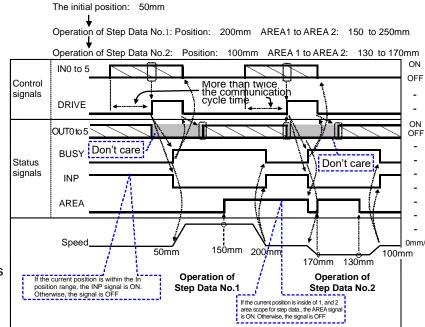

14.3 Operation procedure for Operation by numerical instruction

- E.g.) Input 50.00 [mm] to the position parameter of the specified step data and start the actuator. Turn ON "RUN (Start flag)" after 12 items are specified (same as the items of the step data).
 - •Movement mode, speed, target position, acceleration / deceleration, pushing force, trigger LV, In-position.

Specified by process data Byte3-21.

All of the 8 items above must be numerically instructed for every numerically instructed operation.

•pushing speed, Positioning force, area1, area2. These are registered to the step data in advance. The step data is instructed using IN0-IN5 for numerically instructed operation.

- Procedure -

- Timing chart / numerically instructed operation -

"Output" and "Input" in the procedure indicates the following.

Output: Process data output Input: Process data input

- (1) Confirm that "Output,Byte2,bit0: "Run" = OFF. Turn OFF "Run", when it is ON.
- (2) Specify the step data number for positioning force, pushing speed, area 1, and area 2 using output Byte0,Bit0-5:IN0-5.
- E.g.) Specify step data No.1

 →Turn ON the


 "Output,Byte0,Bit0:IN0",

 Turn OFF the

 "Output byte0 Bit1-5: IN1-5"

"Output,byte0,Bit1-5: IN1-5". This is the step data that the positioning force, the pushing force, and Area1/2 are used.

- (3) Set "Output,Byte3-21" as numerical operation data. (8 items must be set numerically)
- (4) Turn ON the "Output,byte2,Bit0: Run". The actuator starts operating based on numerically instructed values.

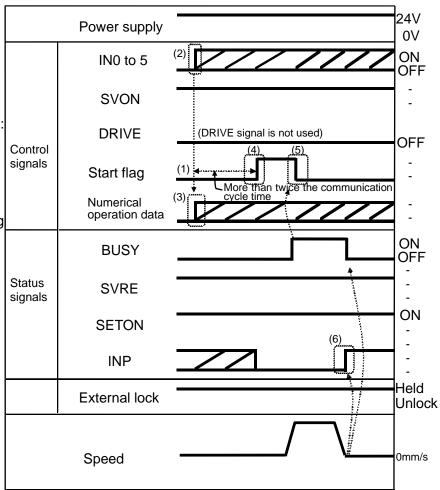


- (5) When the actuator starts and input Byte1, Bit0:BUSY=ON is output, the output Byte2,Bit0:RUN flag=OFF is input.
- (6) When the actuator moves to the target position, "Input,Byte1,Bit3:INP" is ON. When the actuator stops, Input,Byte1,Bit0:BUSY is OFF. When both"Input,Byte1,Bit3:INP"=ON and "Input,Byte1,Bit0:BUSY"=OFF are established, the specified operation is considered to be completed.
- * Before a numerically instructed operation starts, confirm it is a state of "SVRE=1 (The servo motor is ON)" and "SETON=1 (The returning to origin is completed)".





15. Options

15.1 Actuator cable [5m or shorter]

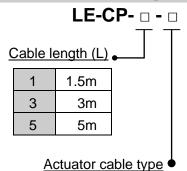


Nil	Robotic type cable
S	Standard cable

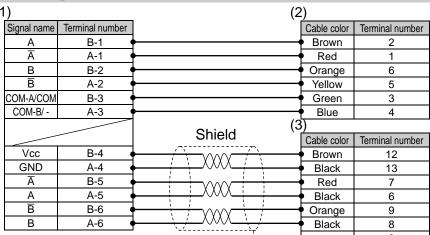

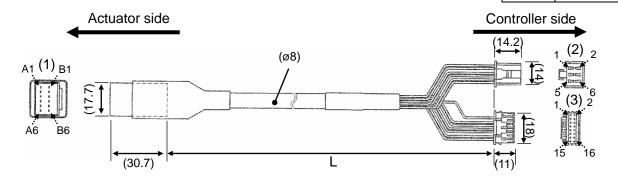

 15.2 Actuator cable [8 to 20m]





8	8m *
Α	10m *
В	15m *
C	20m *

Produced upon receipt of order

* Only "Robotic type cable" can be selected.


20111]				
1)		(2)	
Signal name	Terminal number		Cable color	Terminal number
Α	B-1 •		Brown	2
Ā	A-1		Red	1
В	B-2		Orange	6
B	A-2		Yellow	5
COM-A/COM	B-3		Green	3
COM-B/ -	A-3		Blue	4
		Objetal d	3)	
		Shield	Cable color	Terminal number
Vcc	B-4 •		Brown	12
GND	A-4		Black	13
Ā	B-5 •		Red	7
Α	A-5		Black	6
B	B-6	· · · · · · · · · · · · · · · · · · ·	Orange	9
В	A-6	· · · · · · · · · · · · · · · · · · ·	Black	8
		<u></u>	_	3

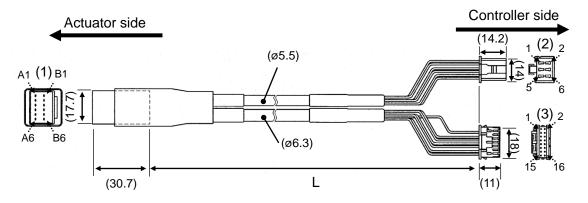

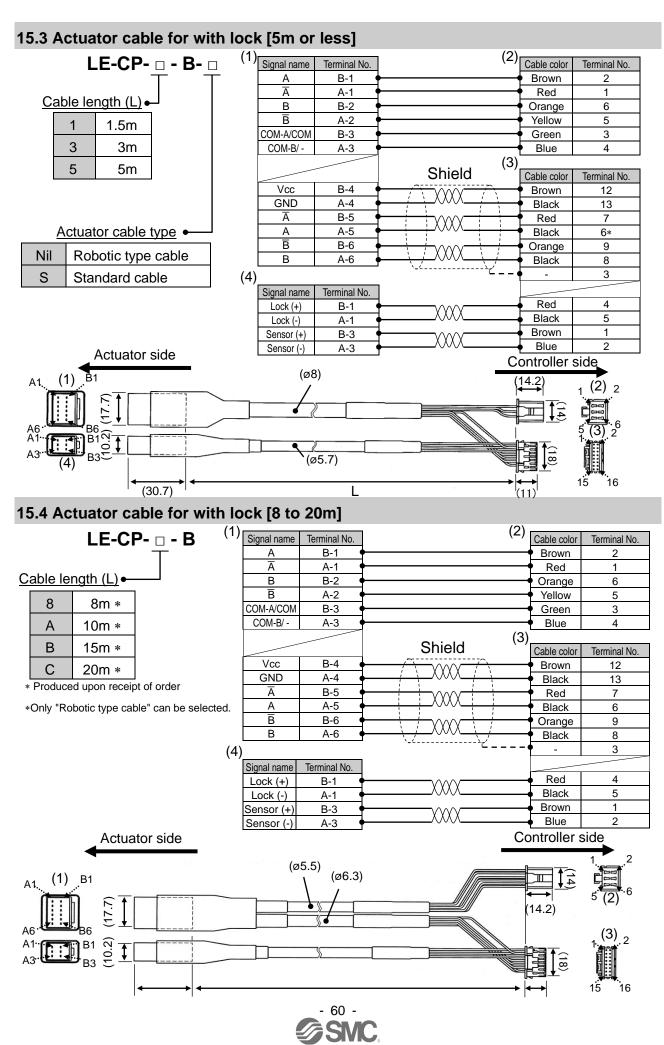

15.5 Power supply plug

 JXC-CPW



Viewed from A


7.2			
	65 32	11000	
1	C24V	4	OV
2	M24V	(5)	N.C.
3	EMG	6	LK RLS

Detail of Power supply plug

No.	Terminal	Function	Functional explanation
1	C24V	Power supply (+)	The positive control power.
2	M24V	Motor power (+)	The positive power for the actuator motor to be supplied via the controller.
3	EMG	Stop (+)	The positive power for Stop signal
4	0V	Common power (-)	The negative common power for M24V, C24V, EMG and LK RLS.
5	-	NC	
6	LK RLS	Unlocking (+)	The positive power for lock release.

15.6 IO-Link communication plug

 
JXC-CL-S



Detail of IO-Link communication plug

No.	Terminal	Function	Functional explanation		
1	L+	IO-Link power supply input (+)	+24 VDC for IO-Link power supply [IO-Link communication starts when the power supply L+/L-and C24V control power are supplied to the JXC controller.]		
2	N.C.	-	N/A		
3	L-	IO-Link power supply (-)	0VDC for IO-Link power supply		
4	C/Q	IO-Link signal	Connect IO-Link signal.		

15.7 Controller Communication cable

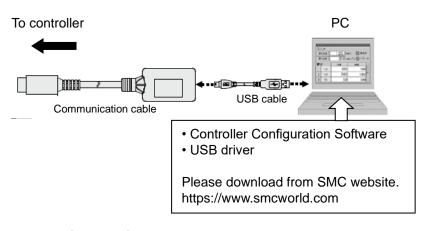

$$JXC-W2A-C$$

Communication cable

LEC-W2-U USB cable

Operating environment

OS	Windows®7,Windows®8.1,Windows®10,Windows®11
Communication interface	USB1.1 or USB2.0 port
Display	1024×768 or more

Windows®7, Windows®8.1, Windows®10, and Windows®11 are registered trademarks of United States Microsoft Corporation.

⚠ Caution


The latest version of the controller setting software must be used.

Upgrade software can be downloaded from SMC website. http://www.smcworld.com/



15.8 Teaching box




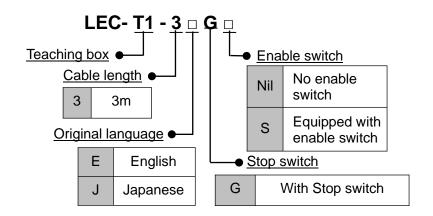


Conversion Cable

P5062-5 (Cable length: 0.3m)

 *This cable is necessary only when connecting the teaching box to the JXC controller



Dimensions

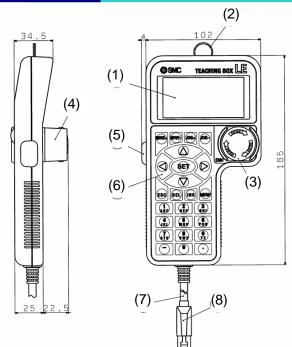

No	Indication	Function
(1)	LCD	Liquid crystal display (with backlight)
(2)	Ring	The ring to hang the teaching box.
(3)	Stop switch	When the switch is pressed, the switch locks and it stops. Turn clockwise to release the lock.
(4)	Stop guard	Protector for the stop switch
(5)	Enable switch (Option)	Switch to prevent unintentional operation of Jog test function. * Does not apply to other functions e.g. data change
(6)	Key switch	Entry switches
(7)	Cable	3m length
(8)	Connector	The connector to be connected to the SI of the controller

16. Alarm for Motor Control

The details of the alarm for motor control can be checked using a PC (the controller setting software) or the teaching box.

* Please refer to the manuals of the controller setting software or the teaching box for details of the alarms.

When an alarm is generated, deactivate the alarm after troubleshooting and correcting the error with reference to chapter <u>"16.2 Alarms and countermeasures"</u>.

Alarms are divided into two types. One is an alarm group B to D which can be cleared by turning ON "RESET". The other is group E which cannot be cleared unless the power supply control (24 VDC) is turned OFF once.

16.1 Alarm group signals

This product outputs a signal to establish which type of alarm has been generated. Alarms are classified into 5 groups. When an alarm is generated, it is output using "OUT0" to "OUT3". The table below shows the combination of alarm groups and remote IO signal output ("OUT0" to "OUT3").

A10	Signal								
Alarm group	ALARM	OUT0	OUT1	OUT2	OUT3				
Alarm group B	ON	OFF	ON	OFF	OFF				
Alarm group C	ON	OFF	OFF	ON	OFF				
Alarm group D	ON	OFF	OFF	OFF	ON				
Alarm group E	ON	OFF	OFF	OFF	OFF				

After generation of the alarm, actuator operation, SVRE or SETON are output according to the contents of the alarm as shown below

Alarm araun	Actuator	Change of	of signal	Have to martant
Alarm group	operation	SVRE	SETON	How to restart
Alarm group B	Stop	No change	No change	Turn ON "RESET"
Alarm group C	Stop	No change	No change	Turn ON "RESET"
Alarm group D	Stop	OFF	No change	Turn ON "RESET", then turn ON
Alarm group E	Stop	OFF	OFF	Power supply for control is turned OFF → Supply power again

⁻ Procedure to restart operation when alarm group D is generated -

Procedure 1: Alarm group D is generated → "SVRE" changes to OFF (Servo is OFF)

Procedure 2: Turn ON RESET → (The alarm is cancelled)

→ After turning ON "SVON", "SVRE" turns ON (Servo is ON).

16.2 Alarms and countermeasures

Controller setting software (code) *1	Teaching box	Group	How to deactivate	Alarm contents/Countermeasure
Drive data value is wrong (01-048)	Step data ALM1	В	RESET	<condition>The step data is incorrect for the following conditions (Settable range) (1) Area1 <area2< p=""> (If both Area1 and Area2 is 0, the alarm will not be activated.) (2) Trigger LV ≤ Pushing force (3) Minimum speed of actuator ≤ Pushing speed ≤ Speed (4) Pushing speed ≤ Maximum pushing speed of actuator (5) Pushing force ≤ Minimum pushing force of actuator (6) Basic parameter "Maximum pushing force" ≥ Minimum pushing force of the actuator (7) Basic parameters "Max pushing force" ≥ Threshold <countermeasure> Modify the step data and basic parameters setting Caution Please refer to the manual or the catalogue of the actuator for the max/min pushing force/speed for the actuator.</countermeasure></area2<></condition>
Parameter value is wrong (01-049)	Parame ter ALM	В	RESET	<contents> The basic parameter is not correct for the following condition: (Settable range) (1) Stroke(-) < Stroke (+) (2) W-Area 1 < W-Area 2 (* If both W-Area1 and W-Area2 is 0, the alarm will not be activated.) (3) Maximum pushing force < Maximum pushing force of actuator <countermeasure> Modify the basic parameter setting. Please refer to the manual or the catalogue of the actuator for the maximum pushing force for the actuator.</countermeasure></contents>
Set step data is not registered on list. (01-051)	Step data ALM2	В	RESET	 <contents> For an operation for a specific step data no., the requested number of the step data is not registered. (When operation is commanded through PLC, this alarm will be generated depending on the signal interval and the holding time of signals)</contents> < Countermeasure > (1) Make sure that the "Movement MOD" in the step data is not "Blank (Disabled)" and that numbers [1(ABS)] and [2(INC)] or input in the numerical instruction operation. (2) Set the interval time between signals to more than twice the communication cycle time, when signals are to be continuously input, because PLC processing delays and controller scanning delays can occur. Refer to 14.2[2] Positioning operation
Set stroke is outside the stroke limit. (01-052)	Stroke limit	В	RESET	<contents> The actuator goes outside the stroke limit specified by the basic parameters, "Stroke (+)" and "Stroke (-)" if it performs the requested operation. (Including JOG operation after return to origin) <countermeasure> Make sure that the basic parameters, "Stroke (+)" and "Stroke (-)" are consistent with the distance of actuator movement specified in the step data. Caution If the operation method of step data is "relative coordinated movement", note the location where the operation starts and the distance traveled. If the location is out of the stroke range when the power is supplied, this alarm is generated. Move the table within stroke range, and supply power.</countermeasure></contents>



Alarm _Comment _058 (01-058)	ЗА	В	RESET	<content> This alarm occurs when the following parameter is outside of the settable range during the numerical instruction operation. (Settable range) (1) Area1 < Area2 (If both Area1 and Area2 is 0, the alarm will not be activated.) (2) Trigger LV ≤ Pushing force (3) Minimum speed of actuator ≤ Pushing speed ≤ Speed (4) Pushing speed ≤ Maximum pushing speed of actuator (5) Pushing force ≤ Minimum pushing force of actuator (6) Basic parameter "Maximum pushing force" ≥ Minimum pushing force of the actuator (7) Basic parameters "Max pushing force" ≥ Switch point <countermeasure>Modify the basic parameter setting. Caution Please refer to the operation manual or catalog of the actuator for the maximum pushing speed, minimum pushing force, and minimum speed for the actuator.</countermeasure></content>
Alarm _Comment _061 (01-061)	3D	В	RESET	<content> This alarm occurs when specifying step data based on the unregistered No. of the step data or when the numbers of the Movement MOD specify outside of range during numerical instruction operation. (When operation is commanded through PLC, this alarm will be generated depending on the signal interval and the holding time of signals) <countermeasures> (1) Make sure that the "Movement MOD" in the step data is not "Blank (Disabled)" and that numbers [1(ABS)] or [2(INC)] are input in the numerical instruction operation. (2) Set the interval time between signals to more than twice the communication cycle time, when signals are to be continuously input, because PLC processing delays and controller scanning delays can occur.</countermeasures></content>
Alarm _Comment _062 (01-062)	3E	В	RESET	Refer to 14.2[2] Positioning <content> The actuator goes outside the stroke limit specified by the basic parameters, "Stroke (+)" and "Stroke (-)" if it performs the requested operation during numerical instruction operation. <countermeasure> Make sure the basic parameters, "Stroke (+)" and "Stroke (-)" are consistent with the distance of actuator movement specified in the step data. Caution If the operation method of step data is "relative coordinated movement", note the location where the operation starts and the distance traveled. If the location is out of the stroke range when the power is supplied, this alarm is generated. Move the table within stroke range, and supply power.</countermeasure></content>
Reacting force is outside limit when pushing. Position is unstable. (01-096)	Pushing ALM	С	RESET	<contents> In the pushing operation, the actuator is pushed back from the pushing operation origin position. <countermeasure> Increase the distance from the pushing operation origin position to the object being pushed. Or, increase the pushing force.</countermeasure></contents>



Return to ORIG did not complete in the set time. (01-097)	ORIG ALM	С	RESET	<counte< th=""><th>nts> Return to origin is not co ermeasure> Make sure there ator movement.</th><th>mpleted within the set time. are no obstructions that interfere with</th></counte<>	nts> Return to origin is not co ermeasure> Make sure there ator movement.	mpleted within the set time. are no obstructions that interfere with
Drive is ON when SVRE is OFF (01-098)	Servo OFF ALM	С	RESET	<contents> While the servo motor is OFF, the return to origin operation, positioning operation, pushing operation or JOG operation is requested. <countermeasure> Modify the setting so that those operations will be requested while the servo motor is ON ("SVRE" is ON).</countermeasure></contents>		
Drive is ON when SETON is OFF (01-099)	Drive ALM	С	RESET	before the	he return to origin position is	g so that these operations will be
					wn below.	return parameter has the conditions parameter setting
District					Return to origin mode	ORIG sensor
Did not detect				1 Pus	shing origin operation [Stop]	•Sensor N.O type [N.O]
sensor when returning to ORIG. (01-103)	ORIG Sens ALM	С	RESET	2 Lim	nit switch origin [Sensor]	•The origin sensor is not effective. [Disabled] or •Sensor N.O type [N.O]
				mounte	ed to the actuator.	ons above when the sensor is not rinstallation and settings of the return
Speed exceeded set value (01-144)	Over speed	D	RESET SVON	<conter force, et <counte exceed</counte </conter 	nts> The motor speed exceed acc. ermeasure> Make improvementhe maximum speed of the acc.	
Motor power supply voltage is outside set range. (01-145)	Over motorVol	D	RESET SVON	Contents> The motor power supply voltage is out of range during [SVON]. Countermeasure> Make sure that the voltage supplied to the motor power (M24V) of the controller is within specification. Caution If the power supply is "inrush-current control type", a voltage drop may cause an alarm during acceleration/deceleration. Contents> The alarm may be caused by regenerative power depending on the method of operation of the actuator. Countermeasure> Make sure that the operating conditions are within the specifications. Caution Please refer to the manual or the catalogue of the actuator for the method of operation of the actuator.		

Controller temperatur e exceeded set range. (01-146)	Over Temp	D	RESET SVON	<details> The temperature around the power element of the controller is too high. <countermeasures> Make improvements so that the temperature around the controller is kept appropriate.</countermeasures></details>
Controller supply voltage is outside set range. (01-147)	Over CrtIVol	D	RESET SVON	Contents> The control power supply voltage within the controller is outside the set range. Countermeasure> Make sure that the voltage supplied to the control power (C24V) of the controller is appropriate. Caution If a single power supply is used for both the control power and the motor power, or the power supply is "inrush-current control type", a power voltage drop may be caused due to a voltage drop during acceleration/deceleration.
Current limit is exceeded (01-148)	Over load	D	RESET SVON	<contents> The output current accumulated value exceeds the specified value. <countermeasure> Make sure there are no obstructions that interfere with the actuator movement. Also, make sure that the load, speed, acceleration and deceleration are within the range of the actuator.</countermeasure></contents>
The target position was not reached within the set time limit (01-149)	Posn failed ALM	D	RESET SVON	<content> Failed to reach the set position within the set time limit. <countermeasure> Make sure there are no obstructions that interfere with the actuator movement. Also, make sure that the load, speed, acceleration and deceleration are within the range of the actuator.</countermeasure></content>
Communic ation error. (01-150)	Ctrl Comm ALM	D	RESET SVON	<contents> The connection with the higher-level devices (such as the PC and teaching box) is disconnected. <contents> The connection with the higher-level devices (such as the PC and teaching box) is disconnected. In case of the communication failure of PC or teaching box, resetting of alarm by PC or teaching box is possible after connecting again.</contents></contents>
Abs ID mismatch (01-153)	Absolut e ENC mismat ch	D	RESET SVON SETUP	<contents> For controllers that support batteryless absolute encoders, the controller checks the unique number of the absolute encoder when power is turned on again. If this unique number is different from the previously connected encoder, this alarm is detected. <countermeasure> This alarm occurs when the actuator is used for the first time or when the actuator or controller is replaced. After inputting RESET to reset the alarm, the SETON output turns off, so please perform Return to origin (SETUP input).</countermeasure></contents>
Encoder error (01-192)	Encoder ALM	Е	Turn OFF and ON the power supply for the controller	<contents> Abnormality in communication with the encoder. <countermeasure> Check the connection of the actuator cable.</countermeasure></contents>



			•		
Unable to find motor phase in set time. (01-193)	nd motor not nase in found E	Turn OFF and ON the power supply for the	<contents> Unable to find the motor phase within the set time. (When the servo motor is turned ON ("SVON" turns ON) for the first time after the power is applied, the actuator needs to move a little to find the motor phase. However, if this actuator movement is prevented, this alarm will be activated.)</contents>		
(01-193)			controller	<countermeasure> Make sure there are no obstructions that interfere with the actuator movement and then turn ON the servo motor ("SVON" turns ON).</countermeasure>	
Output current			Turn OFF and ON	<contents> The output current of the power circuit is abnormally high.</contents>	
limit is exceeded set value (01-194)	Over current	E	the power supply for the controller	<countermeasure> Make sure that there are no short circuits of actuator cables, connectors, etc. In addition, make sure that the actuator is compatible with the controller.</countermeasure>	
Error	C==		Turn OFF and ON	<contents> An overflow of the position error counter inside of the controller has occurred.</contents>	
overflowed (01-196)	overflowed overflow	ow Suj	the power supply for the controller	<countermeasure> Make sure there are no obstructions that interfere with the actuator movement. Also, make sure that the load, speed, acceleration and deceleration are within the range of the actuator.</countermeasure>	
Memory Abnormality		Memory ALM E	Turn OFF and ON	<contents> An error of the EEPROM has occurred.</contents>	
has occurred (01-197)			the power supply for the controller	<countermeasure> Please contact SMC. (The write limit of the EEPROM is roughly 100,000 times)</countermeasure>	
CPU error (01-198)	CPU failure	E	Turn OFF and ON the power supply for	<contents> The CPU is not operating normally. (It is possible that the CPU or surrounding circuits has failed, or the CPU is malfunctioning due to electrical noise).</contents>	
(0.1.00)	ianaro			the controller	<countermeasure> If the alarm cannot be deactivated even after the power is reapplied, please contact SMC.</countermeasure>
Alarm_Co		C9 E down	Shut	<contents> In a controller compatible with batteryless absolute encoders, it occurs when an error is detected in the value from the absolute encoder when the power is turned on.</contents>	
mment_02 01 (01-201)	C9		control	<countermeasure> Verify that the controller and electric actuator combination is correct. If the problem reoccurs after the power is turned on again, please contact us.</countermeasure>	
Alarm_Co mment_02	CA	E	Shut down	<contents> In a controller compatible with batteryless absolute encoders, it occurs when an error is detected in the internal data of the absolute encoder when the power is turned on.</contents>	
02 (01-202)		OA .	_	control power	<countermeasure> If the problem reoccurs after the power is turned on again, please contact us.</countermeasure>

^{*1} When alarm is generated, 3-digit numbers after [-] in this table [(code)] are stored to [Alarm code] of Index 0x0050 (Sub Index 0x01-0x04) in the input area of the memory map. The numbers of the alarm code indicated in this table are expressed as decimal numbers.



17. Precautions for wiring and cable

Marning

(1) Adjusting, mounting or wiring change should never be done before shutting OFF the power supply to the product.

Electric shock, malfunction and damage can result.

- (2) Do not disassemble the cable. Use only specified cables.
- (3) Do not connect or disconnect the cable or connector with the power on.

⚠ Caution

- (1) Wire the connector securely. Do not apply any voltage to the terminals other than those specified in the Operation Manual.
- (2) Wire the connector securely.

Check for correct connector wiring and polarity.

(3) Take appropriate measures against noise.

Noise in a signal line may cause malfunction.

As a countermeasure, high voltage and low voltage cables should be separated, and keep wiring lengths short, etc.

(4) Do not route wires or cables together with power or high voltage cables.

The product may malfunction due to interference and surge voltages. Route the wires of the product separately from power or high voltage cables.

 
- (5) Take care that actuator movement does not damage cables.
- (6) Operate with cables secured. Avoid bending cables at sharp angles where they enter the product.
- (7) Avoid twisting, folding, rotating or applying an external force to the cable. Also avoid operating at sharp angles.

Risk of electric shock, broken wires, contact failure and loss of control of the product can occur.

(8) Fix the motor cable protruding from the product in place before using.

The motor cable is not robotic type cable and can be damaged when moved.

Do not place Part A in the diagram below in a flexible cable duct.



(9) Select "Robotic type cables" when deflecting actuator-cables repeatedly. Do not put cables into a flexible moving tube with a radius smaller than the specified value (minimum 50mm). Risk of electric shock, wire damage, contact failure and loss of control of the product can occur if

"Standard cables" are used in case of inflecting the cables repeatedly.

(10) Confirm proper wiring of the product.

Insulation failure (interference with another circuit, poor insulation between terminals etc.) could introduce excessive voltage or current to the controller or its peripheral devices and damage them.

(11) The Speed/pushing force may vary, depending on the cable length, load and mounting conditions etc.

If the cable length exceeds 5m, the speed/pushing force will be reduced 10% per 5 m maximum. (If cable length is 15m, 20% reduction maximum.)

Transport

⚠Caution

(1) Do not carry or swing the product by the motor or the cable.

18. Electric Actuators/Common Precautions

18.1 Design and selection

Marning

(1) Read the Operation Manual before using the product.

Handling or usage/operation other than that specified in the Operation Manual may lead to breakage and product failure.

Any damage attributed to use beyond the specifications is not guaranteed.

(2) There is a possibility of dangerous sudden action by the product if sliding parts of machinery are twisted due to external forces etc.

In such cases, human injury may occur, such as catching hands or feet in the machinery, or damage to the machinery itself may occur. The machinery should be designed to avoid such dangers.

(3) A protective cover is recommended to minimize the risk of personal injury.

If a driven object and moving parts of the product are in close proximity, personal injury may occur. Design the system to avoid contact with the human body.

- (4) Securely tighten all stationary parts and connected parts so that they will not become loose. When the product operates with high frequency or is installed where there is a lot of vibration, ensure that all parts remain secure.
- (5) Consider a possible loss of power source.

Take measures to prevent injury and equipment damage in the case of a power supply failure.

(6) Consider the behavior of an emergency stop of the whole system.

Design the system so that human injury and/or damage to machinery and equipment will not be caused, when it is stopped by a safety device for abnormal conditions such as a power outage or a manual emergency stop of the whole system.

(7) Consider the action when operation is restarted after an emergency stop or abnormal stop of the whole system.

Design the system so that human injury or equipment damage will not occur upon restart of operation of the whole system.

(8) Disassembly and modification is prohibited.

Do not disassemble the product or make any modifications, including additional machining. This may cause human injury and/or an accident.

(9) Do not use the stop signal, "EMG" of the controller and stop switch on the teaching box as the emergency stop for the system.

The stop signal, "EMG" of the controller and the stop switch on the teaching box are for decelerating and stopping the actuator. Design the system with an emergency stop circuit which is applied to the relevant safety standard separately.

(10) When using for vertical applications, it is necessary to build in a safety device.

The rod may fall due to the weight of the work.

The safety device should not interfere with normal operation of the machine.

⚠Caution

(1) Use the product for the maximum usable stroke.

The product will be damaged if it is used with a stroke exceeding the maximum stroke. Refer to the specifications of the product.

(2) When the product repeatedly cycles with partial strokes, operate it at a full stroke at least once a day or every 1,000 strokes.

Otherwise, lubrication can be lost.

(3) Do not use the product in applications where excessive external force or impact force is applied to it.

The product can be damaged. Components, including the motor, are manufactured to precise tolerances, so the slight test deformation may cause faulty operation or seizure.

(4) Return to origin cannot be carried out during operating.

This function cannot be carried out during positioning operation or pushing operation.

(5) Refer to a common auto switch (Best Pneumatics No 2), when an auto switch is built and used within the system.

18.2 Mounting

Warning

(1) Install and operate the product only after reading the Operation Manual carefully and understanding its contents.

Keep the manual in a safe place for future reference.

(2) Tighten threads with the proper tightening torque.

Tighten the screws to the recommended torque for mounting the product.

(3) Do not make any alterations to this product.

Alterations made to this product may lead to a loss of durability and damage to the product, which can lead to human injury and damage to other equipment and machinery.

(4) When using an external guide, the guide axis should be parallel to the actuator axis. There will be damage/excessive wear on the lead screw if the external guide is not parallel.

(5) When an external guide is used, connect the moving parts of the actuator and the load in such a way that there is no interference at any point within the stroke.

Do not scratch or dent the sliding parts of the actuator tube or piston rod etc., by striking them with other objects. Components are manufactured to precise tolerances, so the slightest deformation may cause faulty operation.

- (6) Prevent the seizure of rotating parts (pins, etc.) by applying lubricating grease.
- (7) Do not use the product before verifying that the equipment can operate properly.

 After mounting or repair, connect the power supply to the product and perform appropriate functional inspections to check it is mounted properly.
- (8) Cantilever

When the actuator is operated at high speeds while it is fixed at one end and free at the other end (flange type, foot type, double clevis type, direct mount type), a bending moment may act on the actuator due to vibration generated at the stroke end, which can damage the actuator. In such a case, install a support bracket to suppress the vibration of the actuator body or reduce the speed so that the actuator does not vibrate. Use a support bracket also when moving the actuator body or when a long stroke actuator is mounted horizontally and fixed at one end.

(9) When mounting the actuator or attaching to the work piece, do not apply strong impact or large moment.

If an external force over the allowable moment is applied, it may cause looseness in the guide unit, an increase in sliding resistance or other problems.

(10) Ensure sufficient space for maintenance activities.

Allow sufficient space for maintenance and inspection.



18.3 Handling Precautions

⚠Warning

(1) Do not touch the motor while in operation.

The surface temperature of the motor can increase to approx. 90°C to 100°C due to operating conditions. Energizing alone may also cause this temperature increase. Do not touch the motor when in operation as it may cause burns.

- (2) If abnormal heating, smoking or fire, etc., occurs in the product, immediately shut OFF the power supply.
- (3) Immediately stop operation if abnormal operation noise or vibration occurs.

 If abnormal operation noise or vibration occurs, the product may have been mounted incorrectly.

 Unless operation of the product is stopped for inspection, the product can be seriously damaged.
- (4) Never touch the rotating part of the motor or moving part of the actuator while in operation.
- (5) When installing, adjusting, inspecting or performing maintenance on the product, controller and related equipment, shut OFF the power supply to each of them. Then, lock it so that no one other than the person can turn the power on, or implement measures such as a safety plug.
- (6) In the case of the actuator with a servo motor (24VDC), the "motor phase detection step" is done by turning ON "SVON" just after the controller power is turned ON. The "motor phase detection step" moves the table/rod for the distance of one screw-lead maximum. (The motor rotates in the reverse direction if the table hits an obstacle such as the end stop damper.) Take the "motor phase detection step" into consideration for the installation and operation of this actuator.

⚠Caution

(1) Keep the controller and actuator combination as delivered for use.

The product parameters are set before shipment. If the controller is combined with a different actuator, failure can result.

- (2) Check the product for the following points before operation.
 - a) Damage to power supply line and signal line
 - b) Looseness of the connector to the power and signal lines
 - c) Looseness of the actuator/cylinder and controller/driver mounting
 - d) Abnormal operation
 - e) Emergency stop of the whole system
- (3) When more than one person is performing work, decide on the procedures, signals, measures for emergency and how to start the operation after the measures taken. Also, designate a person to supervise work other than those performing work.
- (4) Actual speed of the product will be changed by the workload.

Before selecting a product, check the catalog for the instructions regarding selection and specifications.

(5) Do not apply a load, impact or resistance, in addition to a transferred load during the "Return to Origin" operation.

When performing return to origin by pushing force, additional force will cause displacement of the origin position since it is based on detected motor torque.

- (6) Do not remove the name plate.
- (7) An operation test should be carried out using a low speed. Start operation using the predefined speed after confirming there are no problems.

[Grounding]

⚠Warning

- (1) Provide a good earth connection to the actuator.
- (2) The earth should be a dedicated earth connection. Class D dedicated grounding should be used. (Ground resistance 100Ω or less)
- (3) The earth cable length should be as short as possible.

[Unpacking]

⚠Caution

(1) Check that the received product is as ordered.

If a different product is installed, other than that ordered, injury or damage can result.



18.4 Operating environment

⚠Warning

- (1) Avoid use in the following environments.
 - 1. Locations where a large amount of dust and cutting chips are airborne.
 - 2. Locations where the ambient temperature is outside the range of the temperature specification (refer to specifications).
 - 3. Locations where the ambient humidity is outside the range of the humidity specification (refer to specifications).
 - 4. Locations where corrosive gas, flammable gas, seawater, water and steam are present.
 - 5. Locations where strong magnetic or electric fields are generated.
 - 6. Locations where direct vibration or impact is applied to the product.
 - 7. Areas that are dusty, or are exposed to splashes of water and oil drops.
 - 8. Areas exposed to direct sunlight (ultraviolet rays).
 - 9. Environment at an altitude of 1000 meters or higher Heat dissipation and withstand voltage will decrease.

Contact your SMC representative for details.

(2) Do not use in an environment where the product is directly exposed to liquid, such as cutting oils.

If cutting oils, coolant or oil mist contaminates the product, failure or increased sliding resistance can result.

(3) Install a protective cover when the product is used in an environment directly exposed to foreign matter such as dust, cutting chips and spatter.

Play or increased sliding resistance can result.

- (4) Shade the sunlight in the place where the product is applied with direct sunshine.
- (5) Shield the product if there is a heat source nearby.

When there is a heat source surrounding the product, the radiated heat from the heat source can increase the temperature of the product beyond the operating temperature range. Protect it with a cover, etc.

(6) Grease oil can be reduced due to the external environment and operating conditions. The lubrication performance may deteriorate and shorten the life of the product.

[Storage]

⚠Warning

- (1) Do not store the product with direct contact to rain or water drops. Do not store the product where it is exposed to harmful gases or liquid.
- (2) Store in an area that is shaded from direct sunlight and has a temperature and humidity within the specified range (-10°C to 60°C and up to 85%. No condensation or freezing.)
- (3) Do not apply vibration and impact to the product during storage.

18.5 Maintenance Precautions

⚠Warning

(1) Do not disassemble or repair the product.

Fire or electric shock can result.

(2) Before modifying or checking the wiring, the voltage should be checked with a tester 5 minutes after the power supply is turned OFF.

Electric shock can result.

ACaution

(1) Maintenance should be performed according to the procedure indicated in the Operating Manual.

Incorrect handling can cause injury, damage or malfunction of equipment and machinery.

(2) Removal of product

When equipment is serviced, first confirm that measures are in place to prevent dropping of work pieces and run-away of equipment, etc, then cut the power supply to the system. When machinery is restarted, check that operation is normal with actuators in the proper positions.

(3) When moving the electric actuator mover manually, disconnect the actuator cable.

When a mover is moved while the electric actuator is connected to the controller, the motor-induced voltage will be passed through to the controller, preventing the electric actuator from moving smoothly. In addition, if the actuator is moved frequently, the induced voltage may cause the controller to malfunction.

[Lubrication]

⚠Caution

(1) The product has been lubricated for life at the manufacturer's and does not require lubrication in service.

Contact SMC if lubrication is to be applied.

18.6 Precautions for actuator with lock

⚠Warning

(1) Do not use the lock as a safety lock or a control that requires a locking force.

The lock used for the product with a lock is designed to prevent dropping of work pieces.

(2) For vertical mounting, use the product with a lock.

If the product is not equipped with a lock, the product will move and drop the work piece when the power is removed. If the actuator with lock is not used, preventive measures should be taken in the design of the equipment.

- (3) "Measures against drops" means preventing a work piece from dropping due to its weight when the product operation is stopped and the power supply is turned OFF.
- (4) Do not apply an impact load or strong vibration while the lock is activated.

If an external impact load or strong vibration is applied to the product, the lock will lose its holding force and damage to the sliding part of the lock or reduced lifetime can result. The same situations will happen when the lock slips due to a force over the thrust of the product, as this accelerates the wear to the lock.

(5) Do not apply liquid or oil and grease to the lock or its surrounding.

If liquid or oil and grease is applied to the sliding part of the lock, its holding force will reduce significantly.

(6) Take measures against drops and check that safety is assured before mounting, adjustment and inspection of the product.

If the lock is released with the product mounted vertically, a work piece can drop due to its weight.

(7) When the actuator is operated manually (when "SVRE" signal is OFF), supply 24VDC to the [LK RLS] terminal of the power supply connector.

If the product is operated without releasing the lock, wear of the lock sliding surface will be accelerated, causing a reduction in the holding force and the life of the locking mechanism.

(8) Do not supply 24VDC power supply constantly to the [LK RLS].

Only supply 24VDC power supply to the [LK RLS (Lock release)] terminal during normal operation. If power is supplied to the [LK RLS] terminal continuously, the lock will be released, and workpieces may be dropped at stop (EMG).

For details of wiring please refer to the operation manual for the controller (JXC series).

19. Controller and Peripheral Devices/Specific Product Precautions

19.1 Design and selection

Warning

(1) Use the specified voltage.

Otherwise, malfunction and damage to the controller may result.

If the applied voltage is lower than the specified voltage, it is possible that the load cannot be moved due to an internal voltage drop. Check the operating voltage before use.

(2) Do not operate beyond the specifications.

Fire, malfunction or actuator damage can result. Check the specifications before use.

(3) Install an emergency stop circuit.

Install an emergency stop outside of the enclosure so that it can stop the system operation immediately and intercept the power supply.

- (4) In order to prevent danger and damage due to the breakdown and the malfunction of this product, which may occur at a certain probability, a backup system should be established in advance by giving a multiple-layered structure or a fail-safe design to the equipment, etc.
- (5) If fire or personal injury is expected due to abnormal heat generation, ignition, smoking of the product, etc., cut OFF the power supply for this product and the system immediately.
- (6) The upper limit of writing cycle to EEPROM of the JXCL1 controller is 100,000 cycles. If the upper limit of writing cycle is exceeded, the writing will not be performed correctly.

19.2 Handling Precautions

Marning

(1) The inside of the controller and its connector should not be touched.

It may cause an electric shock or damage to the controller.

(2) Do not perform operation or setting of this equipment with wet hands. It may cause an electric shock.

(3) A product that is damaged or missing any components should not be used.

Electric shock, fire, and injury can result.

(4) Use only the specified combination of controller and electric actuator.

It may cause damage to the controller or the actuator.

- (5) Be careful not to be caught or hit by the workpiece while the actuator is moving. It may cause an injury.
- (6) Do not connect the power supply to the product until it is confirmed that the workpiece movement area is safe.

The movement of the workpiece may cause an accident.

(7) Do not touch the product when it is energized and for some time after power has been disconnected, as it can be very hot.

It may cause burns due to the high temperature.

(8) Check for voltage using a tester at least 5 minutes after power-OFF when performing installation, wiring and maintenance.

Electric shock, fire, and injury can result.

(9) Do not use the product in an area where it could be exposed to dust, metallic powder, machining chips, or splashes of water, oil or chemicals.

A failure or malfunction can result.

(10) Do not use the product in an area where a magnetic field is generated.

It will cause failure or malfunction.

(11) Do not install the product in an environment where flammable gas, explosive or corrosive gas, liquids or other substances are present.

It could lead to fire, explosion and corrosion.

- (12) Avoid radiant heat from large heat sources such as direct sunlight or hot furnaces. It will cause failure of the controller or its peripheral devices.
- (13) Do not use the product in an environment subjected to cyclic temperature changes. It will cause failure of the controller or its peripheral devices.
- (14) Do not use in a location where surges are generated.

When there are units that generate a large amount of surge around the product (for example solenoid type lifters, high frequency induction furnaces, motors, etc.), this may cause deterioration or damage to the product's internal circuit. Avoid surge generation and crossed lines.

- (15) Do not install the product in an environment subjected to vibration and impact. It will cause failure or malfunction.
- (16) If this product is used in conjunction with a relay or solenoid valve, use a type with a surge absorbing element built-in.

19.3 Mounting

Marning

(1) The controller and its peripheral devices should be installed on a fire-proof material.

Direct installation on or near a flammable material may cause fire.

(2) Do not install this product in a location subject to vibration and impact.

A failure and malfunction can result.

(3) Take measures so that the operating temperature of this controller and its peripheral devices are within the range of the specifications.

Also, this controller should be installed with at least 50mm space between each side of it and other structures or components.

It may cause a malfunction of the controller and its peripheral devices and a fire.

- (4) Do not mount the controller and its peripheral devices near a large electromagnetic contactor or no-fuse breaker which generates vibration on the same panel. Mount them on different panels, or keep the controller and its peripheral devices away from such a vibration source.
- (5) The controller and its peripheral devices should be installed on a flat surface.

If the mounting surface is distorted or not flat, excessive force may be applied to the housing, etc. causing malfunction.

19.4 Wiring

Marning

(1) Do not damage the cable or apply a heavy object or pinch the cable. Avoid repeatedly bending or stretching the cable.

It may cause an electric shock, fire, or breaking of wire.

(2) Wire correctly.

Incorrect wiring could damage the controller or its peripheral devices depending on the seriousness.

(3) Do not perform wiring while the power is on.

It can damage the controller or its peripheral devices could be damaged, causing malfunction.

(4) Do not carry this product by holding its cables.

It may cause an injury or damage to the product.

(5) Do not route wires or cables together with power or high voltage cables.

The wires to the controller or its peripheral devices can be interrupted with noise or induced surge voltage from power lines or high-voltage lines, causing malfunction.

Route the wires of the product separately from power or high voltage cables.

(6) Verify the insulation of wiring.

Insulation failure (interference with another circuit, poor insulation between terminals etc.) could introduce excessive voltage or current to the controller or its peripheral devices and damage them.



19.5 Power supply

ACaution

- (1) Use a power supply with low noise between lines and between power and ground. In cases where noise is high, use an isolation transformer.
- (2) Separate the controller input power supply and the power supply for input/output signals and wire them separately at.
- (3) Take appropriate measures to prevent lightning surges. Ground the surge absorber for lightning separately from the ground connection for the controller and its peripheral devices.

19.6 Grounding

Marning

- (1) Ensure that the product is grounded to allow the noise tolerance of the controller. Otherwise it may cause an electric shock or fire.
- (2) A dedicated Ground connection must be used. Grounding should be to a D-class ground connection. (Ground resistance 100Ω or less)
- (3) The grounding point should be as near as possible to the controller to keep the cable length short.
- (4) In the unlikely event that malfunction is caused by the ground connection, it may be disconnected.


19.7 Maintenance

Marning

- (1) Perform maintenance checks periodically.
 - Confirm wiring and screws are not loose.
 - Loose screws or wires may cause unexpected malfunction.
- (2) Conduct an appropriate functional inspection and test after completing maintenance. In case of any abnormalities (if the actuator does not move, etc.), stop the operation of the system. Otherwise, an unexpected malfunction may occur and it will become impossible to ensure safety. Give an emergency stop instruction to confirm safety.
- (3) Do not disassemble, modify or repair this controller or the peripheral devices.
- (4) Do not put anything conductive or flammable inside of the controller. Fire or explosion can result.
- (5) Do not perform an insulation resistance test or insulation withstand voltage test.
- (6) Ensure sufficient space for maintenance.
 - Design the system to allow the required space for maintenance.

20. Troubleshooting

When any failure occurs with this product, the following chart can be used to identify the cause of the failure. When none of the causes in the troubleshooting can be confirmed, it is presumed that the product is faulty and normal operation can only be recovered by the replacement of a part. It is possible that this product may be damaged due to the operating conditions (applications). Please contact SMC to discuss appropriate measures.

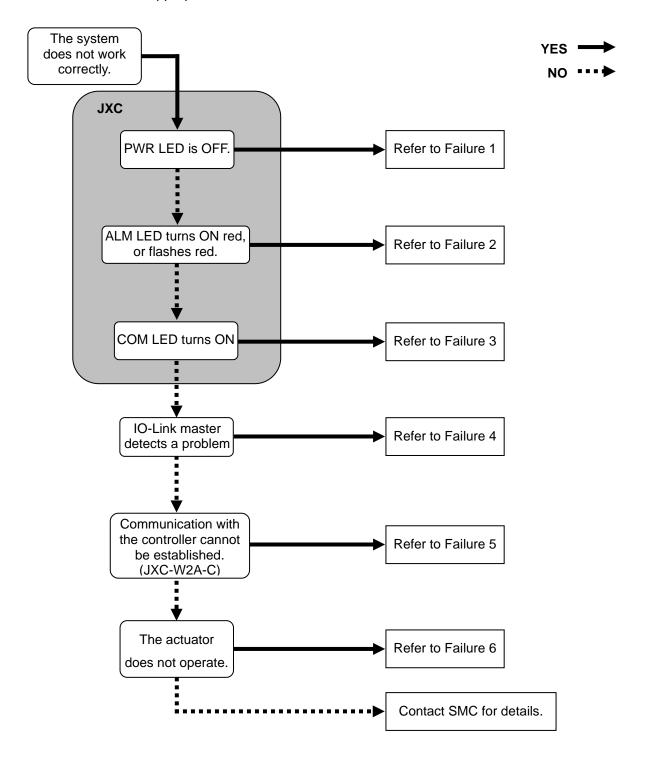

Problem No.	Problem	Possible causes	Investigation method and location of possible causes	Countermeasures
1	PWR LED is OFF.	Power fault	Check that PWR (green) of the controller turns OFF at either of when power is supplied, SVON ON is instructed or the actuator is operating.	Use an appropriate voltage and power supply capacity in reference to the operation manual of the actuator and controller connected. → 3. Specifications → 5. External Connections
		C24V Power fault	Check C24V voltage to the JXCL1 controller PWR connector.	Verify that the correct voltage is supplied to the C24V terminal. Connect the communication cable correctly so that the connector is not loose.
		Incorrect wiring	Check the incorrect wiring, broken wire and short circuit of the power supply plug for JXCL1.	Please correct the wiring in reference to Controller Operation Manual. → <u>5. External Connections</u> → <u>6. Power Supply Plug</u>
	ALM LED is ON	Alarm generated	If it is, check the type of alarm referring to this manual.	Refer to the controller operation manual and take appropriate measures. → 16. Alarm for Motor Control
2	ALM LED is ON and actuator operates abnormally	Misuse of Data storage	Check the model number of the controller to replace is the same as the controller to be replaced. Check the parameter for the connected actuator was written to the JXC controller with JXC-BCW, if the controller is replaced with JXCL1*-BC.	Replace with the JXC controller which is the same model number of the controller to be replaced. If the controller is replaced with JXCL1*-BC, replace the controller after writing the parameters for the connected actuator with JXC-BCW.
	ALM LED is flashing and COM LED is OFF	IO-Link master device power supply failure	Check the power supply voltage supplied from the IO-Link master to the JXCL1 controller.	Verify that power is supplied to the IO-Link master equipment. Connect the communication cable correctly so that the connector is not loose.
			Make sure that there are no loose connectors, incorrect wiring or broken wires in the communication cables.	Connect the communication cable correctly so that the connector is not loose. (Replace the cable if it is broken.)
	COM LED is ON	IO-Link master device power supply failure	Check the power supply voltage supplied from the IO-Link master to the JXCL1 controller.	Verify that power is supplied to the IO-Link master equipment. Connect the communication cable correctly so that the connector is not loose.
3			Make sure that there are no loose connectors, incorrect wiring or broken wires in the communication cables.	Connect the communication cable correctly so that the connector is not loose. (Replace the cable if it is broken.)
		JXC controller C24V power supply failure	Check C24V voltage to the JXCL1 controller PWR connector.	Verify that the correct voltage is supplied to the C24V terminal. Connect the communication cable correctly so that the connector is not loose.
			Make sure that there are no loose wires, incorrect wiring or broken wires in JXCL1 controller PWR connector.	Connect the communication cable correctly so that the connector is not loose. (Replace the cable if it is broken.)



	IO-Link master detects a problem (COM LED is ON)	Communi cation failure between IO-Link master and the master of the IO-Link.	Make sure that the IO-Link master and the master of the IO-Link are established.	Verify that power is supplied to the master of the IO-Link master. Check if there are broken cables or loose connectors of the cable between the IO-Link master and the master of the IO-Link master. When there are broken cables, replace the cable and connect the cables correctly.
4		IO-Link matching failure	When the matching level of connection port for the JXCL1 controller is "TYPE_COMP (type is compatible)", confirm that the JXC controller and device ID registered to the master are matched.	Connect a JXCL1 controller for which the device ID matches with the device ID registered to the master. →10.2.2 ISDU Parameter
			When the matching level of connection port for the JXCL1 controller is "IDENTICAL (complete match)", confirm that the JXC controller and serial No. registered to the master are matched.	Connect a JXCL1 controller for which the device ID matches with the serial No. registered to the master. →10.2.2 ISDU Parameter
		IO-Link communi cation mode is not transferred to "Operate mode."	Check the contents of the "device access lock" for the JXCL1 controller and the setting of "data storage back up level" for the port connected to the IO-Link master.	Unlock the data storage function using the JXCL1 controller "device access lock" setting. Or, disable the data storage back up level for the port connected to the JXCL1 controller of the IO-Link master. →10.2.2(1-2)Device Access Locks
5	Communication fault (JXC — W2A-C)	The USB driver is not installed	Check that the USB driver for the conversion unit is installed.	Please install the USB driver of the communication unit. The USB driver's installation starts when the communication unit is connected with PC. Details of the installation procedure are shown in "Installation procedure of the JXC-W2 setting software".
		Incorrect COM port setting	Please confirm if the correct COM port is set to the ACT Controller.	The COM port allocated to the controller is different for different PC's. Check and confirm the COM port number with the controller connected to the PC. The COM port number can be checked using the Device Manager of the PC. For details of the COM port checking and setting methods refer to the "JXC-W2 Controller Configuration Software Installation Manual".
		Connection failure	Please confirm the connection status.	Please confirm motor controller (JXC) = communications cable = communication unit = USB cable = PC is connected. For example, communication cannot be established if the connector has been damaged. Please confirm the power supply of motor controller (JXC) has been turned ON. Communication cannot be established if the power supply is OFF. If equipment other than the motor controller (JXC) (PLC and measurement equipment) is connected with PC, remove these before checking. (There is a possibility that the communication with other equipment interferes in PC.)
	Actuator operates abnormally	Misuse of Data storage	Check the model number of the controller to replace is the same as the controller to be replaced. Check the parameter for the connected actuator was written to the JXC controller with JXC-BCW, if the controller is replaced with JXCL1*-BC.	Replace with the JXC controller which is the same model number of the controller to be replaced. If the controller is replaced with JXCL1*-BC, replace the controller after writing the parameters for the connected actuator with JXC-BCW.



	1	1		
	Does not operate at all.	Set data failure	Check the Endian type of the upper level communication transmission format for IO-Link (big or little endian).	Numeric data byte order may change depending on the Endian type of the transmission format of the upper communication of IO-Link master. Form the data based on the Endian type of the upper communication. →21. Handling sent/received data
		Lock release error	When the unlock switch is turned ON or OFF there is an unlocking sound made.	If there is no sound of lock release, the lock brake may be broken. → If the problem persists, please contact SMC.
		External equipment failure	Check that the PLC connected to the controller operates correctly. Test operation of the controller on its own.	Refer to the controller operation manual and take appropriate measures. → 10. Memory map)
		Unsuitable spec.	Check if the controller's specifications are appropriate, the power supply is suitable and the controller is compatible with the actuator.	Take appropriate measures according to this manual. → 3. Specifications
	Operation stops intermittently	Incorrect wiring	Is the wiring connected correctly? Refer to the controller operation manual to confirm wiring, and check for broken wires and short-circuits.	Correct the wiring so that the input/output of each signal is performed appropriately. → 5. External Connections
		Electric noise	Connect to Ground correctly. Avoid bundling the cables.	Refer to the controller operation manual and take appropriate measures. → 3.4 Mounting
6		Incorrect parameters	Check that the parameter values are correct. Also, check the cables are not bundled.	Take appropriate measures according to this manual. → 11. Settings and Data Entry
		Voltage drop	Check for a temporary voltage drop in the power supply? (If there is a temporary voltage drop in the power supply, the "EMG" signal from the PWR connector will turn OFF so the actuator will stop. However, this stop will be released when the voltage recovers.)	There is a possibility of a momentary voltage drop because the capacity of the power supply is insufficient, or if the power supply is "inrush-current control" type. If necessary, replace the power supply. → 3. Specifications
		Failure of pushing operation	Check that "INP" turns ON during a pushing operation. (If completion of the pushing operation is detected by "INP", the PLC cannot confirm completion)	Check "INP" signal before the energy saving mode is turned ON. → 10.1 Process data
		Unsuitable spec.	Check if the controller's specifications are appropriate, the power supply is suitable and the controller is compatible with the actuator.	Take appropriate measures according to this manual. → 3. Specifications
		Signal timing	Check the timing of the signal from the PLC to the controller.	Set the interval time between signals to more than twice the communication cycle time, when the signals are to be continuously input, because PLC processing delays and controller scanning delays can occur. 12.4 Controller input signal response time



	Incorrect origin position	If it is a pushing operation, repeat return to origin operations several times to check if the actuator returns to the origin correctly. Perform the Return to Origin position operation several times to check the Origin position.	Take measures to make the actuator operate normally (remove foreign matter that interferes with the actuator movement, etc.)
The actuator does not move to the correct position.	Incorrect parameters	Check that the parameter values are appropriate and the program is correct. Review the maximum speed, the maximum acceleration and the maximum deceleration of the actuator.	Modify the parameters and test the operation. → 11. Settings and Data Entry
	Unsuitable specification	Check if the controller's specifications are appropriate, the power supply is suitable and the controller is compatible with the actuator.	Take appropriate measures according to this manual. → 3. Specifications
	Incorrect wiring	Is the wiring connected correctly? Refer to the controller operation manual to confirm wiring, and check for broken wires and short-circuits.	Correct the wiring so that the input/output of each signal is performed appropriately. → 5. External Connections
	Unsuitable specification	Check if the controller's specifications are appropriate, the power supply is suitable and the controller is compatible with the actuator.	Take appropriate measures according to this manual. → 3. Specifications
The actuator does not move correctly.	Signal timing	Check the timing of the signal from the PLC to the controller.	Set the interval time between signals to more than twice the communication cycle time, when the signals are to be continuously input, because PLC processing delays and controller scanning delays can occur. 12.4 Controller input signal response time
	Data not stored correctly	Check whether data (step data, parameter) is written correctly. Do not turn OFF the controller input power or remove the cable while data is being written (green light flashing).	Input correct data (step data, parameter) again and confirm operation. → 3.2 Parts Description → 11. Settings and Data Entry
	Incorrect parameters	Check that the parameter values are correct. Review the maximum speed and the maximum acceleration of the actuator.	Modify the values of the parameters and test the operation. → 11. Settings and Data Entry
	Operation pattern is not suitable.	Check if a trapezoidal acceleration/deceleration is programmed for the actuator operation. In case of such operation, the actuator may start slowing down before it reaches the maximum speed.	Modify the setting to make the moving distance longer or the acceleration larger → 12. Settings and Data Entry
Speed not achieved	Unsuitable specification	Check if the controller's specifications are appropriate, the power supply is suitable and the controller is compatible with the actuator.	Take appropriate measures according to this manual. → 3. Specifications
	Voltage drop	Check for a temporary voltage drop in the power supply? (If there is a temporary voltage drop in the power supply, the EMG terminal of PWR power connector will turn OFF so the actuator will stop. However, this stop will be released when the voltage recovers.)	There is a possibility of a momentary voltage drop because the capacity of the power supply is insufficient, or if the power supply is "inrush-current control" type. If necessary, replace the power supply. → 3. Specifications

6



21. Handling of sent/received data

The Byte order for the process data and parameters for the IO-Link communication is big Endian type.

When the upper communication byte order is little Endian, the byte order of a word or double word data size will be changed when they are accessed.

This chapter explains the data handling when the connected upper communication byte order is big or little Endian type.

The handling of a negative value is also explained.

(1) When the upper communication data byte order is big Endian

(1-1) Access of a word data

- E.g. 1) shows an example when the speed, acceleration speed and deceleration speed of a process data in word data is accessed.
 - **E.g. 1)** When 100 mm/s is written to the "speed(Byte4, Byte5)" of the process data output: 100 mm/s is 0x0064h in hexadecimal.

When the upper communication byte order is big Endian, the data is written in order of 0x **00 64**.

	Sp	eed	
	0x00(Byte4:Speed H)	0x64(Byte5:Speed L)	Word
M	SB	LSB	

(1-2) Access of double word data

- E.g. 2) shows an example when a double word data such as "target position" of a process data in word data is accessed.
 - **E.g. 2)** When 700.00 mm/s is written to the "target position (Byte6-Byte9)" of the process data output: "Position" is based on the unit by 0.01mm.

The value to express -700.00 mm is 70000 in decimal number, and 0x00011170 in hexadecimal.

When the upper communication byte order is big Endian, the data is written in order of 0x **00 01 11 70**.

	Target	position	Double word
0x00(Byte6:Taget Posn HH)	0x01(Byte7:Taget Posn HL)	0x11(Byte8:Taget Posn LH)	0x70(Byte9:Taget Posn LL)
MSB			LSB

(2) When the upper communication data byte order is little Endian

(2-1) Access of word data

- E.g. 3) shows an example when the speed, acceleration speed, and deceleration speed of a process data in a word data is accessed.
 - **E.g. 3)** When 100 mm/s is written to the "speed (Byte4, Byte5)" of the process data output: 100 mm/s is 0x0064h in hexadecimal.

When the upper communication byte order is little Endian, the data is written in order of 0x 64 00.

Sp	eed	
0x64(Byte4: Speed L)	0x00(Byte5:Speed H)	Word
MSB	LSB	



(2-2) Access of double word data

- E.g. 4) shows an example when a double word data such as "target position" in double word data is accessed.
 - E.g. 4) When 700.00 mm/s is written to the "target position (Byte6-Byte9)" of the process data output: Position" is based on the unit by 0.01mm.

The value to express -700.00 mm is 70000 in decimal number, and 0 x 00011170 in hexadecimal.

When the upper communication byte order is little Endian, the data is written in order of 0x **70 11 01 00**.

Target position

Double word

0x70(Byte9:Taget Posn LL)|0x11(Byte8:Taget Posn LH)|0x01(Byte7:Taget Posn HL)|0x00(Byte6:Taget Posn HH)|
MSB LSB

(3) Negative value data

Please refer to E.g. 5) below when using negative value data.

In the example, 4byte negative value data is explained.

E.g. 5) When 700.00 mm/s (negative value) is written to the "target position (Byte6-Byte9)" of the process data output:

"Position" is based on the unit by 0.01 mm.

Negative values are expressed using two's complement notation.

The value to express -700.00 mm is -70000 in decimal number, and 0 x FFFEEE90 in hexadecimal number.

The byte order of the written data needs to be changed depending on the Endian type of the upper communication as shown below.

When the upper communication byte order is big Endian, and data is written in double word data. \rightarrow 0x **FF FE EE 90**

When the upper communication byte order is little Endian, and data is written in double word data. \rightarrow 0x 90 EE FE FF



22. Definitions and terminology

The major terminology used in this Operation Manual is stated below.

	Terminology	Definition
С	Communication speed	Data transmission speed of a network such as a Fieldbus. The speed is determined by the upper device (PLC etc.). The unit is bits per second (bps).
	Communication cycle time	This is the cycle for sending data from master to slave (JXCL1 controller).
D	Data Storage	This is a function to store the IO-Link device parameter settings to the IO-Link master. With the IO-Link data storage function, the IO-link device can be replaced easily without re-setting the parameters.
	Device ID	ID specified for each IO-Link device. Each product number has its own device ID. The product number for a controller is different depending on the mounting method or connected actuator, but the device ID is common.
	Device Parameter	One of the ISDU parameters for IO-Link protocol specifications for which the order and contents are predetermined.
	Direct Parameter	Parameter which can easily be accessed in IO-Link communication.
F	Fieldbus	An industrial communication system, which uses a defined protocol to transfer data between devices on a network. A typical automation system will use a fieldbus network to exchange data between a PLC master and the actuators/sensors.
1	IODD	IODD (I/O Device Description) Device Definition file to provide properties and parameters to establish the functions and communications of an IO-Link device. IODD includes the main IODD file and a set of image files such as vendor logo, device picture and device icon.
	ISDU parameter	IO-Link communication parameter which is accessed non-periodically. In the JXCL1 controller, device parameters and actuator parameters and step parameters are designated for an SMC product.
Р	PLC	Abbreviation of Programmable Logic Controller, a digital computer used for automation of electromechanical processes.
	Process data	Periodically communicated data using IO-Link communication. This process data enables the operation of the actuator control flag and provides numerical instructions, and will confirm actuator conditions including the position.
Т	Topology	Connection configuration of the Fieldbus network Expresses how each terminal and control components are connected. The typical topology is star type, linear type and ring type.
V	Vendor ID	ID to indicate the manufacture of the IO-Link device. This is controlled by the IO-Link community. The SMC vendor ID is 0x0083.

Trademark

The company name, system name, and product name described in this document are registered trademarks of each individual company. In this document TM and (R) are not specified.



Revision history

- A: Contents revised in several places. [Nov 2020]
- B: Added supported OS [Mar 2023]
- C: Contents revised in several places. [Dec 2023]
- D: "Safety Instrutions" revised [Feb 2025]

SMC Corporation

URL https://www.smcworld.com

Note: Specifications are subject to change without prior notice and any obligation on the part of the manufacturer. © SMC Corporation All Rights Reserved

