
Remote Type Pressure Sensors/ Pressure Sensor Controllers

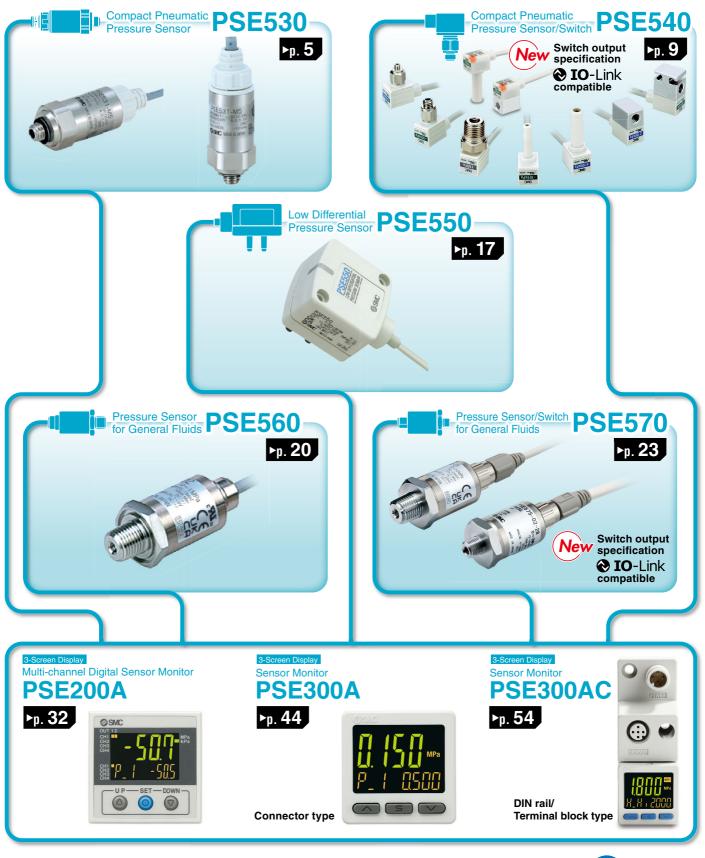

PSE Series


CAT.EUS100-56D-UK

IO-Link Compatible

Two types of connection are supported depending on the application.

For the communication of sensor data/Reduced installation space
 Direct connection PSE54□-L/PSE57□-L2

 On site setting and the confirmation of measured values/Reduced wiring
 Hub connection PSE202A/203A

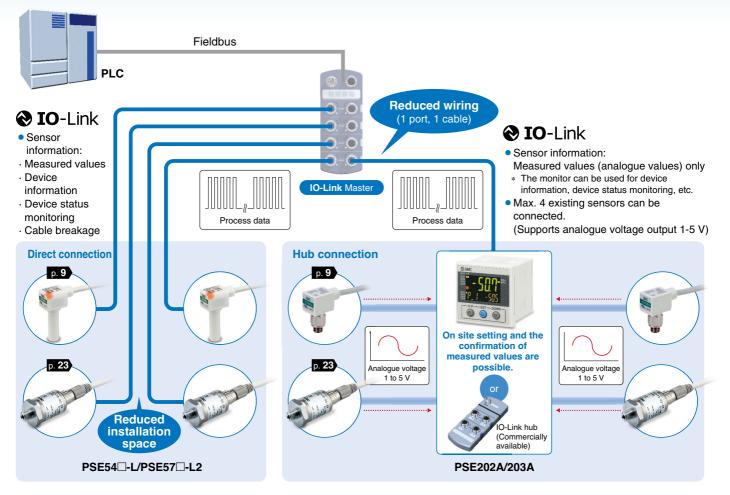

Compatible Series PSE54 -L / PSE57 -L2 p.11,25

Visualisation of operation/equipment status/Remote monitoring and control by communication

Implement diagnostic bits in the process data.

The diagnostic bit in the cyclic process data makes it easy to find problems with the equipment. It is possible to find problems with the equipment in real time using the cyclic (periodic) data and to monitor such problems in detail with the noncyclic (aperiodic) data.

Process Data

110000	5 Data											Card Conta				
Bit offset	l	tem		N	ote		l ſ	[Diagnosi	s items		310				M
0	OUT	1 output	0: C)FF	1: ON			Outside of	of rated	oressure	range	an -		- Taken to	and a state	
1	OUT	2 output	0: C)FF	1: ON			Interna	l produc	t malfunc	tion				11	
8	Diagnosis (Measuremen	t) 0: N	lormal	1: Abn	ormal	// [· Over cu	rrent						and the second se	
14	Diagno	sis (Error)	0: N	lormal	1: Abn	ormal		· Outside		clear rang	ge	-				
15	Diagno	sis (Error)	0: N	lormal	1: Abn	ormal		· IO-Link			ror		IO-Link (Compatible	e Device	
16 to 31	Measured p	pressure valu	е	Signe	d 16 bit			 Snapsh 	ot failure]-L / PSE		
													_			
Bit offset	31 30	0 29	28	27	26	25	24	23	22	21	20	19	18	17	16	
Item	m Measured pressure value (PD)															
Bit offset	15	14	13	12	11	10	9	8	7	6	5	4	3	2	1	0
Itom	System error	Other than system error		R	eservatio	on		Measurement			Rese	rvation	•		OUT2	OUT1
Item	Diam							Diamaria							0	a

Diagnosis


SMC

Switch output

Diagnosis

Remote Type Pressure Sensors/Pressure Sensor Controllers PSE Series


Compatible with small switches for general fluids

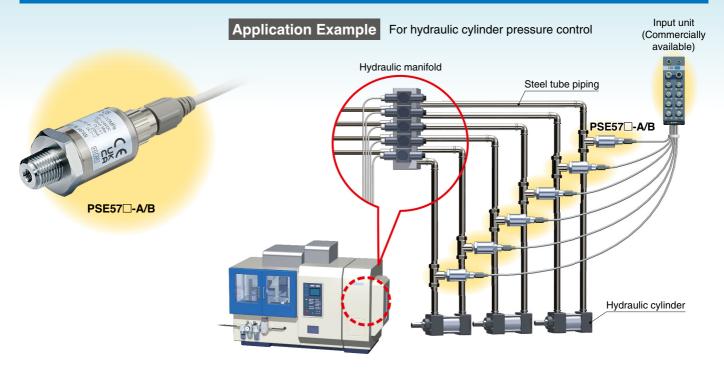

Switch Output Specification (Factory setting)


Eliminates the need to set the threshold value on-site, reducing labour!

- Is there more than one sensor with the same settings in the same equipment?
- Are there repeat devices equipped with sensors with the same settings?
- Is there a sensor that needs its settings at the equipment shipping destination to be tamper proof?

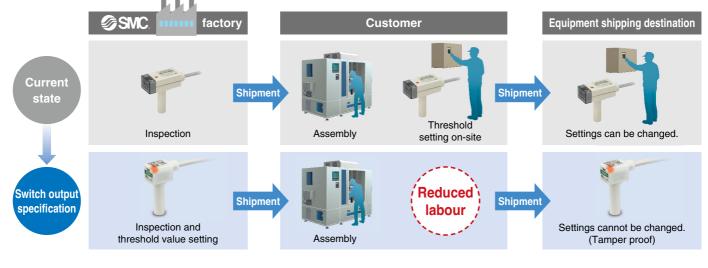



PSE Series Variations

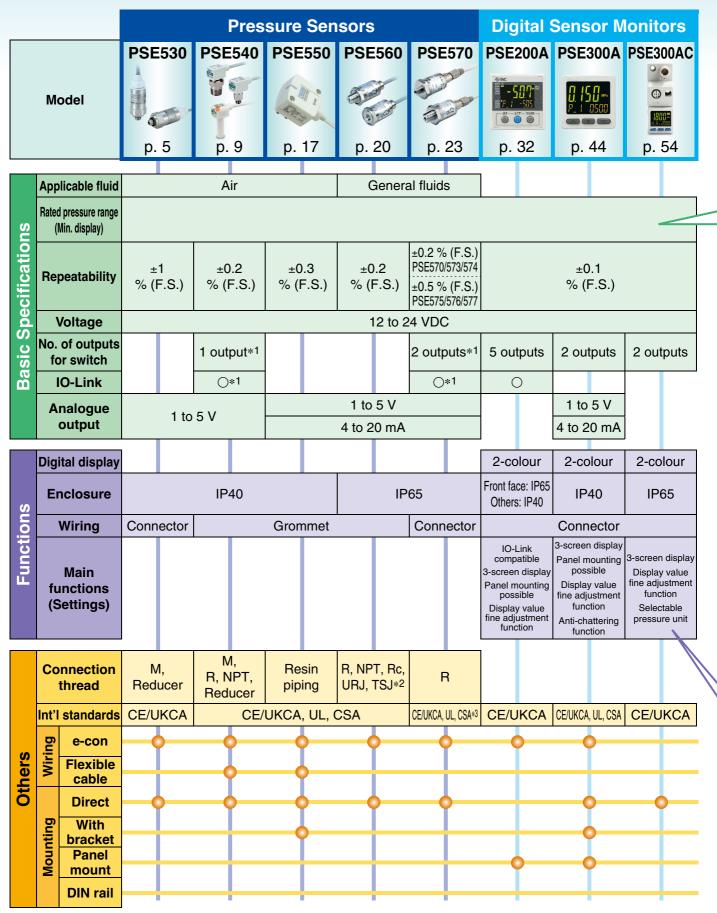

*1 The IO-Link compatible switch output specification cannot be connected to the PSE200A/PSE300A(C).

*2 URJ: Face seal fitting, TSJ: Compression fitting *3 Excludes the IO-Link/2-output type

	Pressure Sensor/ <i>PSE5</i> Series								
		PSE53	PSE54	PSE55	PSE56	PSE57			
	Rated pressure range	Ū.			() man	alla ha			
Vacuum		PSE531	PSE541	_	PSE561	_			
Compound pressure	-100 kPa	PSE533	PSE543	_	PSE563	PSE573			
	0 100 kPa	PSE532	_	_	_	_			
	0500 kPa	_	_	_	PSE564	PSE574			
Positive	0 1 MPa	PSE530	PSE540	_	PSE560	PSE570			
pressure	0	_	_	—	_	PSE575			
	0 5 MPa	—	_	_	_	PSE576			
	0 / 10	—	_	—	_	PSE577			
Low differential pressure	0:2 kPa	—	-	PSE550	-	—			

Digital Sensor Monitor/PSE200A/300A Series

	PSE200A PSE300A PSE300AC Image: State of the state of								
Applicable pressure sensor model*1					Display/	Display/Smallest settable increment			
PSE531	PSE541	_	PSE561	_	0.1 kPa	0.1 kPa	0.1 kPa		
PSE533	PSE543	_	PSE563	PSE573	0.1 kPa	0.2 kPa	0.1 kPa		
PSE532	_	_	-	_	0.1 kPa	0.1 kPa	0.1 kPa		
_	_	_	PSE564	PSE574	_	1 kPa	1 kPa		
PSE530	PSE540	_	PSE560	PSE570	0.001 мра	0.001 мра	0.001 мра		
_	—	PSE550	-	_	_	0.01 kPa	0.001 kPa		
* Analogue o	Analogue output only								

Analogue output only


Main Functions * For a	letails, refer to the "Operation Manual" on the SMC website.
Key-lock	Locks the keys to prevent accidental operation
Peak/Bottom value holding	Displays the min. and max. values being set and keeps those values on the display
Auto-preset	Allows for the pressure to be set automatically In the case of suction verification, it memorises the pressure when adsorbed and released. After repeating several times, the optimum values are calculated automatically.
Auto-shift	Stable switch output is possible even when the supply pressure fluctuates. The set value is corrected automatically in accordance with the fluctuations in the supply pressure.
Display value fine adjustment	Allows for the displayed values to be adjusted (±5 %) and the evening out of the variations in the displayed values of each pressure switch
Anti-chattering	Prevents malfunction due to sharp pressure fluctuations The detection of momentary pressure fluctuation as abnormal pressure can be prevented by changing the response time settings.




Compact Pneumatic Pressure Sensor

PSE530 Series

Series **Rated pressure range** 100 kPa 500 kPa –100 kPa 1 MPa **PSE530** 0 1 MPa **PSE531** -101 kPa 0 **PSE532** 0 101 kPa **PSE533** -101 kPa 101 kPa

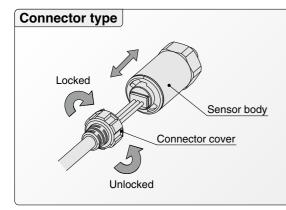


110

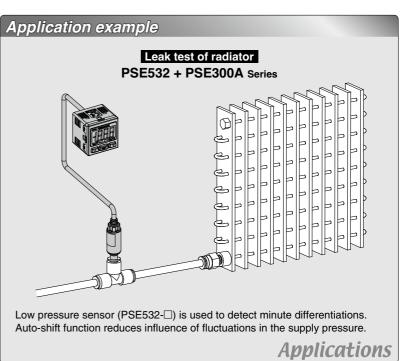



RoHS

Pressure Sensor PSE530 Series

How to Order

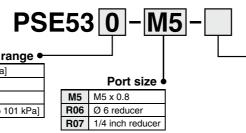


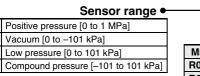

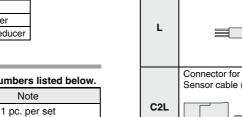

When only optional parts are required, order with the part numbers listed below. Description Part no. ZS-28-C Connector for pressure sensor controller `ahla

Sensor cable	29-20-F	Cable length: 3 m
Connector for pressure sensor controller + Sensor cable	ZS-26-J	Cable length: 3 m The connector is not attached to the cable at the time of shipment.

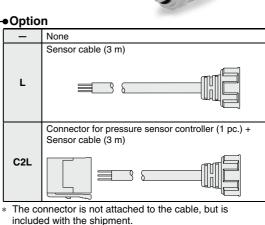

RoHS

PSE530

PSE540

PSE550

PSE560

PSE570

Specifications

Options/Part Nos.

0

1 2

3

	Model	PSE530 (Positive pressure)	PSE531 (Vacuum)	PSE532 (Low pressure)	PSE533 (Compound pressure)		
Bated p	pressure range	0 to 1 MPa	0 to -101 kPa	0 to 101 kPa	-101 to 101 kPa		
•	on analogue output range	-0.1 to 0 MPa	10.1 to 0 kPa	-10.1 to 0 kPa			
	ressure	1.5 MPa		500 kPa	I		
Applica	ble fluid		Air/Non-corrosive gas	s/Non-flammable gas			
Power s	supply voltage	12 to 24 VDC ±10 %, Ripple (p-p) 10 % or less (with reverse connection protection)					
Current	t consumption		15 mA or less	(with no load)			
Output	specifications	Analogue output 1 to 5 V (within rated pressure range), 0.6 to 1 V (within extension analogue output range), Output impedance: Approx. 1 kΩ					
Accuracy	(Ambient temperature at 25 °C)	±2 % F.S. (within rated pressure range), ±5 % F.S. (within extension analogue output range)					
Linearit	ty	±1 % F.S.					
Repeatability		±1 % F.S.					
Power s	supply voltage effect	$\pm 1~\%$ F.S. based on the analogue output at 18 V ranging from 12 to 24 VDC					
ent	Enclosure	IP40					
ů	Temperature range	Operating: 0 to 50 °C; Stored: -10 to 70 °C (No freezing or condensation)					
Enclosure Temperature range Withstand voltage		1000 VAC (in 50/60 Hz) for 1 min between terminals and housing					
En	Insulation resistance	5 M Ω or more (500 VDC measured via megohmmeter) between terminals and housing					
Temper	rature characteristics	±2 % F.S. (25 °C reference)					
Sensor	cable/Option	Halogen-free heavy-duty cable, 3 cores, Ø 2.7, 3 m, Conductor area: 0.15 mm ² , Insulator O.D.: 0.8 mm					
Standa	rds	CE/UKCA marking					

Piping Specifications


Part no.		M5	R06	R07		
Port size		M5 x 0.8 male thread	Ø 6 reducer type	1/4 inch reducer type		
Materials of parts in contact with fluid		Pressure sensor: Silicon, O-ring: NBR				
		Body: Stainless steel 304	Body	: PBT		
Waight	With sensor cable (3 m)	41 g	41 g 38 g			
Weight	Without sensor cable	7 g	3.8	3 g		

SMC


PSE530 Series

Internal Circuit and Wiring Example

PSE53 Voltage output type 1 to 5 V Output impedance Approx. 1 k Ω

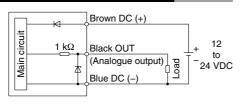

Analogue Output

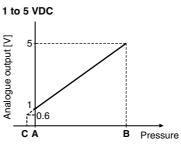


Range	Rated pressure range	Α	В	С
For vacuum	0 to –101 kPa	0	–101 kPa	10.1 kPa
For compound pressure	-101 kPa to 101 kPa	-101 kPa	101 kPa	—
For low pressure	0 to 101 kPa	0	101 kPa	–10.1 kPa
For positive pressure	0 to 1 MPa	0	1 MPa	–0.1 MPa

Dimensions

PSE53
-M5


29.4 7.2 12 12 12 29.4 7.2 15×0.8 13.4 14 15×0.8 15

PSE53

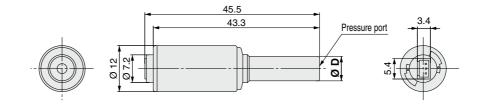

Model Applicable fitting size (
))
PSE53□-R06 6	
PSE53□-R07 1/4"	

With sensor cable

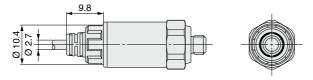

PSE540	
PSE550	
PSE560	
PSE570	
PSE200A	
gital Sensor Monito PSE300A	
PSE300AC	


PSE530


8


Compact Pneumatic Pressure Sensor/Switch

PSE540 Series

Series		Ra	ated pressure range		
	–100 kPa	0	100 kPa	500 kPa	1 MPa
PSE540		0			1 MPa
PSE541	–101 kPa	0			
PSE543	–100 kPa		100 kPa		

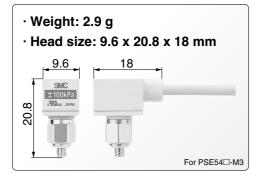

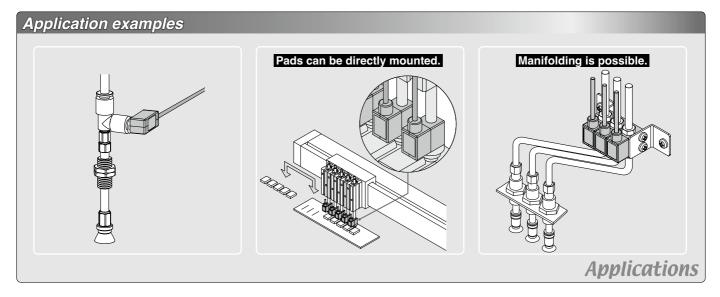

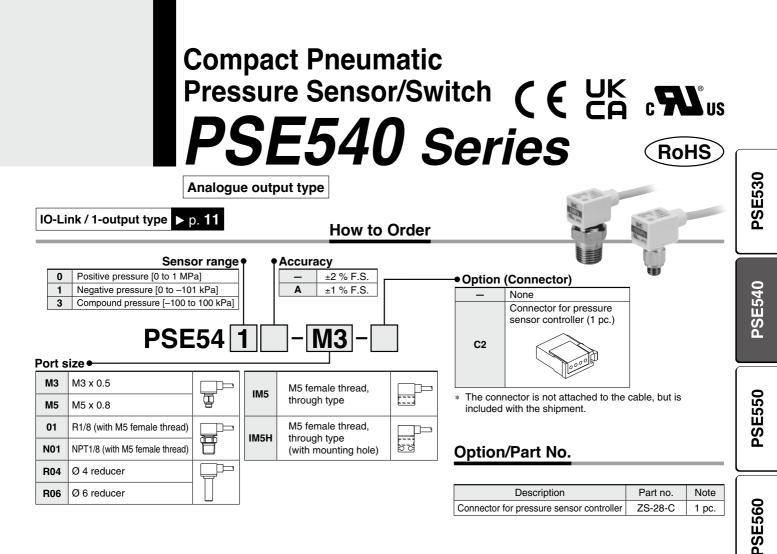

Specifications

	Model	PSE540	PSE541	PSE543		
Rate	d pressure range	0 to 1 MPa	0 to –101 kPa	-100 to 100 kPa		
Exte	nsion analogue output range	-0.1 to 0 MPa	10.1 to 0 kPa			
Proo	of pressure	1.5 MPa	500	kPa		
Appl	licable fluid	A	ir/Non-corrosive gas/Non-flammable ga	S		
Pow	er supply voltage	12 to 24 VDC ±10 %,	Ripple (p-p) 10 % or less (with reverse of	connection protection)		
Curr	ent consumption		15 mA or less			
Outp	out specifications	Analogue output 1 to 5 V (within rated pressure	e range), 0.6 to 1 V (within extension analogue o	utput range), Output impedance: Approx. 1 $k\Omega$		
Асси	uracy	PSE54□: ±2 % F.S. (within rated pressure range), ±5 % F.S. (within extension analogue output range)				
(Aml	bient temperature at 25 °C)	PSE54□A: ±1 % F.S. (within rated pressure range), ±3 % F.S. (within extension analogue output range)				
Linearity		±0.7 % F.S. or less ±0.4 % F.S.				
Repeatability		±0.2 % F.S.				
Power supply voltage effect		±0.8 % F.S.				
Enclosure		IP40				
Environment	Operating temperature range	P Operating: 0 to 50 °C, Stored: -20 to 70 °C (No freezing or condensation)				
no'	Operating humidity range	Operating/Stored: 35 to 85 % RH (No condensation)				
nvi	Withstand voltage	1000 VAC (in 50/60 Hz) for 1 min between terminals and housing				
Ш	Insulation resistance	50 M Ω or more (500 VDC measured via megohmmeter) between terminals and housing				
Tem	perature characteristics	±2 % F.S. (25 °C reference)				
Sens	sor cable	Oilproof heavy-duty vinyl cable (ellipse), 3 cores, 2.7 x 3.2, 3 m, Conductor area: 0.15 mm ² , Insulator O.D.: 0.9 mm				
Stan	dards	CE/UKCA marking, UL/CSA (E216656)				

Piping Specifications

Part no.		М3	M5	01	N01	R04	R06	IM5	IM5H
Port size		M3 x 0.5	M5 x 0.8	R1/8	NPT1/8	Ø 4 reducer	Ø 6 reducer	M5 female thread,	M5 female thread, through type
				M5 x 0.8	M5 x 0.8			through type	through type (with mounting hole)
	Case	Resin ca	se: PBT	Resin ca	ase: PBT	PE	т	Resin case: PBT	
Material	Case	Fitting: Stainless steel 303		Fitting: C3604BD		I DI		Fitting: A6063S-T5	
	Pressure sensing section			Pres	ssure sensor: S	Silicon, O-ring: I	NBR		
Weight	With sensor cable	42.4 g	42.7 g	49.	3 g	41.4 g	41.6 g	43.3 g	44.1 g
weight	Without sensor cable	2.9 g	3.2 g	9.	8 g	1.9 g	2.1 g	3.8 g	4.6 g


PSE570

PSE200A


Digital Sensor Monitors

PSE300AC PSE300A


IO-Link / 1-output type

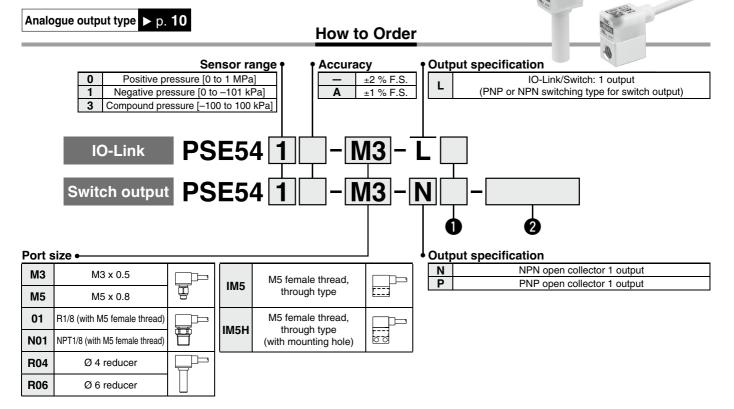


Lead wire termination

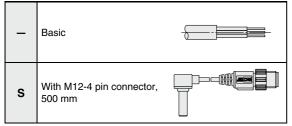


Set value (When output specification "N" or "P" is selected)

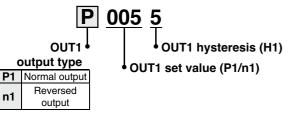

Normal output

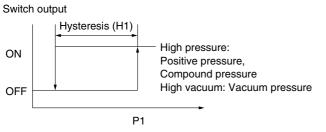

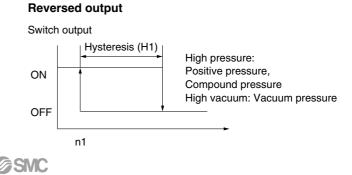

Compact Pneumatic Pressure Sensor/Switch **PSE540** Series

OUT1 set value (P1/n1)

Symbol		Sensor range	
Symbol	PSE540	PSE541	PSE543
-10			–100 kPa*1
-09			–90 kPa
-08			–80 kPa
-07			–70 kPa
-06	/		–60 kPa
-05			–50 kPa
-04			–40 kPa
-03			–30 kPa
-02			–20 kPa
-01	–0.1 MPa*1	10 kPa*1	–10 kPa
000	0.0 MPa	0 kPa	0 kPa
001	0.1 MPa	–10 kPa	10 kPa
002	0.2 MPa	–20 kPa	20 kPa
003	0.3 MPa	–30 kPa	30 kPa
004	0.4 MPa	–40 kPa	40 kPa
005	0.5 MPa	–50 kPa	50 kPa
006	0.6 MPa	–60 kPa	60 kPa
007	0.7 MPa	–70 kPa	70 kPa
008	0.8 MPa	–80 kPa	80 kPa
009	0.9 MPa	–90 kPa	90 kPa
010	1.0 MPa*1	-100 kPa*1	100 kPa*1

OUT1 hysteresis (H1)

Sumbol	Sensor range							
Symbol	PSE540	PSE541	PSE543					
0	0.00 MPa	0 kPa	0 kPa					
1	0.01 MPa	1 kPa	1 kPa					
2	0.02 MPa	2 kPa	2 kPa					
3	0.03 MPa	3 kPa	3 kPa					
4	0.04 MPa	4 kPa	4 kPa					
5	0.05 MPa	5 kPa	5 kPa					
6	0.06 MPa	6 kPa	6 kPa					
7	0.07 MPa	7 kPa	7 kPa					
8	0.08 MPa	8 kPa	8 kPa					
9	0.09 MPa	9 kPa	9 kPa					
Α	0.10 MPa	10 kPa	10 kPa					

*1 Part numbers whose switch output switching point is out of the set pressure range cannot be selected. Normal output: P1 - H1 ≥ set pressure range lower limit Reverse output: n1 + H1 ≤ set pressure range upper limit

Be sure to confirm the above.

*2 If you wish to use a set value other than the above, contact your local SMC sales representative.

Ordering Example

- · Pressure range: Positive pressure
- · Port size: M3
- · Accuracy: ±2 % F.S.
- · Output specification: NPN open collector 1 output
- · Lead wire termination: With M12-4 pin connector
- · OUT1: Normal output, Set point 0.5 MPa,
- Hysteresis 0.05 MPa

PSE540-M3-NS-P0055

PSE530

PSE540 Series

Specifications

	1	IO-Link					
	Model	PSE540(A)-□-L	PSE541(A)-□-L	PSE543(A)-□-L			
Rated pressure r	ange	-0.1 to 1 MPa	0 to -101 kPa	-100 to 100 kPa			
Set pressure ran	0	-0.105 to 1.05 MPa	10 to -105 kPa	-105 to 105 kPa			
Smallest settable		1 kPa	0.1 kPa	0.1 kPa			
Proof pressure		1.5 MPa		kPa			
Applicable fluid			Ion-corrosive gas/Non-flammable				
Power supply voltage	When used as a switch output device (When not used as an IO-Link device)		4 VDC ±10 %, Ripple (p-p) 10 %	-			
voltage	When used as an IO-Link device	18 to	26.4 VDC, including ripple (p-p)	10 %			
Current consum	ption		35 mA or less				
Output Hystere			PNP open collector 1 output (Sel resis, Window comparator, Error Normal, Reversed Max. load current: 80 mA Max. applied voltage: 30 V lesidual voltage): 1.5 V or less (a s or less, Variable from 0 to 60 s/	output			
Accuracy (Ambie	ent temperature at 25 °C)	PSE54 A: ±1 % F.S. (within rated pressure range), ±3 % F.S. (within extension analogue output range) PSE54 : ±2 % F.S. (within rated pressure range), ±5 % F.S. (within extension analogue output range)					
Linearity		±0.7 % F.S. ±0.4 % F.S.					
Repeatability			±0.2 % F.S.				
Power supply vo	Itage effect	±0.8 % F.S.					
	Enclosure	IP40					
	Operating temperature range	Operating: 0 to 50 °C, Stored: -10 to 60 °C (No freezing or condensation)					
Environment	Operating humidity range	Operating	/Stored: 35 to 85 % RH (No cond	lensation)			
	Withstand voltage	1000 VAC (in 50/60 Hz) for 1 min between terminals and housing					
	Insulation resistance	50 M Ω or more (500 VDC measured via megohmmeter) between terminals and hour formula of the terminal of terminal					
Temperature cha	racteristics	±2 % F.S. (25 °C reference)					
Sensor cable		Oilproof heavy-duty vinyl cable (ellipse), 3 cores, 2.7 x 3.2, 3 m, Conductor area: 0.15 mm ² , Insulator O.D.: 0.9 mm					
Standards		CE/UKCA marking, UL/CSA (E216656)					
	IO-Link type		Device				
	IO-Link type		V1.1				
	Communication speed		COM2 (38.4 kbps)				
	Configuration file		IODD file				
	Min. cycle time		3.4 ms				
.	Process data length	Inn	ut data: 4 bytes, Output data: 0 by	utes			
Communication	On request data communication	inpi	Yes	yioo			
	Data storage function		Yes				
	Event function		Yes				
	Vendor ID						
	Indicator light	131 (0 x 0083) SIO mode: Lights up when switch output is turned ON (OUT1: Red) IO-Link communication: ON or flashing (OUT1: Red)					

Compact Pneumatic Pressure Sensor/Switch **PSE540** Series

Specifications

			Switch output			
	Model	PSE540(A)-□-N/P	PSE541(A)-□-N/P	PSE543(A)-□-N/P		
Rated pressur	e range	-0.1 to 1 MPa	0 to -101 kPa	-100 to 100 kPa	E530	
Set pressure i		-0.105 to 1.05 MPa	10 to –105 kPa	-105 to 105 kPa		
Smallest setta	ble increment		1 kPa		Ι Щ	
Proof pressur	e	1.5 MPa	500) kPa	PS	
Applicable flu	id	Air/	Non-corrosive gas/Non-flammable	gas		
Power supply	voltage	12 to 2	24 VDC ±10 %, Ripple (p-p) 10 %	or less		
Current consu	Imption		35 mA or less			
Output			NPN or PNP open collector 1 output Hysteresis Normal, Reversed Max. load current: 80 mA Max. applied voltage: 30 V Residual voltage): 1.5 V or less (at Delay time: 3.4 ms or less		PSE540	
Accuracy (Am	bient temperature at 25 °C)	PSE54□A: ±1 % F.S. (within rated pressure range), ±3 % F.S. (within extension analogue output range) PSE54□: ±2 % F.S. (within rated pressure range), ±5 % F.S. (within extension analogue output range)				
Linearity		±0.7 % F.S.	±0.4	% F.S.	0	
Repeatability			±0.2 % F.S.		1 13	
Power supply	voltage effect		±0.8 % F.S.		PSE550	
	Enclosure		IP40		v	
	Operating temperature range		°C, Stored: –10 to 60 °C (No freezi	, ·		
Environment	Operating humidity range	Operatin	g/Stored: 35 to 85 % RH (No cond	ensation)		
	Withstand voltage	1000 VAC (in 5	0/60 Hz) for 1 min between termin	als and housing	\geq	
	Insulation resistance	measured via megohmmeter) betv	veen terminals and housing			
Temperature characteristics			±2 % F.S. (25 °C reference)			
Sensor cable		Oilproof heavy-duty vinyl cable (ellipse), 3 cores, 2.7 x 3.2, 3 m, Conductor area: 0.15 mm ² , Insulator O.D.: 0.9 mm				
Standards		CE	E/UKCA marking, UL/CSA (E2166	56)	SE560	


Piping Specifications

Part no. Port size		M3	M5	01	N01	R04	R06	IM5	IM5H	
		M3 x 0.5	M5 x 0.8	R1/8 M5 x 0.8	NPT1/8 M5 x 0.8	Ø 4 reducer	Ø 6 reducer	M5 female thread, through type	M5 female thread, through type (with mounting hole)	
Material		Case	Resin case: PC Fitting: Stainless steel 303			ase: PC 3604BD	Resin c	ase: PC		ase: PC 6063S-T5
Material		Pressure sensing section			Pres	sure sensor: S	Silicon, O-ring: NBR			
Waight	With	sensor cable	43.6 g	43.9 g	50	0.5 g	42.6 g	42.8 g	44.5 g	45.3 g
Weight	With	out sensor cable	4.1 g	4.4 g	1	1 g	3.1 g	3.3 g	5.0 g	5.8 g


PSE540 Series

Internal Circuit and Wiring Example


PSE54 Voltage output type 1 to 5 V Output impedance Approx. 1 kΩ

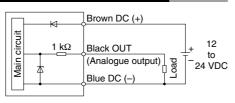


Analogue Output

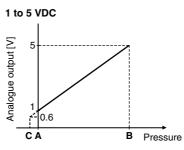


Range	Rated pressure range	Α	В	С
For vacuum	0 to –101 kPa	0	–101 kPa	10.1 kPa
For compound pressure	-100 kPa to 100 kPa	–100 kPa	100 kPa	—
For positive pressure	0 to 1 MPa	0	1 MPa	–0.1 MPa

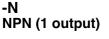

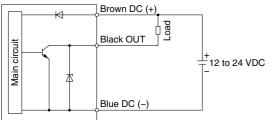


-P PNP (1 output)

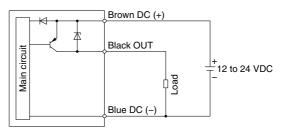


-L: (IO-Link/Switch 1 output)

When used as a switch output device (When not used as an IO-Link device = When in SIO mode)NPN open collector 1 output settingPNP open collector 1 output setting

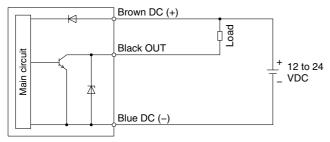


When used as an IO-Link device

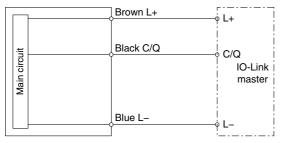



Brown DC (+)




IO-Link: Process Data

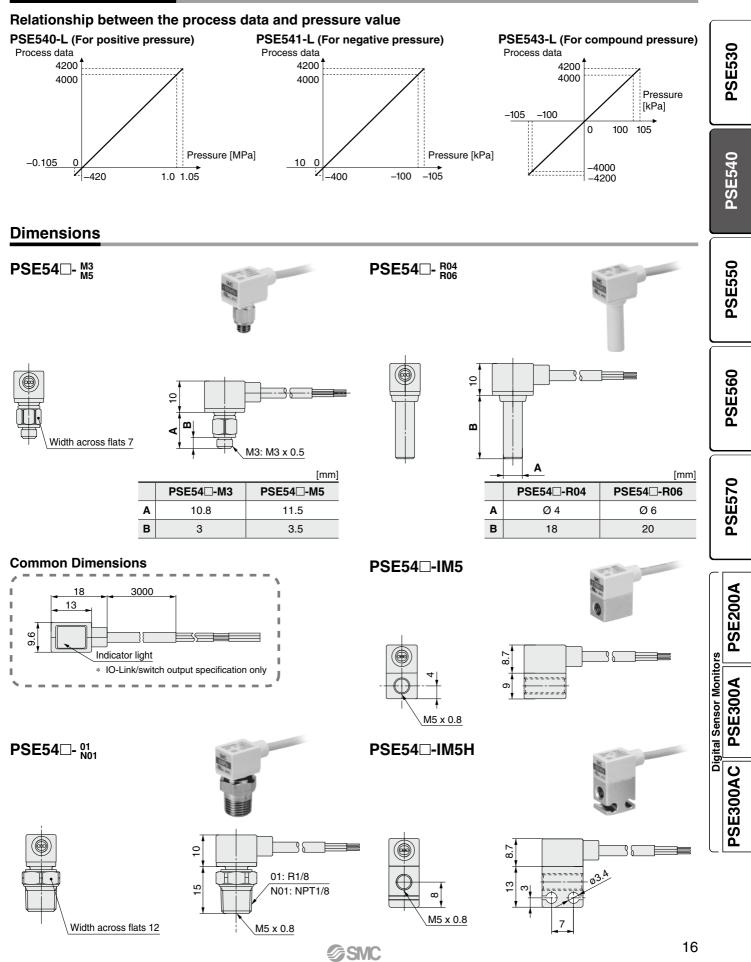

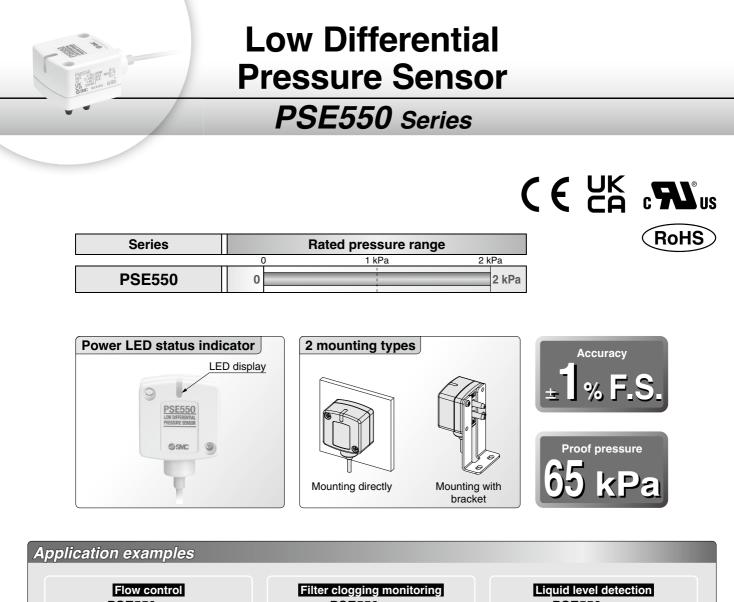

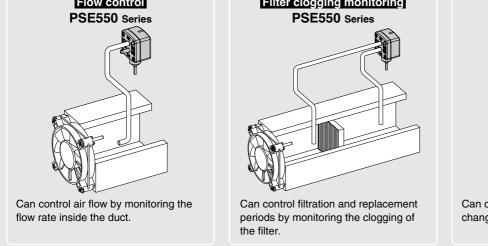


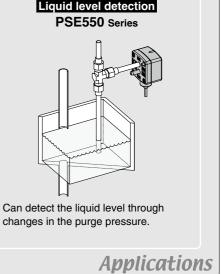

Low Differential Pressure Sensor (E CA CHUS PSE550 Series RoHS

How to Order

	PSE550-	
	Output specifications •	
_	Voltage output type 1 to 5 V	
28	Current output type 4 to 20 mA	

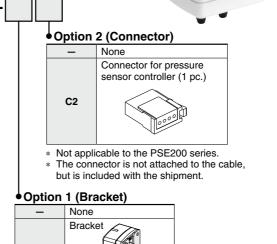

Options/Part Nos.

Description	Part no.	Note
Bracket	ZS-30-A	With M3 x 5 L (2 pcs.)
Connector for pressure sensor controller	ZS-28-C	1 pc.

*	The brack	et is not	attached	to the p	roduct, k	out is	included	with t	he shipment.	
---	-----------	-----------	----------	----------	-----------	--------	----------	--------	--------------	--

Specifications

	Madal	DOELEO				
Det	Model	PSE550 PSE550-28 0 to 2 kPa 0				
	d differential pressure range					
•	rating pressure range		0 kPa*1			
	tension analogue output range -0.2 to 0 kPa -					
	f pressure		kPa			
	icable fluid		s/Non-flammable gas			
	er supply voltage	· · · · · · · · · · · · · · · · · · ·	r less (with reverse connection protection)			
Curr	ent consumption	15 mA or less	—			
Output specifications		Analogue output: 1 to 5 VDC (within rated differential pressure range) 0.6 to 1 VDC (within extension analogue output range) Output impedance: Approx. 1 k Ω	$ \begin{array}{llllllllllllllllllllllllllllllllllll$			
Accur	acy (Operating temperature at 25 °C)	±1 % F.S. (within rated differential pressure range),	±3 % F.S. (within extension analogue output range)			
Line	arity	±0.5 % F.S.				
Repe	eatability	±0.3 % F.S.				
Indic	ator light	Orange light is turned on. (When energized)				
'nt	Enclosure	IP40				
a l	Operating temperature range	Operating: 0 to 50 °C, Stored: -20 to 70 °C (No freezing or condensation)				
- o	Operating humidity range	Operating/Stored: 35 to 85	5 % RH (No condensation)			
Environment	Withstand voltage		n between terminals and housing			
ш	Insulation resistance	50 $M\Omega$ or more (500 VDC measured via me	gohmmeter) between terminals and housing			
Tem	perature characteristics	±3 % F.S. (25	°C reference)			
Port		Ø 4.8 (Ø 4.4 in the	e end) resin piping			
PUIL	3125	(Applicable to I.I	D. Ø 4 air tubing)			
Mater	rials of parts in contact with fluid		n area of sensor: Silicon			
Sone	sor cable		Oilproof heavy-duty vinyl cable (ellipse), 2 cores, Ø 2.6, 3 m			
Jens		Conductor area: 0.15 mm ² , Insulator O.D.: 0.9 mm	Conductor area: 0.15 mm ² , Insulator O.D.: 0.9 mm			
Weig	With sensor cable	75	5 g			
weig	Without sensor cable	35	5 g			
Stan	dards	CE/UKCA marking, UL/CSA (E216656)				

Α

*1 Can detect differential pressure from 0 to 2 kPa within the range of -50 to 50 kPa.

PSE530

PSE540

PSE550

PSE560


PSE570

PSE200A

PSE300AC PSE300A

PSE550 Series


Internal Circuits and Wiring Examples

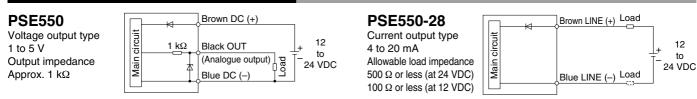


24.3

10.4


Analogue Output

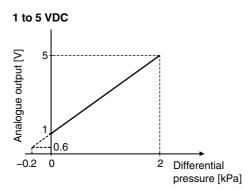


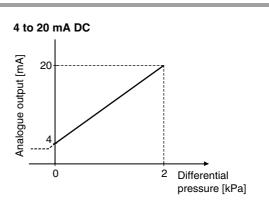

LINE (-) side.

Dimensions

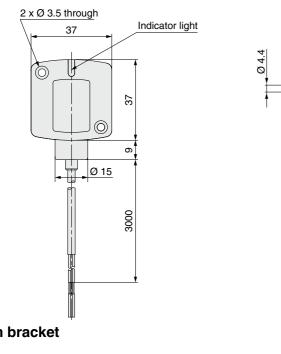

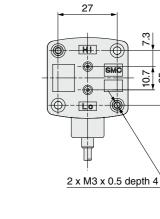


25

* Install the load either on the LINE (+) or


12

to


With bracket

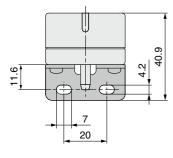


A View

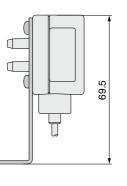

11.7

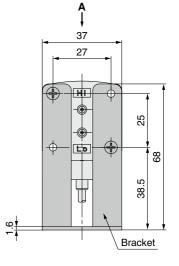

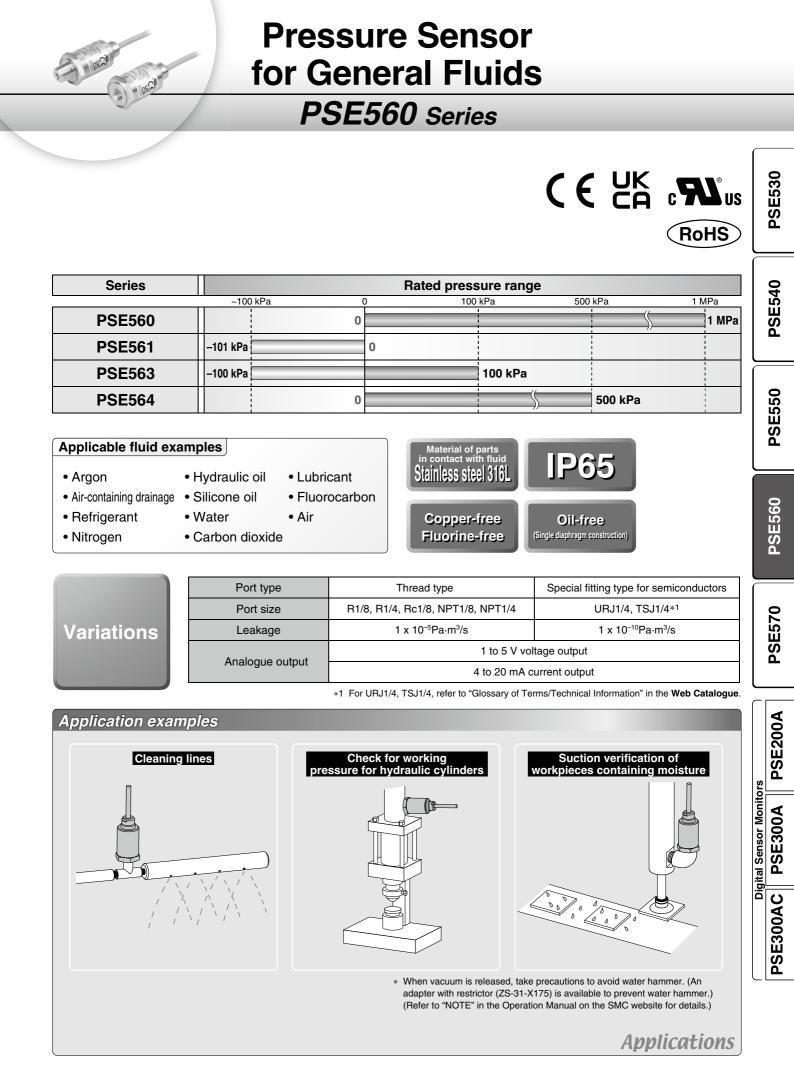

SMC

Pressure Sensor for General Fluids (C UK PSE560 Series RoHS

How to Order Option (Connector) Sensor range Current output type cannot 0 Positive pressure [0 to 1 MPa] None be connected to the 1 Vacuum [0 to -101 kPa] Connector for pressure PSE200 series. Compound pressure [-100 to 100 kPa] sensor controller (1 pc.) 3 The connector is not 4 Positive pressure [0 to 500 kPa] attached to the cable, but is C2 included with the shipment. **PSE56** 0 01 **Options/Part Nos** Port size • R1/8 (with M5 female thread) 01 02 R1/4 (with M5 female thread) Description Part no. Material Note Output specifications C01 Rc1/8 Connector for pressure sensor controller ZS-28-C 1 pc. N01 NPT1/8 (with M5 female thread) Voltage output type Adapter with restrictor Rc1/4 ZS-31-X175 1 pc. N02 NPT1/4 (with M5 female thread) 1 to 5 V 1 pc. Adapter with restrictor NPT1/4 ZS-31-X186 Stainless steel 304 URJ1/4 (Face seal fitting) Α2 Current output type Adapter with restrictor Rc1/8 ZS-31-X188 1 pc. 28 TSJ1/4 (Compression fitting) 4 to 20 mA B2 Adapter with restrictor NPT1/8 ZS-31-X189 1 pc.

Orifice M5

ZS-48-A

Stainless steel 303

1 pc.

Specifications


Model		PSE560 (Positive pressure)	PSE561 (Vacuum)	PSE563 (Compound pressure)	PSE564 (Positive pressure)			
Rated pressure range		0 to 1 MPa 0 to -101 kPa		-100 to 100 kPa	0 to 500 kPa			
Exter	nsion analogue output range	-0.1 to 0 MPa	10.1 to 0 kPa	_	-50 to 0 kPa			
Proo	f pressure	1.5 MPa	500 kPa	500 kPa	750 kPa			
	Model	PSE5	6□-□	PSE56	⊡-□-28			
Appli	cable fluid	Lie	quid or gas that will not corroo	de or attack stainless steel 31	6L			
Powe	er supply voltage	12 to 24 VD	C ±10 %, Ripple (p-p) 10 % o	r less (with reverse connectio	n protection)			
Curre	ent consumption	10 mA	or less	-	_			
Output specifications		Analogue output: 1 to 5 V (within n 0.6 to 1 V (within Output impedance: Approx. 1 kΩ	ated pressure range) extension analogue output range)	Maximum load impedance: 5	C (within rated pressure range) 500 Ω or less (at 24 VDC) 100 Ω or less (at 12 VDC)			
Accur	acy (Ambient temperature at 25 °C)	± 1 % F.S. (within rated pressure range), ± 3 % F.S. (within extension analogue output range)						
Linea	arity	±0.5 % F.S.						
Repe	atability	±0.2 % F.S.						
Powe	er supply voltage effect	±0.3 % F.S.						
ŧ	Enclosure	IP65						
Environment	Operating temperature range	Operating: -10 to 60 °C, Stored: -20 to 70 °C (No freezing or condensation)						
ō	Operating humidity range	Operating/Stored: 35 to 85 % RH (No condensation)						
nvi	Withstand voltage		250 VAC for 1 min betwe	en terminals and housing				
ш	Insulation resistance	50 M $\!\Omega$ or more (50 VDC measured via megohmmeter) between terminals and housing						
Temp	perature characteristics	±2 % F.S. (0	0 to 50 °C: 25 °C reference),	±3 % F.S. (–10 to 60 °C: 25 °C	C reference)			
Sens	or cable	PSE56:: Oilproof heavy-duty vinyl cable with air tubing, 3 cores, Ø 5.1, 3 m, Conductor area: 0.2 mm ² , Insulator O.D.: 1.12 mm PSE5628: Oilproof heavy-duty vinyl cable with air tubing, 2 cores, Ø 5.1, 3 m, Conductor area: 0.2 mm ² , Insulator O.D.: 1.12 mm						
Stand	dards	CE/UKCA marking, UL/CSA (E216656)						

Piping Specifications

Part no.		01	02	N01	N02	C01	A2	B2	
Port size		R1/8	R1/4	NPT1/8	NPT1/4	Do1/9		TSJ1/4	
Port Size	8	M5 x 0.8	M5 x 0.8	M5 x 0.8	M5 x 0.8	Rc1/8 URJ1/4		1531/4	
Material		Cas	e: C3604 + Nicke	el plating, Piping p	ort/Pressure sen	sor: Stainless ste	el 316L, Grease	-free	
Weight	With sensor cable	193 g 200 g		194 g	201 g	187 g	203 g	193 g	
weight	Without sensor cable	101 g	108 g	102 g	109 g	95 g	111 g	101 g	
~									

SMC



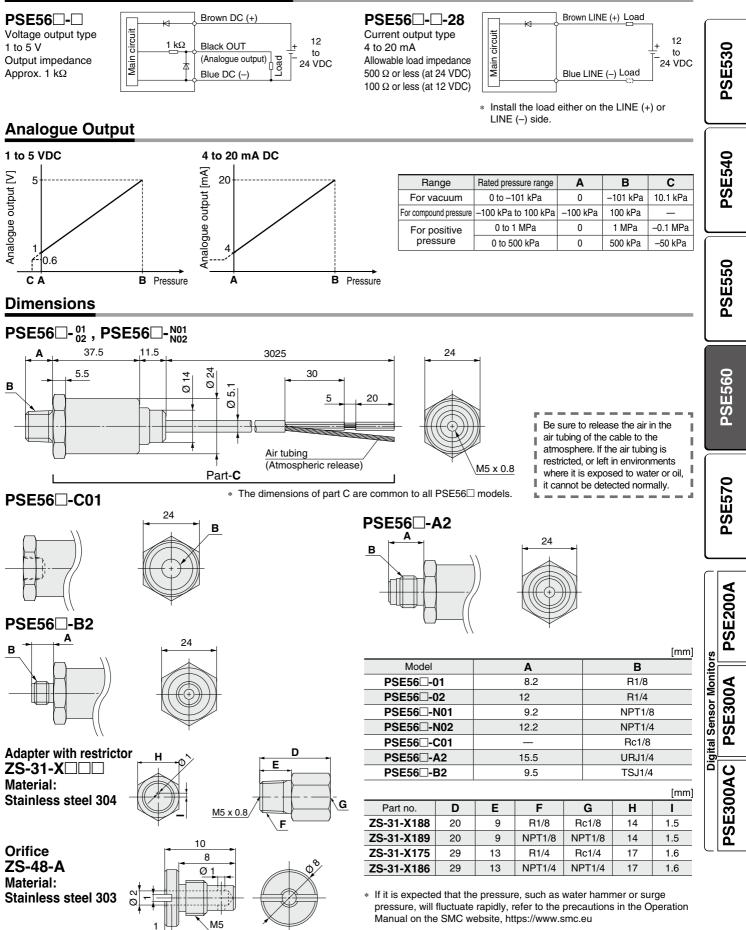

Pressure Sensor/Switch for General Fluids

PSE570 Series

us

(RoHS) 🚷 IO-Link


Series	Rated pressure range									
	0 1	00 kPa	500 kPa	1 MPa 2 N	/IPa	5 MPa	10 MPa			
PSE570	0			1 MPa						
PSE573	-100 kPa	100 kPa								
PSE574	0		500 kPa		 					
PSE575	0			\$	2 MPa					
PSE576	0					5 MPa				
PSE577	0						10 MPa			

M12 connector

	Materials of Par	Materials of Parts in Contact with Fluid										
		PSE570/573/574	PSE575/576/577									
	Piping port*1	C3604 + Nickel plating										
	Pressure sensor*1	Al2O3 (Alumina 96 %)										
	Sensor seal	FKM + Grease	FKM									
*1 Stainless steel 316L is used for the PSE560. For details, refer to page 20.												



Application examples

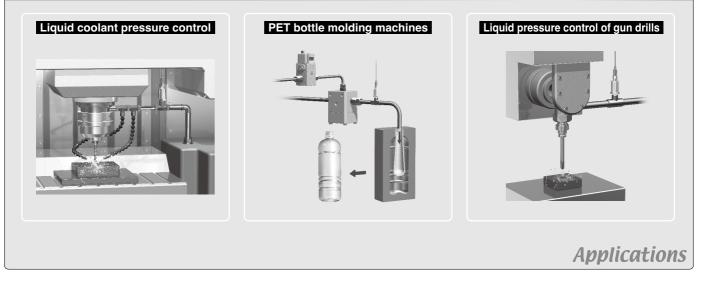

Pressure Sensor/Switch for General Fluids (E UK PSE570 Series RoHS

Analogue output type

IO-Link / 2-output type ▶ p. 25

How to Order

	JU-	
E		

PSE530


PSE540

PSE550

PSE560

PSE570

PSE57) –[0	1
Positive pressure [0 to 1 MPa]			
Compound pressure [-100 to 100 kPa]			
Positive pressure [0 to 500 kPa]			
Positive pressure [0 to 2 MPa]			
Positive pressure [0 to 5 MPa]			
Positive pressure [0 to 10 MPa]			

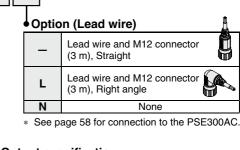

•Output specification

_	Voltage output type 1 to 5 V
28	Current output type 4 to 20 mA

Port size

Cumbol	Port size		Model								
Symbol	Port size	PSE570	PSE573	PSE574	PSE575	PSE576	PSE577				
01	R1/8 (with M5 female thread)	•	•	•	—	—	_				
02	R1/4 (with M5 female thread)	•	•	•	•	•	•				


Options/Part Nos.

/	Description	Part no.	Material	Note
1	Lead wire and M12 connector (3 m), Straight	ZS-37-A	-	1 pc.
2	Lead wire and M12 connector (3 m), Right angle	ZS-37-B	_	1 pc.
3	Assembly-type connector	PCA-1557743	-	1 pc.
4	Adapter with restrictor Rc1/4	ZS-31-X175	Stainless steel 304	1 pc.
5	Adapter with restrictor Rc1/8	ZS-31-X188	Oldii iiess Sleei JU4	1 pc.
6	Orifice M5	ZS-48-A	Stainless steel 303	1 pc.
7	1+3	ZS-37-A-X448	—	The lead wire and connector are shipped
8	2+3	ZS-37-B-X449	—	together. (Not assembled)
9	Connector for pressure sensor controller connection	ZS-28-CA-4	_	1 pc.

Specifications

	Model	PSE570	PSE573	PSE574	PSE575	PSE576	PSE577		
Fluid	Applicable fluid				aterials of parts in contact with fluid				
-	Rated pressure range	0 to 1 MPa	-100 to 100 kPa	0 to 500 kPa	0 to 2 MPa	0 to 5 MPa	0 to 10 MPa		
Pressure	Proof pressure	3.0 MPa	600 kPa	1.5 MPa	5.0 MPa	12.5 MPa	30 MPa		
	Power supply voltage		12 to 2	4 VDC ±10 % with	10 % voltage ripple	or less			
Electrical	Current consumption			10 mA	or less				
	Protection			Reverse conne	ction protection				
	Analogue output accuracy (Ambient temperature at 25 °C)		±1.0 % F.S.			±2.5 % F.S.			
	Linearity			±0.5 %	% F.S.				
Accuracy	Repeatability (Ambient temperature at 25 °C)		±0.2 % F.S.		±0.5 % F.S.				
	Temperature characteristics (25 °C reference)	±2 % F.S. (0 to 50 °C) ±3 % F.S. (-10 to 60 °C)	±3 % F.S. (±4 % F.S. (-	,	±5 % F.S. (-10 to 60 °C)				
	Enclosure		· · ·	IP	65				
	Withstand voltage		500 V	AC for 1 min betwe	en terminals and ho	ousing			
Environment	Insulation resistance	100 N	IΩ or more (500 VD	C measured via me	egohmmeter) betwe	en terminals and ho	ousing		
	Operating temperature range		Operating: -10 to	60 °C, Stored: -20 t	o 70 °C (No freezing	g or condensation)			
	Operating humidity range		Operat	ting/Stored: 35 to 85	5 % RH (No conden	sation)			
Standards	S			CE/UKCA marking,	UL/CSA (E216656)				
Materials	of parts	Piping port: C3604 + N			Piping port: C3604				
in contact	t with fluid	Pressure sensor: Al2O	3 (Alumina 96 %), Sens	or seal: FKM + Grease	Pressure sensor: A	12O3 (Alumina 96 %), Sensor seal: Fh		

Model		PSE57□-□	PSE57□-□-28
August Output		Voltage output: 1 to 5 V	Current output: 4 to 20 mA
Analogue output	Impedance	Output impedance: Approx. 1 k Ω	Maximum load impedance: 500 Ω or less (at 24 VDC) 100 Ω or less (at 12 VDC)

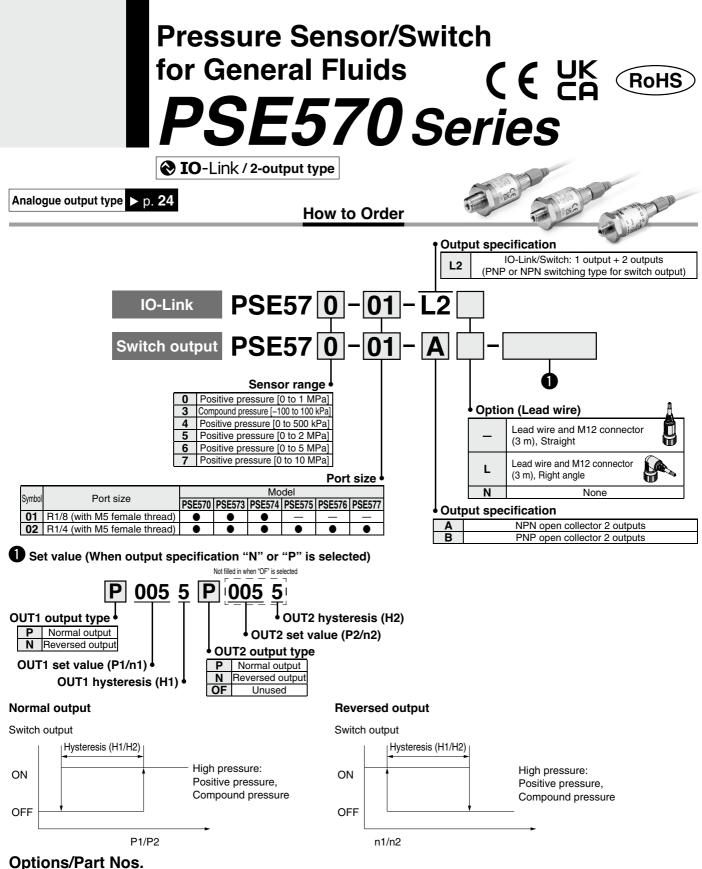

Options/Fait Nos.

/	Description	Part no.	Material	Note	/	Description	Part no.	Material	Note				
	Lead wire and M12	ZS-37-A		1 pc.			EX9-AC005-SSPS	_	Length: 0.5 m, Straight				
U	connector (3 m), Straight	23-37-A		i pc.	Lead wire and M12 connector (Connector on both sides)		0	0	Lead with and M40	Lead wire and M12	EX9-AC010-SSPS	—	Length: 1 m, Straight
2	Lead wire and M12	ZS-37-B		1 no					0		EX9-AC020-SSPS	_	Length: 2 m, Straight
Q	connector (3 m), Right angle	Z3-37-D		1 pc.			EX9-AC030-SSPS	—	Length: 3 m, Straight				
3	Assembly-type connector	PCA-1557743	_	1 pc.			EX9-AC050-SSPS	—	Length: 5 m, Straight				
4	Adapter with restrictor Rc1/4	ZS-31-X175	Stainless	1 pc.			EX9-AC100-SSPS	—	Length: 10 m, Straight				
(5)	Adapter with restrictor Rc1/8	ZS-31-X188	steel 304	1 pc.	10	Connector for pressure sensor	ZS-28-CA-4		1 no				
6)	Orifice M5	ZS-48-A	Stainless	1 no		controller connection	23-20-0A-4	_	1 pc.				
0	Office MS	23-40-A	steel 303	1 pc.									
\bigcirc	1+3	ZS-37-A-X448	-	The lead wire and connector are									
8	2+3	ZS-37-B-X449	_	shipped together. (Not assembled)									

SMC

* The lead wire with an M12 connector is not included with the product. Please order it separately.

25

OUT1 Set Value (P1/n1) OUT2 Set Value (P2/n2)

			Sensor	r range		
Symbol	PSE570	PSE573	PSE574	PSE575	PSE576	PSE577
-10	/	-100 kPa*1	/			
-09		–90 kPa				
-08		–80 kPa				
-07		–70 kPa			/	
-06		–60 kPa				
-05		–50 kPa				
-04		–40 kPa		/		
-03		–30 kPa				
-02		–20 kPa				
-01	–0.1 MPa*1	–10 kPa	-50 kPa*1			
000	0.0 MPa	0 kPa	0 kPa	0.0 MPa*1	0.0 MPa*1	0 MPa*1
001	0.1 MPa	10 kPa	50 kPa	0.2 MPa	0.5 MPa	1 MPa
002	0.2 MPa	20 kPa	100 kPa	0.4 MPa	1.0 MPa	2 MPa
003	0.3 MPa	30 kPa	150 kPa	0.6 MPa	1.5 MPa	3 MPa
004	0.4 MPa	40 kPa	200 kPa	0.8 MPa	2.0 MPa	4 MPa
005	0.5 MPa	50 kPa	250 kPa	1.0 MPa	2.5 MPa	5 MPa
006	0.6 MPa	60 kPa	300 kPa	1.2 MPa	3.0 MPa	6 MPa
007	0.7 MPa	70 kPa	350 kPa	1.4 MPa	3.5 MPa	7 MPa
008	0.8 MPa	80 kPa	400 kPa	1.6 MPa	4.0 MPa	8 MPa
009	0.9 MPa	90 kPa	450 kPa	1.8 MPa	4.5 MPa	9 MPa
010	1.0 MPa*1	100 kPa*1	500 kPa*1	2.0 MPa*1	5.0 MPa*1	10 MPa*1

OUT1 Hysteresis (H1) OUT2 Hysteresis (H2)

Symbol	Sensor range						
Symbol	PSE570	PSE573	PSE574	PSE575	PSE576	PSE577	
0	0.00 MPa	0 kPa	0 kPa	0.00 MPa	0.00 MPa	0.0 MPa	
1	0.01 MPa	1 kPa	5 kPa	0.02 MPa	0.05 MPa	0.1 MPa	
2	0.02 MPa	2 kPa	10 kPa	0.04 MPa	0.10 MPa	0.2 MPa	
3	0.03 MPa	3 kPa	15 kPa	0.06 MPa	0.15 MPa	0.3 MPa	
4	0.04 MPa	4 kPa	20 kPa	0.08 MPa	0.20 MPa	0.4 MPa	
5	0.05 MPa	5 kPa	25 kPa	0.10 MPa	0.25 MPa	0.5 MPa	
6	0.06 MPa	6 kPa	30 kPa	0.12 MPa	0.30 MPa	0.6 MPa	
7	0.07 MPa	7 kPa	35 kPa	0.14 MPa	0.35 MPa	0.7 MPa	
8	0.08 MPa	8 kPa	40 kPa	0.16 MPa	0.40 MPa	0.8 MPa	
9	0.09 MPa	9 kPa	45 kPa	0.18 MPa	0.45 MPa	0.9 MPa	
Α	0.10 MPa	10 kPa	50 kPa	0.20 MPa	0.50 MPa	1.0 MPa	

*1 Product number whose switch output switching point is out of set pressure range cannot be selected. Normal output: P1 – H1 ≥ set pressure range low limit When reverse output: n1 + H1 ≤ set pressure range high limit Please confirm that it is.

*2 If you wish to use a set-up setting other than the above, contact your SMC sales representative

Ordering Examples

- · Pressure range: PSE576
- · Port size: 02
- Output specification: PNP open collector 2 outputs
- · Lead wire: Lead wire and M12 connector (3 m), Right angle
- \cdot OUT1: Normal output, Set point 2.5 MPa, Hysteresis 0.05 MPa
- · OUT2: Unused

PSE576-02-BL-P0051OF

PSE570 Series

Specifications

			IO-Link						
Model		PSE570-□-L2	PSE573-D-L2	PSE574-□-L2	PSE575-□-L2	PSE576-□-L2	PSE577-□-L2		
Applicable						materials of parts in			
		ressure range	0 to 1 MPa	-100 to 100 kPa	0 to 500 kPa	0 to 2 MPa	0 to 5 MPa	0 to 10 MPa	
	-	ssure range	-0.105 to 1.050 MPa	-105.0 to 105.0 kPa	-50 to 525 kPa	-0.105 to 2.1 MPa	-0.105 to 5.25 MPa	-0.105 to 10.5 MPa	
Pressure	Smallest s	settable increment	1 kPa	0.1 kPa	1 kPa	1 kPa	10 kPa	10 kPa	
	Proof pr	ressure	3 MPa	600 kPa	1.5 MPa	5 MPa	12.5 MPa	30 MPa	
Electrical	Power (W supply voltage	/hen used as a witch output device Vhen not used as n IO-Link device) Vhen used as an	12 to 24 VDC ±10 %, Ripple (p-p) 10 % or less						
	IC	D-Link device	18 to 30 VDC, including ripple (p-p) 10 %						
		consumption				or less			
Switch output			Reverse connection protection NPN or PNP open collector 2 outputs (Selectable) Hysteresis, Window comparator, Error output Normal, Reversed Max. load current: 80 mA Max. applied voltage: 30 V Internal voltage drop (Residual voltage): 1.5 V or less (at load current of 80 mA) Delay time: 3.4 ms or less, Variable from 0 to 60 s/0.01 s increments						
	Accuracy (Am	bient temperature at 25 °C)		±1.0 % F.S.		±2.5 % F.S.			
	Linearit	у	±0.5			% F.S.			
Accuracy	Repeata (Ambient te	ability emperature at 25 °C)	±0.2 % F.S.			±0.5 % F.S.			
	Tempera characte		±2 % F.S. (0 to 50 °C) ±3 % F.S. (-10 to 60 °C) ±4 % F.S. (-10 to 60 °C)			±5	% F.S. (–10 to 60 °	C)	
	Enclosu	-	IP65						
		nd voltage	500 VAC for 1 min between terminals and housing						
Environment		on resistance	100 N			egohmmeter) betwee		using	
		temperature range	Operating: -10 to 60 °C, Stored: -20 to 70 °C (No freezing or condensation)						
		g humidity range							
Standards	s		CE/UKCA marking						
Materials of parts in contact with fluid		Pressure sensor: Al ₂ O ₃ (Alumina 96 %), Pressure sensor			oort: C3604 + Nickel sensor: Al ₂ O ₃ (Alum Sensor seal: FKM				
	IO-Link	type	Device						
		version	V1.1						
	Commu	inication speed							
	Configu	iration file	IODD file						
	Min. cyc	cle time	3.4 ms						
	Process	s data length	Input data: 4 bytes, Output data: 0 bytes						
Communication		lest data	Yes						
	Data sto	orage function	Yes						
	Event fu	unction	Yes						
	Vendor	ID	131 (0 x 0083)						
	Indicato	or light	S		communication: G	is turned ON (OUT1 reen light is ON or fla pht is flashing.		d)	

Specifications

		Switch output						
Model		PSE570-□-A/B	PSE573-D-A/B	PSE574-D-A/B	PSE575-D-A/B	PSE576-D-A/B	PSE577-D-A/B	
Ap	plicable fluid	Gas or liquid that will not corrode the materials of parts in contact with fluid						
é	Rated pressure range	0 to 1 MPa	-100 to 100 kPa	0 to 500 kPa	0 to 2 MPa	0 to 5 MPa	0 to 10 MPa	
sui	Set pressure range	-0.105 to 1.050 MPa	-105.0 to 105.0 kPa	–50 to 525 kPa	-0.105 to 2.1 MPa	-0.105 to 5.25 MPa	-0.105 to 10.5 MPa	
Pressure	Smallest settable increment	1 kPa				10 kPa		
đ	Proof pressure	3 MPa	600 kPa	1.5 MPa	5 MPa	12.5 MPa	30 MPa	
cal	Power supply voltage		12 1	to 24 VDC ±10 %, R	lipple (p-p) 10 % or l	ess		
Electrical	Current consumption			35 mA	or less			
щ	Protection			Reverse conne	ction protection			
Switch output		NPN or PNP open collector 2 outputs Hysteresis Normal, Reversed Max. load current: 80 mA Max. applied voltage: 30 V Internal voltage drop (Residual voltage): 1.5 V or less (at load current of 80 mA) Delay time: 3.4 ms or less						
	Accuracy (Ambient temperature at 25 °C)	±1.0 % F.S.				±2.5 % F.S.		
ac)	Linearity	±0.5 % F.S.						
Accuracy	Repeatability (Ambient temperature at 25 °C)	±0.2 % F.S.			±0.5 % F.S.			
	Temperature characteristics	±2 % F.S. (0 to 50 °C) ±3 % F.S. (0 to 50 °C) ±3 % F.S. (-10 to 60 °C) ±4 % F.S. (-10 to 60 °C)		°C)				
ņt	Enclosure	IP65						
ĥ	Withstand voltage	500 VAC for 1 min between terminals and housing						
٥.	Insulation resistance	100 M Ω or more (500 VDC measured via megohmmeter) between terminals and housing						
Environment	Operating temperature range				to 70 °C (No freezin	,		
ш	Operating humidity range	Operating/Stored: 35 to 85 % RH (No condensation)						
Sta	Indards	CE/UKCA marking						
Materials of parts in contact with fluid		Piping port: C3604 + Nickel plating, Pressure sensor: Al2O3 (Alumina 96 %), Sensor seal: FKM + Grease Pressure sensor: Al2O3 (Alumina 96 %), Sensor seal: FKM + Grease						

Piping Specifications

Part no.		PSE570/573/574-01	PSE570/573/574-02	PSE575/576/577-02	
Port size		R1/8	R1/4	R1/4	
		M5 x 0.8	M5 x 0.8	M5 x 0.8	
Motorial	s of parts	Piping port: C360	4 + Nickel plating	Piping port: C3604 + Nickel plating	
	ct with fluid	Pressure sensor: Al	2O3 (Alumina 96 %)	Pressure sensor: Al2O3 (Alumina 96 %)	
mconta		Sensor seal: FKM + Grease		Sensor seal: FKM	
	Without lead wire	88 g	95 g	103 g	
Weight	and M12 connector	88 g	95 g	105 g	
	With lead wire	175 g	190 a	191 g	
	and M12 connector	175 y	182 g	1919	

Cable Specifications

Conductor	Nominal cross section	AWG23			
Conductor	Outside diameter	0.72 mm			
	Material	Cross-linked vinyl chloride			
Insulator	Outside diameter	1.14 mm			
	Colour	Brown, Blue, Black, White			
Sheath	Material	Oil resistant vinyl chloride			
Finished O.	D.	Ø 4			
Length		3 m			

PSE530


PSE540

PSE550

PSE560


PSE570 Series

Internal Circuits and Wiring Examples

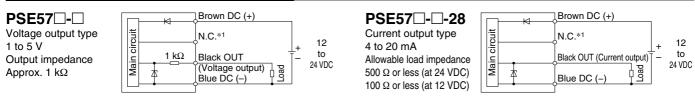


*1 For the analogue output type, the unconnected terminals are used in SMC, so please do not connect them.

PSE57D-D-A NPN open collector (2 outputs)

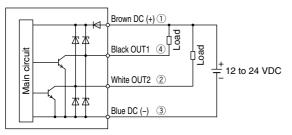


PSE57D-D-B PNP open collector (2 outputs)

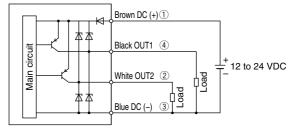


PSE57 -L2


When used as a switch output device * The numbers in the circuit diagrams show the connector pin layout. Setting of NPN open collector 2 outputs

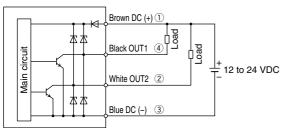


Setting of PNP open collector 2 outputs

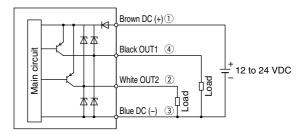

When used as an IO-Link device

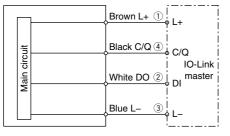

Analogue Output

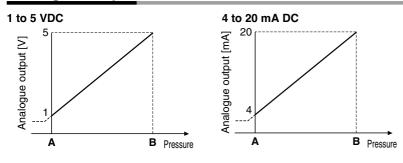


SMC


Model	Model Rated pressure range		В
PSE570	0 to 1 MPa	0 MPa	1 MPa
PSE573	-100 to 100 kPa	–100 kPa	100 kPa
PSE574	0 to 500 kPa	0 kPa	500 kPa
PSE575	0 to 2 MPa	0 MPa	2 MPa
PSE576	0 to 5 MPa	0 MPa	5 MPa
PSE577	0 to 10 MPa	0 MPa	10 MPa

29

Pressure Sensor/Switch for General Fluids **PSE570** Series

IO-Link: Process Data

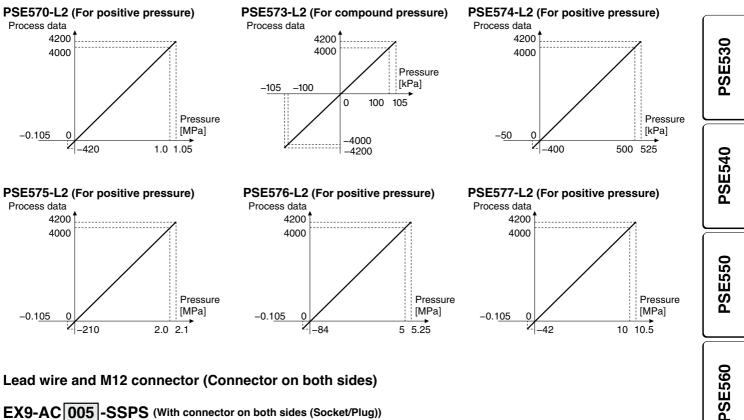

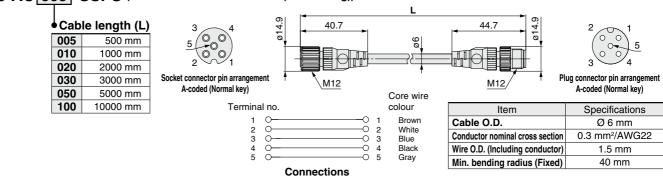




PSE570

PSE570 Series

Dimensions

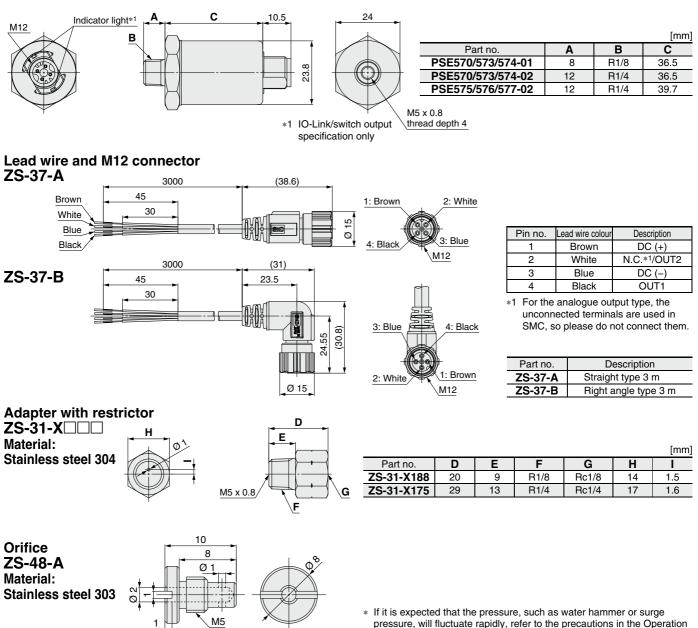

pressure, will fluctuate rapidly, refer to the precautions in the Operation Manual on the SMC website, https://www.smc.eu



3-Screen Display Multi-channel Digital Sensor Monitor PSE200A Series

Up to 4 pressure sensors can be connected!






O IO-Link Compatible


Hub Function

Convert analogue signals to digital signals! * For details, refer to the "Operation Manual" on the SMC website. It is possible to change the settings while checking the measured value.

SMC

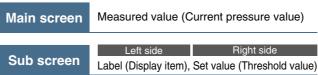

SMC

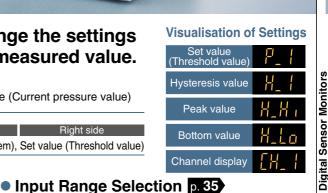

Differential Pressure Check Mode p. 34
 3 channels are displayed simultaneously. p. 34

Applicable Pressure Sensor Variations

DOWN -



PSE560

PSE570

PSE200A


PSE300AC PSE300A

3-Screen Display Multi-channel Digital Sensor Monitor PSE200A Series

Visualisation of Settings Item and set value are displayed together. PSE200A Existing model Easy to confirm the displayed item @ SMC Switches between displays SET 🛡 SET 🛡 DOWA Ø **Mode Examples** Set value Set value Set hysteresis Normal output (Threshold value) Reversed output (Threshold value) Hysteresis value **Hysteresis** mode Normal output/ Normal output/ Reversed output/ Set value Set value Reversed output/ Set value Set value Lo side (Threshold value) Hi side (Threshold value) Lo side (Threshold value) Hi side (Threshold value) Window comparator mode

Easy Screen Switching

It is possible to change the settings while checking the measured value.

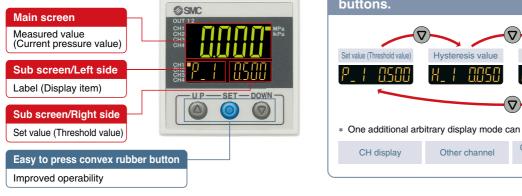


The sub screen can be switched by pressing the down buttons. Image: Set value Image: Set value

Simple 3-Step Setting


After selecting the channel, when the SET button is pressed and the set value (P_1) is displayed, the set value (threshold value) can be set.

When the SET button is pressed and the hysteresis


(H_1) is being displayed, the hysteresis value can be set.

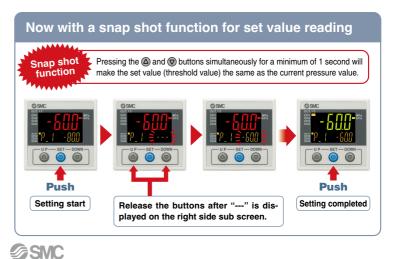

Centralised Control Saves Installation Space.

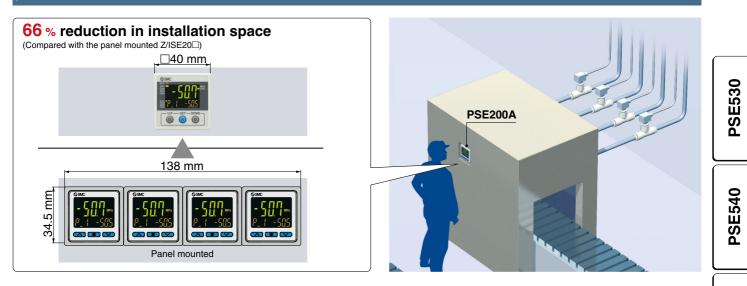

Differential Pressure Check Mode * For details, refer to the "Operation Manual" on the SMC website

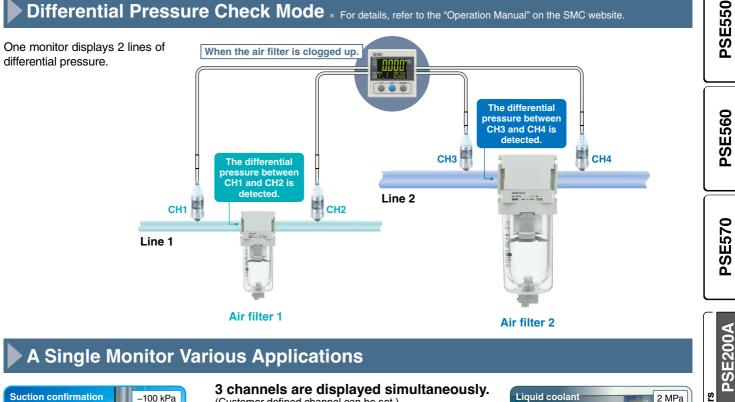


A Single Monitor Various Applications



PSE300AC PSE300A

Input Range Selection (for Pressure/Flow rate)

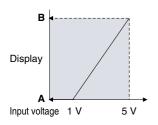

The sensor input range can be set to the required value and displayed. (Voltage input: 1 to 5 V) Pressure switch/Flow switch can be displayed.


A is displayed for 1 V. B is displayed for 5 V.

The range can be set as required. Refer to page 3 8 for the specification of the sensors which can be connected.

For the individual specifications of each connectable sensor, refer to the Web Catalogue.

For Digital Flow Switch for Water / PF3W511



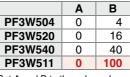


Set A and B to the values shown in the table on the left.

For Flow Sensor / PFMV5

Setting of the display for analogue voltage




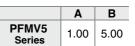

Set A and B to the values shown in the table on the left.

Connectors

Connection and removal of wiring is easy.

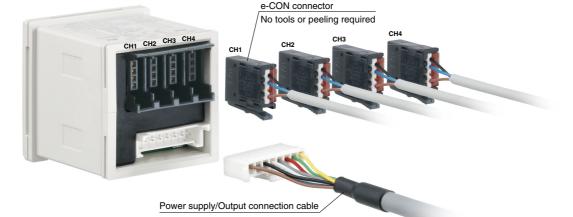

Functions * For details, refer to the "Operation Manual" on the SMC website.

Auto-preset function

This function, when selected in the initial setting, calculates and stores the set value from the measured pressure.

- **Display value fine adjustment function** Fine adjustment of the indicated value of the pressure sensor can be made within the range of ±5 % of the read value.
- Peak/Bottom value indication function

This function constantly detects and updates the maximum (minimum) pressure when the power is supplied, and allows to hold the maximum (minimum) pressure value.

Key-lock function

This function prevents operation errors such as accidentally changing setting values.

Zero-clear function

This function clears and resets the zero value on the display of measured pressure.

Error display function

This function displays error location and content when a problem or error has occurred.

Anti-chattering function

This function prevents the detection of such temporary drops in the supply pressure as errors by changing the delay time setting.

Pressure range/Unit selection function The pressure range and displayed unit can be switched.

Zero-cut setting

When the pressure display value is close to zero, this function forces the display to zero.

Selection of power-saving mode Power-saving mode can be selected. It shifts to power-saving mode automatically when there is no button operation for 30 seconds.

Setting of security code

Users can select whether a security code must be entered to release the key lock.

SMO

Auto-shift function

This function compensates for such supply pressure fluctuations. It measures the pressure at the time of auto-shift signal input and uses it as the reference pressure to correct the set value on the switch.

- Differential pressure check mode Set and display the differential pressure between CH1 - CH2, and CH3 - CH4.
- Channel to channel copy function The set values can be copied to other channel.

Channel select function

Pressure value for the selected channel is displayed.

Channel scan function Pressure values for each channel are displayed in turn every 2 seconds.

3-Screen Display Multi-channel Digital Sensor Monitor PSE200A Series

Series Variations


				Dig	ital Sensor Mon	itors				
		PSE200A			300AC	р. 54	PSE300	4	p. 44	
		1022001								PSE530
										PSE540
S	Repeatability	±0.1 % (F.	S.)			±0.1 %	ω (F.S.)			
tion	Voltage	12 to 24 VI					24 VDC			00
ifica			-							PSE550
Basic Specifications	No. of outputs for switch Analogue output	5 outputs 	3		_	2 OU	tputs	1 to 5 V 4 to 20 mA		PS
Bas	Operating temperature	0 to 50 °C)			0 to	50 °C			
					1.1			1.00		60
	Number of screens	3				:	3			PSE560
Functions	Enclosure	Front face: I Others: IP4			IP65			IP40		Ľ
Fun	3 Step	Yes				Y	es			
	Wiring	Connecto	or			Conr	nector			220
					1		-		_	PSE570
sors		Compact Pneumatic Pressure Sensor PSE53	Compact Pne Pressure Se PSE54	ensor	Low Differential Pressure Sensor PSE550	for G	sure Sensor eneral Fluids PSE56 □	Pressure for Genera PSE5	al Fluids	Ĕ
Pressure Senso				F		T	a de la de		JU	s PSE200A
Applicable Pressure		Rated pressure range -101 kPa to 0 -100 kPa to 100 kPa 0 to 100 kPa 0 to 1 MPa	Rated pressure -101 kPa to 0 -100 kPa to 10 0 to 1	00 kPa	Rated pressure range 0 to 2 kPa	-101	pressure range kPa to 0 kPa to 100 kPa 0 to 500 kPa 0 to 1 MPa	0 to 0 to 0 to		Digital Sensor Monitors
			C0[NT	ENTS	2				PSE300AC
How	to Order			· p. 37	Applicable Pressu	re Sensor	s		p. 39	

CONTENTS

How to Order	
Options/Part Nos p. 37	
Specifications p. 38	

Applicable Pressure Sensors p. 3	39
Internal Circuits and Wiring Examples p. 3	39
Dimensions	12

3-Screen Display Multi-channel Digital Sensor Monitor (Є ЦК **PSE200A Series** Понз

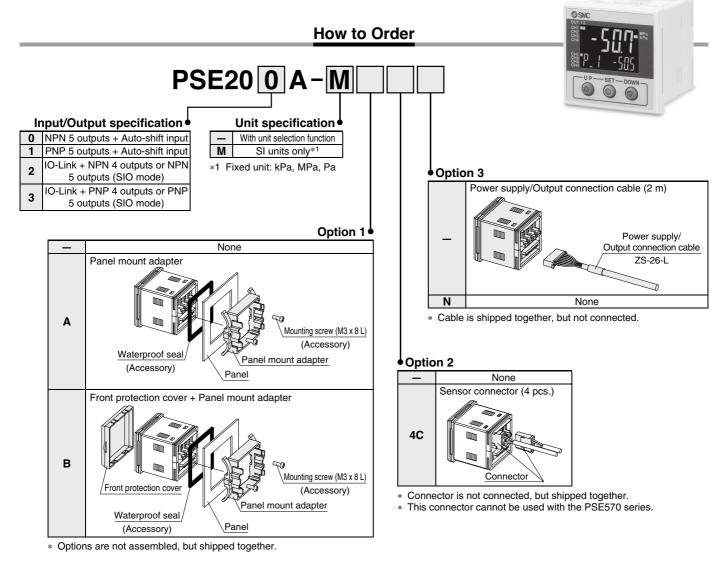

Options/Part Nos.

When only optional parts are required, order with the part numbers listed below.

Description	Part no.	Note				
Panel mount adapter	ZS-26-B	Waterproof seal, mounting screws M3 x 8 L (2 pcs.) included				
Front protection cover + Panel mount adapter	ZS-26-C Waterproof seal, mounting screws M3 x 8 L (2					
	ZS-26-D	□48 conversion adapter				
□48 conversion adapter * This adapter is used to mount the PSE200A series on the panel fitting of the PSE 1 0 0 series.						
	Order panel mount adapter separately.					
Front protection cover		ZS-26-01				
Concer connector (1 no nor cot)	ZS-28-C	For the PSE5 series (Excludes the PSE570 series)				
Sensor connector (1 pc. per set)	ZS-28-CA-4	For PSE570 series				
Power supply with M12 connector/Output cable (Made to Order) * For use when using an M12 connector for IO-Link communication						

Specifications

	Series	PSE200A									
	oplicable SMC essure sensor	PSE550	PSE531 PSE541 PSE561	PSE533 PSE543 PSE563 PSE573	PSE532	PSE564 PSE574	PSE530 PSE540 PSE560 PSE570	PSE575	PSE576	PSE577	PSE530
Ra	ted pressure range	0 to 2 kPa	0 to -101 kPa	-100 to 100 kPa	0 to 100 kPa	0 to 500 kPa	0 to 1 MPa	0 to 2 MPa	0 to 5 MPa	0 to 10 MPa	S
	play/Set pressure range	–0.2 to 2.1 kPa	10 to -105 kPa	-105 to 105 kPa	–10 to 105 kPa	–50 to 525 kPa	-0.105 to 1.05 MPa	-0.105 to 2.1 MPa	-0.25 to 5.25 MPa	-0.5 to 10.5 MPa	l ă
Disp	lay/Smallest settable increment	0.001 kPa	0.1 kPa	0.1 kPa	0.1 kPa	1 kPa	0.001 MPa	0.001 MPa	0.01 MPa	0.01 MPa	
	When used as a switch output device When used as an IO-Link device			12	to 24 VDC ±10) % with 10 % ı	ripple (p-p) or le	ess			
Electrical					18 to 30 VDC	including rippl					PSE540
Ē	Current consumption					55 mA or less					ิเง
	Protection Power supply voltage for sensor*1					olarity protection supply voltage					
	Power supply voltage for sensor* ¹ Power supply current for sensor* ²		Max	50 mA (Howo)			<u>] – 1.5 v</u> nputs is 200 m.	A maximum or			
~	Display accuracy		iviax.				perature of 25 \pm		1855.)		
lrac	Repeatability			±0.5		0.1 % F.S. ±1 di		3 0)			
Accuracy	Temperature characteristics					F.S. (Reference					0
	Output type						utput: 5 outputs	3			
Switch output (SIO mode)	Output mode						de, Error output				SE550
0	Switch operation					output, Reverse					S
l S	Max. load current					80 mA					ם מ
ort	Max. applied voltage (NPN only)					30 VDC					
1 T	Internal voltage drop (Residual voltage)					s (at load curre	,				
- S	Delay time*3			5 ms			s/0.01 s incren	nents			
N,	Hysteresis					ariable from 0*					
	Protection		Over current protection Oo Voltage input: 1 to 5 VDC (Input impedance: 1 MΩ) Inputs 4 inputs e-CON								U
Sensor input	Input type Number of inputs	Voltage input: 1 to 5 VDC (Input impedance: 1 MΩ)							<u> </u>		
i.	Connection method	e-CON							U U		
Sens	Protection			Ove	r voltage prote		oltage of 26.4 V				l ă
	Ito-shift input*5	Voltage	free input (Ree						-shift function (DN/OFF	
-	Unit ^{*6}						, mmH2O (depe				
	Display type				· · · ·	LCD	•				
Display	Number of screens						Sub screen x 2				
lisi	Display colour						screen: Orange				N N
	Number of display digits	Main screen: 4 digits	(7 segments), Sub sc						its are 11-segments,	7 segments for other)	SE570
	Indicator light gital filter*7			Lights up v			DN. OUT1, OUT	2: Orange			S
	Enclosure			Eront		0 to 30 s/0.01	s increments nted), Others: II	D10*8			L D
Environment	Withstand voltage						ninals and hour				
	Insulation resistance		50 MQ				eter) between		ousina		
Ϋ́	Operating temperature range						60 °C (No conde		louonig		
Ē	Operating humidity range						(No condensat				4
	andards					E/UKCA markii	•				
Ţ	Body			5	1 g (Excludes		nd output cable	e)			E20
Weight	Power supply/Output cable					60 g					Ш
	e-CON (1 pc.)		-			2 g					PS
(IO-Link mode)	IO-Link type IO-Link version					Device V1.1					
Ĕ	Communication speed						(s)				
Ē	Configuration file	COM2 (38.4 kbps) IODD file*9							ک او		
ļ	Minimum cycle time	4.8 ms							20		
<u>io</u>	Process data length	Input data: 10 bytes, Output data: 0 bytes							ensor Mon E300A		
icat	On request data communication	Yes							Sen SE		
nu	Data storage function	ves Ves							D		
Communication	Event function	V1.1 V1.1 COM2 (38.4 kbps) IODD file*9 4.8 ms Input data: 10 bytes, Output data: 0 bytes Yes Yes Yes Yes 131 (0 x 0083)							git		
	Vendor ID										
*2		ont on DC (+) side and DC (-) side of the sensor input connector results in of the product (AWG26)							Q		
*3	breakage of the product. Use of the product of a real of the product of							E300A			
	If the applied press			t value. the hve	steresis must h	F	Sheath	Finished O		ð 4.8	Ш
	value more than th	e amount of flu	ctuation, or cha	attering will occ							PS
*5	This setting is only possible for the PSE200A/PSE201A.										

*5 This setting is only possible for the PSE200A/PSE201A. *6 This setting is only possible for models with the unit selection function. Only MPa, kPa, or Pa is available for models without this function.

*7 The response time indicates when the set value is 90 % in relation to the step input.

∗8 If □48 conversion adapter is used, it meets IP40.

*9 The configuration file can be downloaded from the SMC website, https://www.smc.eu

* Products with tiny scratches, marks, or display colour or brightness variations which do not affect the performance of the product are verified as conforming products.




PSE200A Series

Applicable Pressure Sensors

	Applicable	SMC press	ure sensor			Rated pressure range								
PSE53	PSE54	PSE550	PSE56	PSE57	–100 kPa () 100 kPa	500	kPa	1 M	Pa 21	MPa	5 N	1Pa	10 MPa
PSE531	PSE541	—	PSE561	—	–101 kPa 📖	0								
PSE533	PSE543	—	PSE563	PSE573	–100 kPa 📖	🔲 100 kPa	1							
PSE532	—	—	—	—	0	💷 100 kPa	1							
	—	—	PSE564	PSE574	0			500 kPa						
PSE530	PSE540	—	PSE560	PSE570	0					1 MPa				
—	—	—	—	PSE575	0						2 MPa			
	—	—	—	PSE576	0						1		5 MPa	
—	—	—	—	PSE577	0				ļ					10 MP
_	_	PSE550	_	_	0	I2 kPa								


Internal Circuits and Wiring Examples

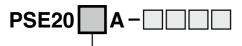

Input/Output specifications




· NPN open collector 5 outputs + Auto-shift 1 input

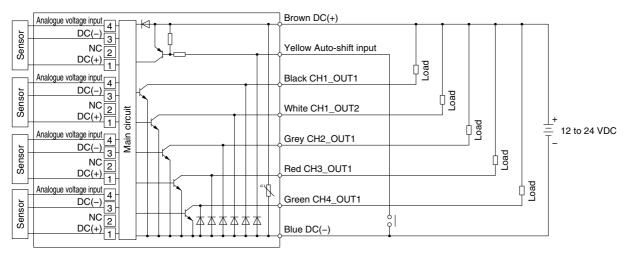


1

· PNP open collector 5 outputs + Auto-shift 1 input

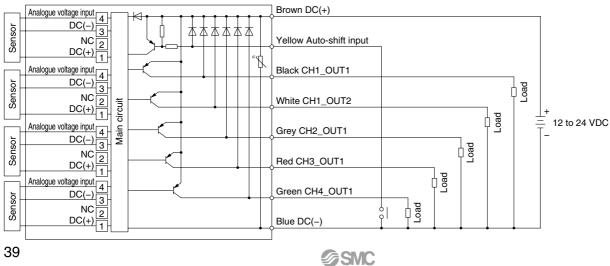


Internal Circuits and Wiring Examples

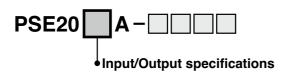


2

· IO-Link/NPN open collector 1 output + NPN open collector 4 outputs

When used as an IO-Link device

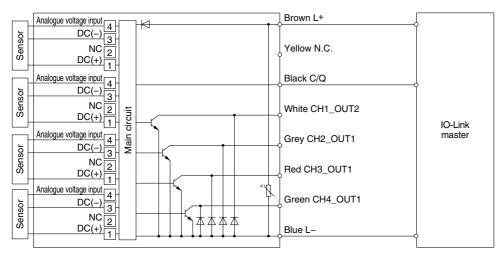

When used as a switch output device

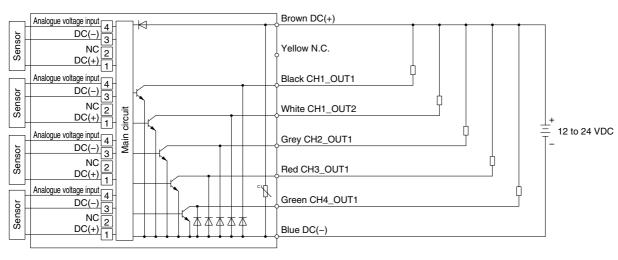

SMC

PSE530

PSE540

PSE550

PSE560

PSE570


PSE200A

PSE300AC PSE300A

Digital Sensor Monitors

PSE200A Series


Internal Circuits and Wiring Examples

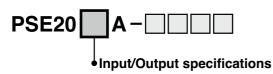


3

· IO-Link/PNP open collector 1 output + PNP open collector 4 outputs

When used as an IO-Link device

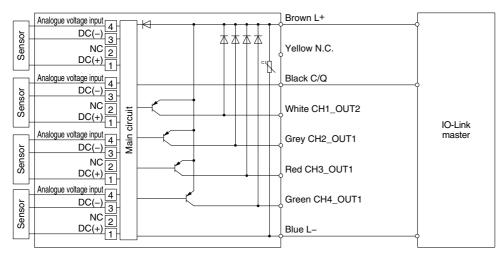


When used as a switch output device

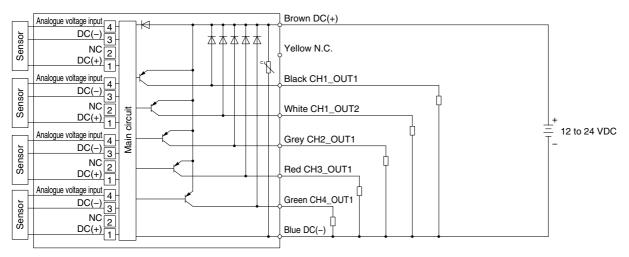

3-Screen Display Multi-channel Digital Sensor Monitor **PSE200A** Series

Dimensions

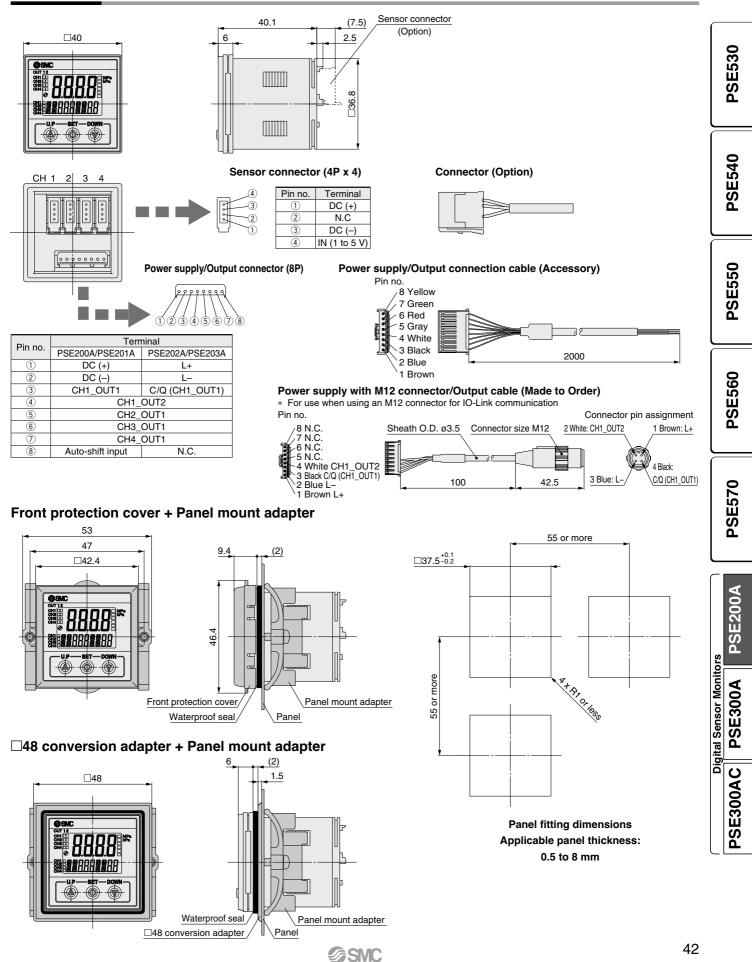




3-Screen Display **Sensor Monitor PSE300A** Series

ဴစ္က	попэ	L US	A C7	. C C								
PSE530	Set/Display resolution		ge	essure ran	Rated p				ensors	cable se	Appli	
] S		1 MPa 10 MPa	0 kPa	0 kPa 50	0 10	0 kPa	-10	PSE57□	PSE56□	PSE55□	PSE54□	PSE53□
	0.1 kPa				0	1	-101 kPa	—	PSE561	—	PSE541	PSE531
	0.2 kPa			100 kPa			-100 kPa	PSE573	PSE563	_	PSE543	PSE533
540	0.001 MPa	1 MPa				0		PSE570	PSE560	_	PSE540	PSE530
PSE540	0.001 MPa	2 MPa				0		PSE575	_	_	_	_
	0.01 MPa	5 MPa				0		PSE576	_	_	_	_
	0.01 MPa	10 MPa	<u>\$</u>			0		PSE577	_	_	_	_
550	0.1 kPa			100 kPa		0		_	_	_	_	PSE532
PSE550	1 kPa		500 kPa			0		PSE574	PSE564	_	_	_
	0.01 kPa] 2 kPa	0		_	—	PSE550	—	—

(BoHS)

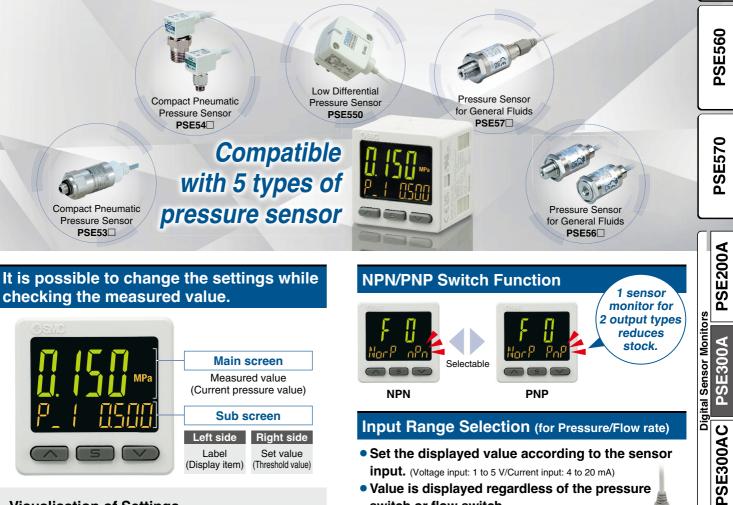

Input Range Selection (for Pressure/Flow rate)

- Set the displayed value according to the sensor input. (Voltage input: 1 to 5 V/Current input: 4 to 20 mA)
- Value is displayed regardless of the pressure switch or flow switch.







Sub screen

Right side

Set value

(Threshold value)

Left side

Label

(Display item)

Hysteresis value


Bottom value

Visualisation of Settings

Set value

(Threshold value **Peak value**

Improved Operability

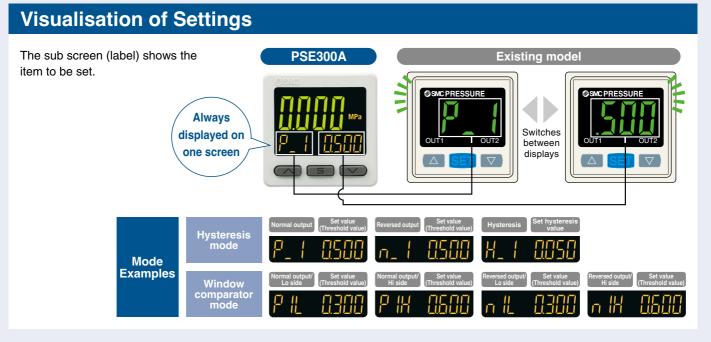

Simple 3-Step Setting


When the S button is pressed and the set value (P_1) is being displayed, the set value (threshold value) can be set. When the S button is pressed and the hysteresis (H_1) is being displayed, the hysteresis value can be set.






Setting completed

to adjust to the set value.

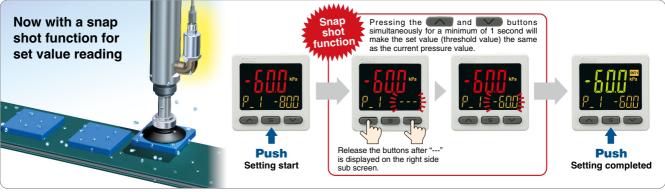


Easy Screen Switching

It is possible to change the settings while checking the measured value.

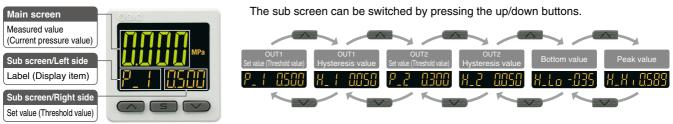

* One additional arbitrary display mode can be added via the function settings.

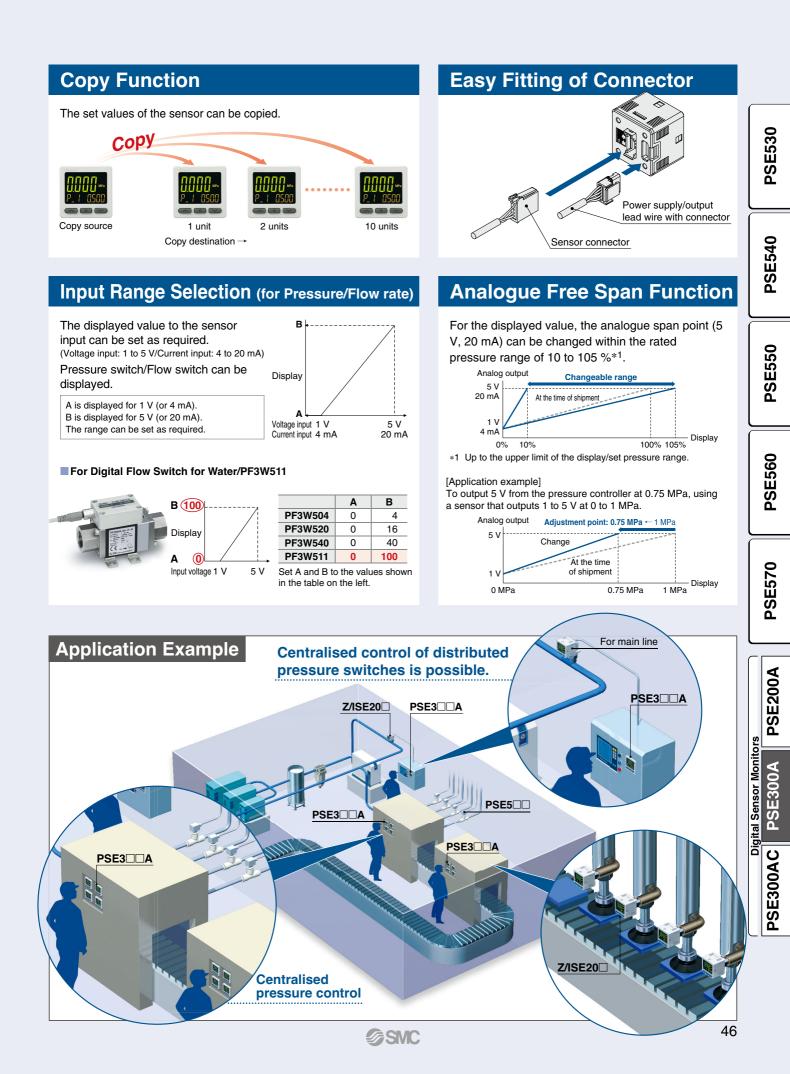


Series Variations

				Digita	I Sensor Mon	itors			
		PSE300A		PSE20	A00	р. 32	PSE300	AC	р. 54
		0. (50 P. (0.50) C C C C					E		
s	Repeatability	±0.1 % (F.S	ŝ.)			±0.1 %	(F.S.)		
atio	Voltage	12 to 24 VI	oc			12 to 2	4 VDC		
ecific	No. of outputs for switch	2 outputs	;		5 outputs			2 outputs	
Basic Specifications	Analogue output	1 to 5 V 4 to 20 m/	A			-	-		
Ba	Operating temperature	0 to 50 °C	;			0 to 5	50 °C		
	Number of screens	3				3	3		
Functions	Enclosure	IP40			Front face: IP65 Others: IP40			IP65	
Fun	3-step setting	Yes				Ye	es		
	Wiring	Connecto	r		_	Conn	ector	_	
sors		Compact Pneumatic Pressure Sensor PSE53 □	Compact Pneu Pressure Ser PSE54 [nsor	Low Differential Pressure Sensor PSE550	for G	sure Sensor eneral Fluids ' SE56 □	for Gene	re Sensor eral Fluids E57
Applicable Pressure Sensors						Ť	OF P	A	D.W
ole F		Rated pressure range	Rated pressure	range	ated pressure range		pressure range		ssure range
Applicat		–101 kPa to 0 –100 kPa to 100 kPa 0 to 100 kPa 0 to 1 MPa	–101 kPa to 0 –100 kPa to 100 0 to 1 M		0 to 2 kPa	–101 kF –100 kF	Pa to 0 Pa to 100 kPa 0 to 500 kPa 0 to 1 MPa	0 0 0	to 100 kPa to 500 kPa to 1 MPa to 2 MPa to 5 MPa to 10 MPa

CONTENTS

How to Order p. 48
Options/Part Nos p. 48
Specifications

Internal Circuits and Wiring Examples p. 50	0
Dimensions p. 5	1

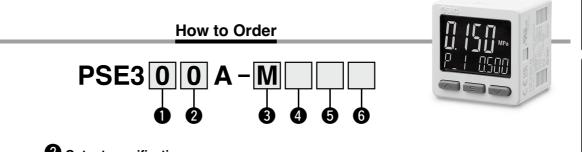

Input specification

mput specification						
ymbol	Description					
0	Voltage input					
1	Current input					

2 Output specification

Symbol	Description	Factory default settings
0	NPN/PNP open collector 2 outputs switching type +	NPN open collector 2 outputs + Analogue voltage*1
3	Analogue voltage/Auto-shift/Copy function switching type	PNP open collector 2 outputs + Analogue voltage*1
1	NPN/PNP open collector 2 outputs switching type +	NPN open collector 2 outputs + Analogue current*2
4	Analogue current/Auto-shift/Copy function switching type	PNP open collector 2 outputs + Analogue current*2
6	NPN/PNP open collector 2 outputs switching type + Copy function	NPN open collector 2 outputs + Copy function

*1, 2 Although the default output specifications differ, the output specifications are the same.

3 Unit specification

Symbol	Description
_	With unit selection function
М	SI units only*1

*1 Fixed unit: MPa, kPa, Pa

Option 1

Symbol	Description				
-	Without lead wire				
L	Lead wire with connector (2 m lead wire)	ZS-46-5L Power supply/output lead wire with connector			

6 Option 3

Symbol	Description					
_	None					
с	Sensor connector	ZS-28-C Sensor connector				

* This connector cannot be used with the PSE570 series.

Options/Part Nos.

When only optional parts are required, order with the part numbers listed below.					
Description	Part no.	Note			
Bracket	ZS-46-A1	—			
Panel mount adapter	ZS-46-B	—			
Panel mount adapter + Front protection cover	ZS-46-D	—			
Lead wire with connector	ZS-46-5L	5-core, 2 m			
Front protection cover	ZS-27-01	—			
Sensor connector (1 pc. per set)	ZS-28-C	For the PSE5 series (Excludes the PSE570 series)			
Sensor connector (1 pc. per set)	ZS-28-CA-4	For the PSE570 series			

Symbol	Description						
_	None						
A	Bracket	ZS-46-A1					
в	Panel mount adapter	ZS-46-B Panel Panel mount adapter					
D	Panel mount adapter + Front protection cover	ZS-46-D Panel Protection cover Panel mount adapter					

IS	PSE200A
Digital Sensor Monitors	PSE300A
D	PSE300AC

PSE530

PSE540

PSE550

PSE560

PSE570

PSE300A Series

Specifications

_							BOE 0001				
		Series			DOFFOO		PSE300A	DOFEOD		1	
	Applicable SMC pressure sensor		PSE550	PSE531 PSE541 PSE561	PSE533 PSE543 PSE563 PSE573	PSE532	PSE564 PSE574	PSE530 PSE540 PSE560 PSE570	PSE575	PSE576	PSE577
Ra	ted pres	sure range	0 to 2 kPa	0 to –101 kPa	-100 to 100 kPa	0 to 100 kPa	0 to 500 kPa	0 to 1 MPa	0 to 2 MPa	0 to 5 MPa	0 to 10 MPa
Di	splay/Set	pressure range	–0.2 to 2.1 kPa	10 to -105 kPa	-105 to 105 kPa	-10 to 105 kPa	–50 to 525 kPa	-0.105 to 1.05 MPa	-0.105 to 2.1 MPa	-0.25 to 5.25 MPa	-0.50 to 10.5 MPa
Dis	splay/Smal	llest settable increment	0.001 kPa	0.1 kPa	0.1 kPa	0.1 kPa	1 kPa	0.001 MPa	0.001 MPa	0.01 MPa	0.01 MPa
cal	Power s	upply voltage			12	to 24 VDC ±1	0 %, Ripple (p	o-p) 10 % or l	ess		
Electrical	Current	consumption				:	35 mA or less				
Ē	Protecti	on				Po	larity protection	on			
	Display	accuracy			±0.5 %	6 F.S. ±1 digi	t (Ambient ter	nperature of 2	25 °C)		
∑	Repeata	bility				±0.	1 % F.S. ±1 d	igit			
Accuracy	Analogue ou	tput accuracy (To display value)					±0.5 % F.S.	-			
Acc	Analogu	e output linearity					±0.2 % F.S.				
	Tempera	ture characteristics				±0.5 % F	.S. (Referenc	e: 25 °C)			
	Output t	type			Seleo	t from NPN c	or PNP open c	ollector 2 out	puts.		
	Output i	mode		Select from	n Hysteresis,	Window comp	parator, Error	output, or Sw	ritch output O	FF modes.	
1	Switch o	operation				Select from N	lormal or Rev	ersed output.			
Switch output	Max. loa	ad current					80 mA				
10	Max. app	lied voltage (NPN only)					30 VDC				
1 c		tage drop (Residual voltage)		NPN: 1 V o	or less (at load	current of 80) mA) PNP: 1	.5 V or less (a	at load curren	nt of 80 mA)	
S	Delay ti	me*1		1.5 ms	or less (with	anti-chattering	g function: 20	, 100, 500, 10	000, 2000, 50	00 ms)	
	Hvsteresis	Hysteresis mode				Va	ariable from 0	*2			
	Protecti	Window comparator mode									
-		Output type*3		Over current protection Voltage output: 1 to 5 V Extension analogue output range: 0.6 to 1 V							
f	Voltage output										
Ē	output	Output type*3	Dutput impedance Approx. 1 kΩ Dutput type*3 Current output: 4 to 20 mA Extension analogue output range: 2.4 to 4 mA								
ne	Current	output type			•		at power sup	• •	•		
Analogue output	output	Load impedance					at power sup		24 V: 600 Ω		
	Analogu	ie response time		50 ms or less							
input	Input ty	ре	Non-voltage input: 0.4 V or less								
Auto-shift input	Input me	ode	Select from Auto-shift or Auto-shift zero.								
Auto	Input tin	ne	5 ms or more								
Sensor input	Input ty	ре					t 1 to 5 VDC (4 to 20 mA DC				
ğ		of inputs					1 input				
ense		tion method					nnector (e-CC	,			
S	Protecti	on				• •	ction (up to a	•	,		
	Unit ^{*4}				MPa, kPa,	Pa, kgt/cm ² ,	bar, mbar, ps	ı, ınHg, mmH	g, mmH2O		
	Display						LCD	Out			
Number of screens				3-screen display (Main screen, Sub screen x 2) 1) Main screen: Red/Green							
ā	2) Sub screen: Orange 1) Main screen: 4 digits (7 segments) 2) Sub screen: 4 digits (Upper 1 digit 11 segments, 7 segments for other)										
	Indicato	r liaht	Lights up when switch output is turned ON. OUT1, OUT2: Orange								
Di	gital filter				ge up Wi		00, 500, 100		orango		
	Enclosu					0, 0, 00, 1	IP40	.,			
ler		nd voltage			1000	VAC for 1 mir	n between terr	ninals and ho	ousing		
		on resistance		50 MΩ or r			via megohmm			nd housing	
Environment		ig temperature range					–10 to 60 °C				
1		ng humidity range		- F			5 to 85 % RH				
St	andards					-	16656), CE/UI		,		
Weight	Body				25 g (Excludes pow	ver supply and	d output lead	wires)		
Wei	Lead wi	re with connector					+39 g				

1 Value without digital filter (at 0 ms)
*2 If the sensor input fluctuates around the set value, the hysteresis must be set to a value more than the amount of fluctuation, or chattering will occur.
*3 If the connected sensor does not have an extended analogue output range, there is no extended analogue output range available for this product.


*4 This setting is only possible for models with the unit selection function. Only MPa, kPa, or Pa is available for models without this function (set by pressure range). *5 The response time indicates when the set value is 90 % in relation to the step input.

*6 Display, switch output and analogue response time are affected.


* Products with tiny scratches, marks, or display colour or brightness variations which do not affect the performance of the product are verified as conforming products.



Internal Circuits and Wiring Examples

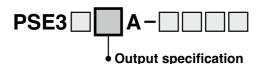

1 NPN (2 outputs) + Copy function setting

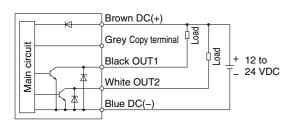


3

NPN (2 outputs) + Analogue voltage output setting NPN (2 outputs) + Analogue current output setting

		Brown DC(+)	1g	•]
		Grey Analogue or	utput		
circu		Black OUT1	Load	_	+ 12 to
Main circuit	×	White OUT2	1	Load	_ 24 VDC
		Blue DC(-)			

5 NPN (2 outputs) + Auto-shift input setting

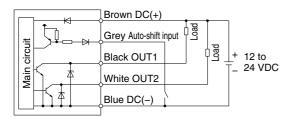

Sensor connector connection



Input specification


Dia		Terminal			
Pin no.	PSE30⊡A	Current input)			
110.	(Voltage input)	Pressure sensor 2-wire type	Pressure sensor 3-wire type		
1	DC (+)(Brown)	DC (–)(Brown)	DC (+)(Brown)		
2	N.C.	N.C.	N.C.		
3	DC (-)(Blue)	N.C.	DC (-)(Blue)		
4	IN (1 to 5 V)(Black)	IN (4 to 20 mA)(Blue)	IN (4 to 20 mA)(Black)		

 $\ast~$ The colours in () indicate the wire colour of the PSE5 $\square\square$ series.

Output specification	Settable circuit	Factory default settings
0	1, 2, 3, 4, 5, 6	3
1	1, 2, 3, 4, 5, 6	3
3	1, 2, 3, 4, 5, 6	(4)
4	1, 2, 3, 4, 5, 6	(4)
6	1), 2	1

(2)

PNP (2 outputs) + Copy function setting

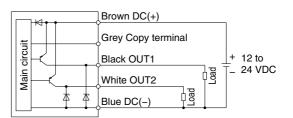


(4)

PNP (2 outputs) + Analogue voltage output setting PNP (2 outputs) + Analogue current output setting

	1141•	•		Brown DC(+)			,	
it			•	Grey Analogu				
circuit	K			Black OUT1	Load		L	12 to
Main	— <			White OUT2		Load	-	24 VDC
~		Ϋ́,		Blue DC(-)	Load			

6 PNP (2 outputs) + Auto-shift input setting

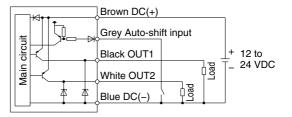



PSE530

PSE540


PSE550

PSE560

PSE570

PSE300A Series

Dimensions

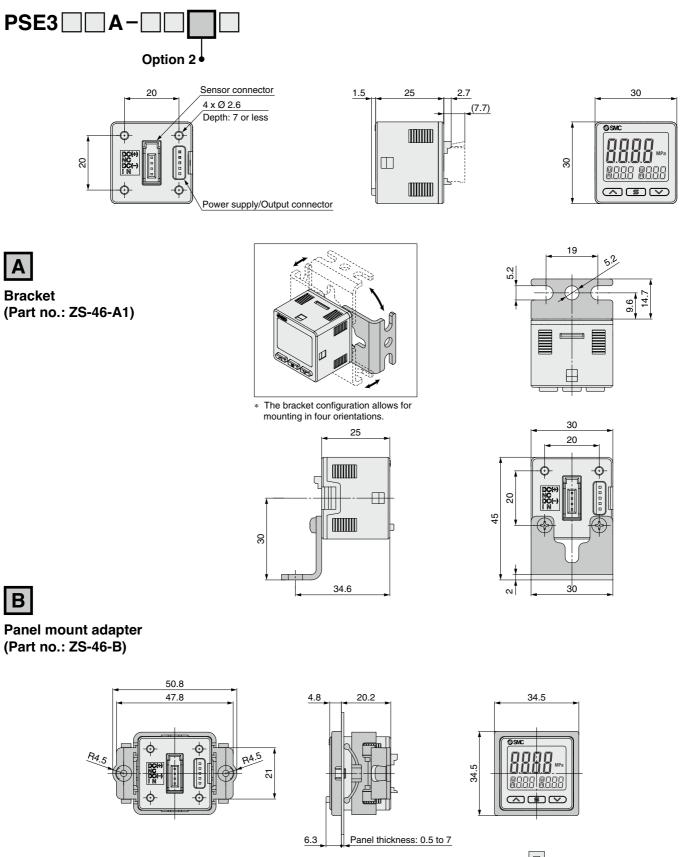




3-Screen Display Sensor Monitor **PSE300A** Series


Dimensions



Panel mount adapter + Front protection cover (Part no.: ZS-46-D)

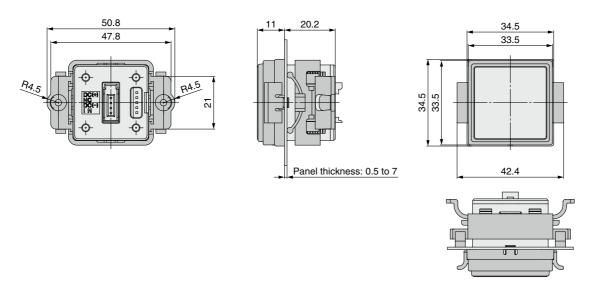

Lead wire with connector (Part no.: ZS-46-5L)

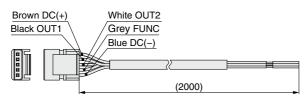

Cable Specifications

Conductor area		0.15 mm ² (AWG26)	
Inculator	0.D.	1.0 mm	
Insulator	Colour	Brown, Blue, Black, White, Grey (5-core)	
Sheath	Finished O.D.	Ø 3.5	

PSE530

PSE540

PSE550


PSE560

PSE570


PSE300A Series

Dimensions


Panel fitting dimensions

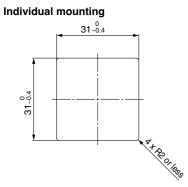


Multiple (2 pcs. or more) secure mounting <Horizontal>

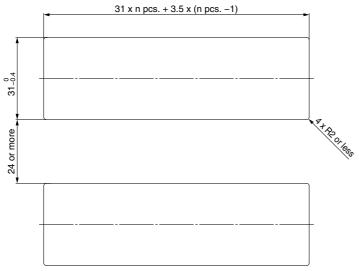

Panel mount example <Horizontal>

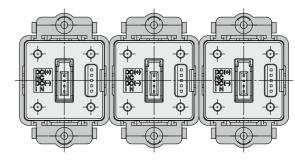

Panel mount example <Vertical>

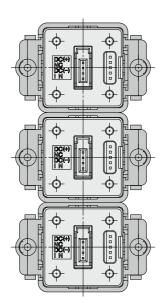

<Vertical>




3-Screen Display Sensor Monitor PSE300AC Series

RoHS

5530

PSE	IP65													
	Set/Display resolution	Rated pressure range Set/Display resolution							Applicable sensors					
		I MPa 10 MPa) kPa	00 kPa 500	0 10	–100 kPa	PSE57□	PSE56□	PSE55□	PSE54□	PSE53□			
40	0.1 kPa				0	01 kPa	—	PSE561	—	PSE541	PSE531			
PSE540	0.2 kPa			100 kPa		00 kPa	PSE573	PSE563	—	PSE543	PSE533			
ď	0.001 MPa	1 MPa				0	PSE570	PSE560	—	PSE540	PSE530			
	0.001 MPa	2 MPa				0	PSE575	—	_	_	_			
02	0.01 MPa	5 MPa				0	PSE576	—	_	_	_			
E550	0.01 MPa	10 MPa				0	PSE577	—	_	_	_			
PSI	0.1 kPa			100 kPa		0	_	—	_	_	PSE532			
	1 kPa		500 kPa	<u>\$</u>		0	PSE574	PSE564	_	_	_			
0	0.01 kPa				2 kPa	0	_	_	PSE550	_	_			
PSE560		<u> </u>				·								

It is possible to change the settings while checking the measured value.

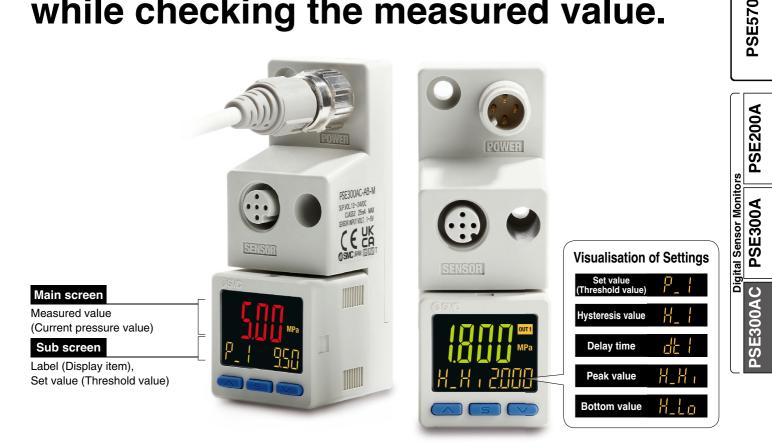


3-Screen Display Sensor Monitor PSE300AC Series

<complex-block>

Easy Screen Switching

It is possible to change the settings while checking the measured value.

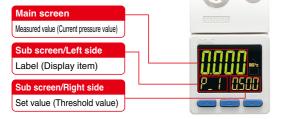


The sub screen can be switched by pressing the up/down buttons.



* One arbitrary display mode can be added via function settings.

NPN/PNP Switch Function—


The number of stock items can be reduced.

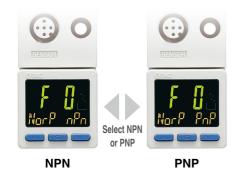

Input Range Selection (for Pressure/Flow rate) -

The sensor input range can be set to the required value and displayed. (Voltage input: 1 to 5 V/Current input: 4 to 20 mA)

Pressure switch/Flow switch can be displayed.

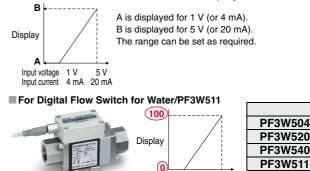


Input voltage 1 V

5 V


	Α	В				
PF3W504	0	4				
PF3W520	0	16				
PF3W540	0	40				
PF3W511 0 100						
Set A and B to the values shown in the table above						

Simple 3-Step Setting

When the S button is pressed and the set value (P_1) is being displayed, the set value (threshold value) can be set. When the S button is pressed and the hysteresis (H_1) is being displayed, the hysteresis value can be set.

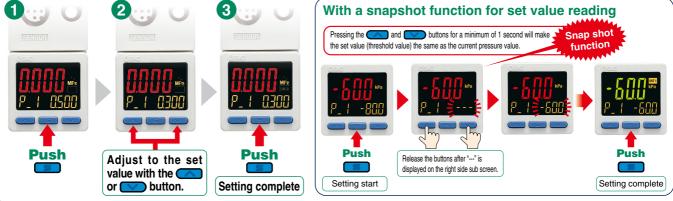

3-Screen Display Sensor Monitor (E UK **PSE300AC Series** (RoHS)

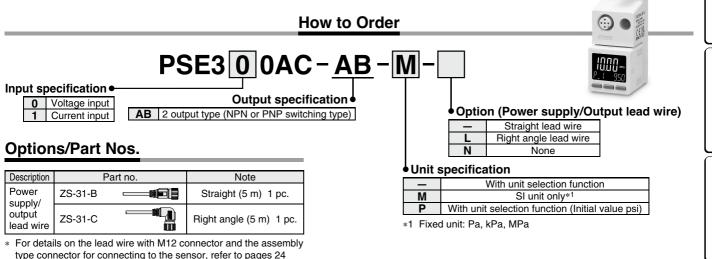

and 25

Specifications

M12 Connector Type

Specif	ications											PSE560					
M12 Co	nnector Type											S					
	Series					PSE300AC						Δ.					
Applicable	SMC pressure sensor	PSE550	PSE531/PSE541 PSE561	PSE533/PSE543 PSE563/PSE573		PSE564 PSE574	PSE530/PSE540 PSE560/PSE570	PSE575	PSE576	PSE577	L						
Rated pre	essure range	0 to 2 kPa	0 to -101 kPa		0 to 100 kPa			0 to 2 MPa	0 to 5 MPa	0 to 10 MPa							
Display/Set pressure range -0.2 to 2.1 kPa 10 to -105 kPa -105 to 10					-10 to 105 kPa	-50 to 525 kPa	-0.105 to 1.05 MPa	-0.105 to 2.1 MPa	-0.1 to 5.25 MPa	-0.1 to 10.5 MPa	MPa						
						0.01 MPa		2									
	Power supply voltage			12 to 2	24 VDC (±10 9	%) with 10 % v	voltage ripple	or less	•	•		SE570					
Electrical	Current consumption					25 mA or less	3					Щ					
	Protection					connection p						С С					
	Display accuracy			±0.5 % F.	S. ±Min. displa	ay unit (Ambie	nt temperatur	e of 25 °C)									
Accuracy	Repeatability			±0.1 % F.	S. ±Min. displa	ay unit (Ambie	nt temperatur	e of 25 °C)									
-	Temperature characteristics			±0.5 % F.S.	(Ambient tem	perature of 0	to 50 °C, 25 °	C reference)									
	Output type			Se	elect from NPN	or PNP oper	o collector outp	out.				-					
	Output mode		Select from	n hysteresis m	ode, window o	comparator m	ode, error out	out or switch o	output OFF.			⋖					
	Switch operation			S	Select from nor	mal output or	reverse outpu	ut.				PSE200A					
Switch	Max. load current	20 mA									2						
output	Max. applied voltage (NPN only)	30 VDC									Ш						
output	Internal voltage drop (Residual voltage)	1 V or less (with load current of 20 mA)								S N							
	Delay time *1	1 ms or less (with anti-chattering function: 20, 100, 500, 1000, 2000, 5000 ms)								_							
	Hysteresis	Variable from 0*2							Digital Sensor Monitors	≝∟							
	Protection Over current protection								Ē	í							
	Input type	ype Voltage input: 1 to 5 VDC (Input impedance: 1 M Ω), Current input: 4 to 20 mA DC (Input impedance: 51 Ω)							51 Ω)		PSE300A						
Sensor										18							
input	Connection method	M12-4 pin connector								ັງ ຕ							
	Protection	Over voltage protection (up to a voltage of 26.4 VDC)							Ğ	μ							
	Unit *3			MPa, kPa	ι, Pa, kgf/cm ² ,	bar, mbar, ps	i, inHg, mmHg	g, mmH2O			Ŭ,	်းတွ					
	Display type									ta l							
Display	Number of screens	3-screen display (Main screen, Sub screen x 2)							<u>.</u>	<u></u>							
Display	Display colour	1) Main screen: Red/Green, 2) Sub screen: Orange															
	Number of display digits									4							
	Indicator light	Lights up when switch output is turned ON. OUT1/OUT2: Orange									18						
Digital filt	ter *4	0, 10, 50, 100, 500, 1000, 5000 ms								PSE300A							
	Enclosure IP65									Ш							
	Withstand voltage			1000	VAC for 1 mi	n between ter	minals and ho	using				S					
Environment	Insulation resistance		50 MΩ or	more (500 VI	DC measured	via megohmn	neter) betweer	n terminals an	d housing		l	Δ.					
	Operating temperature range																
	Operating humidity range	Operating/Stored: 35 to 85 % RH (No condensation)							ı.								
Standard	tandards CE/UKCA						ı.										
Weight				55.4	l g (without po	wer supply or	output lead w	rires)			ı.						
4 14 1		•															

*1 Value without digital filter (at 0 ms)

*2 If the applied pressure fluctuates around the set value, the hysteresis must be set to a value more than the amount of fluctuation, or chattering will occur.

- *3 This setting is only available for models with the unit selection function. Only MPa, kPa, or Pa is available for models without this function.
- *4 The response time indicates when the set value is 90 % in relation to the step input. 56 SMC

PSE530


PSE540

PSE550


PSE300AC Series

Internal Circuits and Wiring Examples

Setting of NPN open collector 2 outputs: Pressure sensor 3-wire type

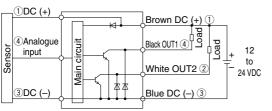

Setting of NPN open collector 2 outputs: Pressure sensor 2-wire type

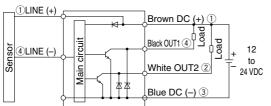


* The output type can be changed in the function selection mode.


* Numbers in the figures show the connector pin layout.


Dimensions

Setting of PNP open collector 2 outputs: Pressure sensor 3-wire type

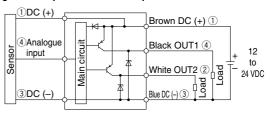


Setting of PNP open collector 2 outputs: Pressure sensor 2-wire type

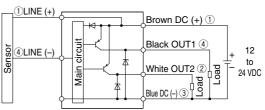

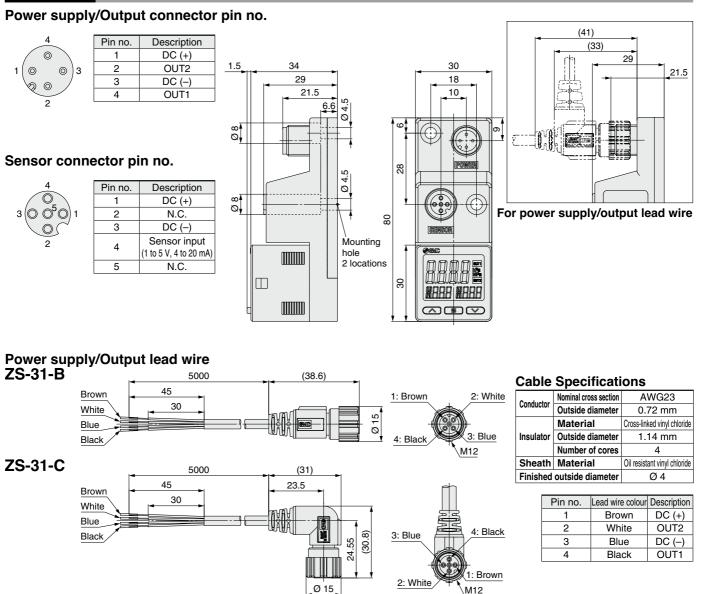

3-Screen Display Sensor Monitor **PSE300AC** Series

Options / Connection Examples

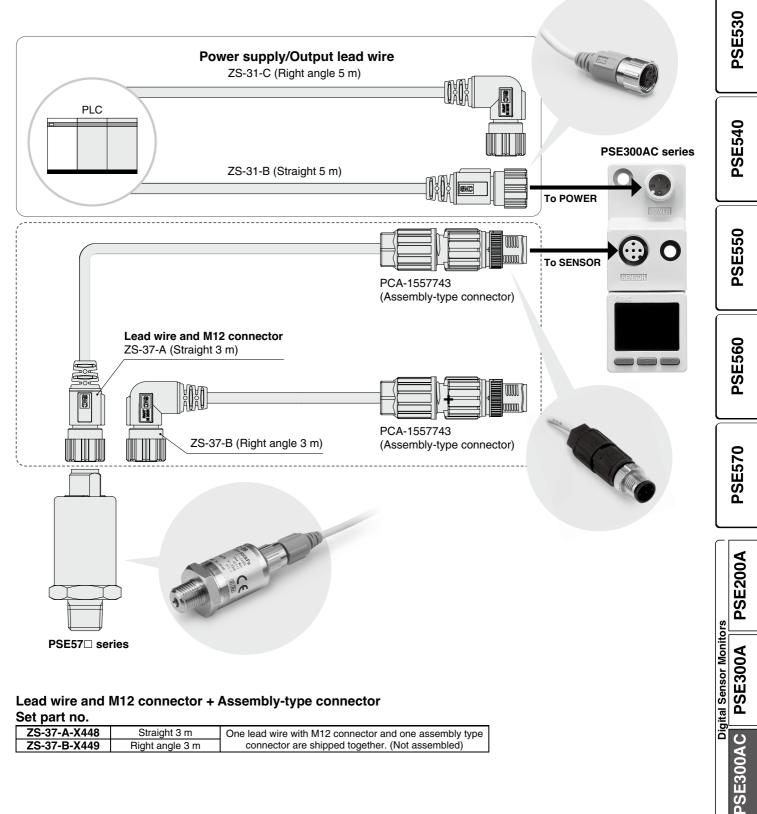

Lead wire and M12 connector + Assembly-type connector Set part no.

ZS-37-A-X448	Straight 3 m	One lead wire with M12 connector and one assembly type
ZS-37-B-X449	Right angle 3 m	connector are shipped together. (Not assembled)

\land	Safety I	nstructions	These safety instructions are intended to prevent hazardous situations and/or equipment damage. These instructions indicate the level of potential hazard with the labels of				
				or "Danger." They are all important notes for safety and must be ternational Standards (ISO/IEC) ¹⁾ , and other safety regulations.			
	Danger:	Danger indicates a hazard wit which, if not avoided, will resu injury.	0	 ISO 4414: Pneumatic fluid power – General rules and safety requirements for systems and their components. ISO 4413: Hydraulic fluid power – General rules and safety requirements for systems and their components. 			
	Warning:	Warning indicates a hazard w which, if not avoided, could re injury.		IEC 60204-1: Safety of machinery – Electrical equipment of machines. (Part 1: General requirements) ISO 10218-1: Robots and robotic devices - Safety requirements for industrial robots - Part 1: Robots.			
	Caution:	Caution indicates a hazard wi which, if not avoided, could re		etc.			

injury.

∧ Warning

1. The compatibility of the product is the responsibility of the person who designs the equipment or decides its specifications. Since the product specified here is used under various operating conditions, its compatibility with specific equipment must be decided by the person who designs the equipment or decides its specifications based on necessary analysis and test results. The expected performance and safety assurance of the equipment will be the responsibility of the person who has determined its compatibility with the product. This person should also continuously review all specifications of the product referring to its latest catalogue information, with a view to giving due consideration to any possibility of equipment failure when configuring the equipment.

2. Only personnel with appropriate training should operate machinery and equipment.

The product specified here may become unsafe if handled incorrectly. The assembly, operation and maintenance of machines or equipment including our products must be performed by an operator who is appropriately trained and experienced.

- 3. Do not service or attempt to remove product and machinery/ equipment until safety is confirmed.
 - 1. The inspection and maintenance of machinery/equipment should only be performed after measures to prevent falling or runaway of the driven objects have been confirmed.
 - 2. When the product is to be removed, confirm that the safety measures as mentioned above are implemented and the power from any appropriate source is cut, and read and understand the specific product precautions of all relevant products carefully.
 - 3. Before machinery/equipment is restarted, take measures to prevent unexpected operation and malfunction.

4. Our products cannot be used beyond their specifications. Our products are not developed, designed, and manufactured to be used under the following conditions or environments. Use under such conditions or environments is not covered.

- 1. Conditions and environments outside of the given specifications, or use outdoors or in a place exposed to direct sunlight.
- 2. Use for nuclear power, railways, aviation, space equipment, ships, vehicles, military application, equipment affecting human life, body, and property, fuel equipment, entertainment equipment, emergency shut-off circuits, press clutches, brake circuits, safety equipment, etc., and use for applications that do not conform to standard specifications such as catalogues and operation manuals.
- 3. Use for interlock circuits, except for use with double interlock such as installing a mechanical protection function in case of failure. Please periodically inspect the product to confirm that the product is operating properly.

∧ Caution

We develop, design, and manufacture our products to be used for automatic control equipment, and provide them for peaceful use in manufacturing industries. Use in non-manufacturing industries is not covered.

Products we manufacture and sell cannot be used for the purpose of transactions or certification specified in the Measurement Act.

The new Measurement Act prohibits use of any unit other than SI units in Japan.

Limited warranty and **Disclaimer/Compliance** Requirements

The product used is subject to the following "Limited warranty and Disclaimer" and "Compliance Requirements".Read and accept them before using the product.

Limited warranty and Disclaimer

- 1. The warranty period of the product is 1 year in service or 1.5 years after the product is delivered, whichever is first.²⁾ Also, the product may have specified durability, running distance or replacement parts. Please consult your nearest sales branch
- 2. For any failure or damage reported within the warranty period which is clearly our responsibility, a replacement product or necessary parts will be provided. This limited warranty applies only to our product independently, and not to any other damage incurred due to the failure of the product.
- 3. Prior to using SMC products, please read and understand the warranty terms and disclaimers noted in the specified catalogue for the particular products.
- 2) Vacuum pads are excluded from this 1 year warranty. A vacuum pad is a consumable part, so it is warranted for a year after it is delivered. Also, even within the warranty period, the wear of a product due to the use of the vacuum pad or failure due to the deterioration of rubber material are not covered by the limited warranty.

Compliance Requirements

- 1. The use of SMC products with production equipment for the manufacture of weapons of mass destruction (WMD) or any other weapon is strictly prohibited.
- 2. The exports of SMC products or technology from one country to another are governed by the relevant security laws and regulations of the countries involved in the transaction. Prior to the shipment of a SMC product to another country, assure that all local rules governing that export are known and followed.

Revision History

Edition B	 * A DIN rail/terminal block type and current input type have been added to the PSE300 series. 	LT
Edition C	 The PSE570 series pressure sensor for general fluids has been added. The number of pages has been decreased from 40 to 36. 	TT
Edition D	 An IO-Link compatible switch output specification has been added to the PSE540 series. An IO-Link compatible switch output specification has been added to the PSE570 series. The number of pages has been increased from 36 to 60. 	

SMC Corporation (Europe)

+43 (0)2262622800	www.smc.at	office@smc.at	Lithuania	+370 5 2308118	www.smclt.lt	info@smclt.lt
+32 (0)33551464	www.smc.be	info@smc.be	Netherlands	+31 (0)205318888	www.smc.nl	info@smc.nl
+359 (0)2807670	www.smc.bg	office@smc.bg	Norway	+47 67129020	www.smc-norge.no	post@smc-norge.no
+385 (0)13707288	www.smc.hr	office@smc.hr	Poland	+48 222119600	www.smc.pl	sales@smc.pl
+420 541424611	www.smc.cz	office@smc.cz	Portugal	+351 214724500	www.smc.eu	apoioclientept@smc.smces.es
+45 70252900	www.smcdk.com	smc@smcdk.com	Romania	+40 213205111	www.smcromania.ro	smcromania@smcromania.ro
+372 651 0370	www.smcee.ee	info@smcee.ee	Russia	+7 (812)3036600	www.smc.eu	sales@smcru.com
+358 207513513	www.smc.fi	smcfi@smc.fi	Slovakia	+421 (0)413213212	www.smc.sk	office@smc.sk
+33 (0)164761000	www.smc-france.fr	supportclient@smc-france.fr	Slovenia	+386 (0)73885412	www.smc.si	office@smc.si
+49 (0)61034020	www.smc.de	info@smc.de	Spain	+34 945184100	www.smc.eu	post@smc.smces.es
+30 210 2717265	www.smchellas.gr	sales@smchellas.gr	Sweden	+46 (0)86031240	www.smc.nu	smc@smc.nu
+36 23513000	www.smc.hu	office@smc.hu	Switzerland	+41 (0)523963131	www.smc.ch	info@smc.ch
+353 (0)14039000	www.smcautomation.ie	sales@smcautomation.ie	Turkey	+90 212 489 0 440	www.smcturkey.com.tr	info@smcturkey.com.tr
+39 03990691	www.smcitalia.it	mailbox@smcitalia.it	UK	+44 (0)845 121 5122	www.smc.uk	sales@smc.uk
+371 67817700	www.smc.lv	info@smc.lv				
			South Africa	+27 10 900 1233	www.smcza.co.za	zasales@smcza.co.za
	+43 (0)2262622800 +32 (0)33551464 +359 (0)2807670 +385 (0)13707288 +420 541424611 +45 70252900 +372 651 0370 +358 207513513 +33 (0)164761000 +49 (0)61034020 +30 210 2717265 +36 23513000 +353 (0)14039000 +39 03990691	+43 (0)2262622800 www.smc.at +32 (0)33551464 www.smc.be +359 (0)2807670 www.smc.bg +385 (0)13707288 www.smc.hr +420 541424611 www.smc.cz +45 70252900 www.smc.dk.com +372 651 0370 www.smc.et +358 207513513 www.smc.fi +33 (0)164761000 www.smc.fa +49 (0)61034020 www.smc.de +30 210 2717265 www.smc.hu +353 (0)14039000 www.smc.hu +353 (0)14039000 www.smc.atomation.ie +39 03990691 www.smcitalia.it	+43 (0)2262622800 www.smc.at office@smc.at +32 (0)33551464 www.smc.be info@smc.be +359 (0)2807670 www.smc.bg office@smc.bg +358 (0)13707288 www.smc.hr office@smc.cz +420 541424611 www.smc.cz office@smc.cz +45 70252900 www.smc.ca smc@smcdk.com +372 651 0370 www.smc.fi smcfi@smc.fi +358 207513513 www.smc.fi smcfi@smc.fi +33 (0)164761000 www.smc.de info@smc.cde +30 210 2717265 www.smc.hellas.gr sales@smchellas.gr +36 23513000 www.smc.hu office@smc.hu +353 (0)14039000 www.smcutomation.ie sales@smcatomation.ie +39 03990691 www.smctalia.it mailbox@smcialia.it	+43 (0)2262622800www.smc.atoffice@smc.atLithuania+32 (0)33551464www.smc.beinfo@smc.beNetherlands+359 (0)2807670www.smc.bgoffice@smc.bgNorway+385 (0)13707288www.smc.hroffice@smc.hrPoland+420 541424611www.smc.czoffice@smc.czPortugal+45 70252900www.smc.ccsmc@smcdk.comRomania+372 651 0370www.smc.fismcf@smc.fiSlovakia+33 (0)164761000www.smc.fismcf@smc.deSlovakia+30 210 2717265www.smc.huoffice@smc.huSpain+36 23513000www.smc.huoffice@smc.huSwitzerland+39 03990691www.smc.lvinfo@smc.lvSwitzerland+371 67817700www.smc.lvinfo@smc.lvSuitzerland	+43 (0)2262622800 www.smc.at office@smc.at Lithuania +370 5 2308118 +32 (0)33551464 www.smc.be info@smc.be Netherlands +31 (0)205318888 +359 (0)2807670 www.smc.bg office@smc.bg Norway +47 67129020 +385 (0)13707288 www.smc.hr office@smc.cz Poland +48 222119600 +420 541424611 www.smc.cz office@smc.cz Pottugal +351 214724500 +45 70252900 www.smcdk.com smc@smcdk.com Romania +40 213205111 +372 651 0370 www.smc.fi smcf@smc.fi Suportclient@smc.fiance.fr Slovakia +421 (0)413213212 +33 (0)164761000 www.smc.de info@smc.de Slovakia +34 421 (0)413213212 +30 210 2717265 www.smc.de info@smc.hu Sweden +46 (0)86001240 +36 23513000 www.smc.hu office@smc.hu Switzerland +41 (0)523963131 +353 (0)14039000 www.smc.hu office@smc.hu Switzerland +41 (0)523963131 +353 (0)14039000 www.smc.nutomation.ie sales@smc.hu Switzerland +41 (0)523963131 +353 (0)14039000 www.smc.ita	+43 (0)2262622800 www.smc.at office@smc.at +32 (0)33551464 www.smc.be info@smc.be +359 (0)2807670 www.smc.bg office@smc.bg +358 (0)13707288 www.smc.hr office@smc.cz +420 541424611 www.smc.cz office@smc.cz +45 70252900 www.smc.dk.com smc@smc.dk.com +372 651 0370 www.smc.fi smcf@smc.fi +33 (0)164761000 www.smc.dk smcf@smc.de +30 010 2717265 www.smc.hu office@smc.cle +30 010 2717265 www.smc.hu office@smc.chu +353 (0)14039000 www.smc.hu offic@smc.chu +353 (0)14039000 www.smc.hu offic@smc.hu +353 (0)14039000 sww.smc.hu offic@smc.hu +353 (0)14039000 sww.smc.hu offic@smc.hu +353 (0)14039000 sww.smc.hu offic@smc.lu +353 (0)14039000 www.smc.itaiia.it info@smc.lv *371 67817700 www.smc.lv offic@smc.lv

Printing CS 00 Printed in Spain