



Bernoulli Type Non-contact Gripper

For the adsorption transfer of thin cloths, films, printed circuit boards, etc.

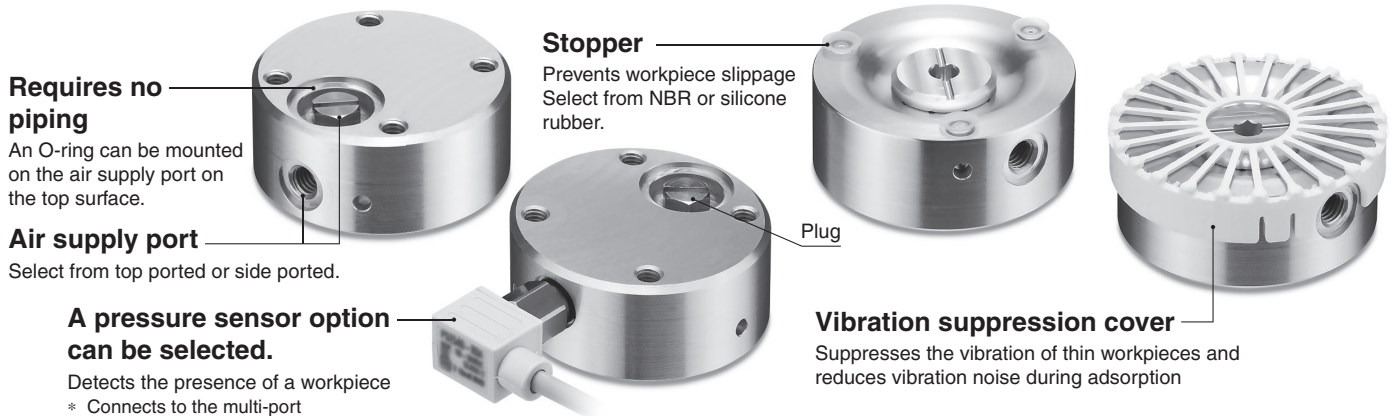


High lifting force compared with the existing model: 4.4 times

(Supply pressure: 0.5 [MPa], For non-permeable workpieces)

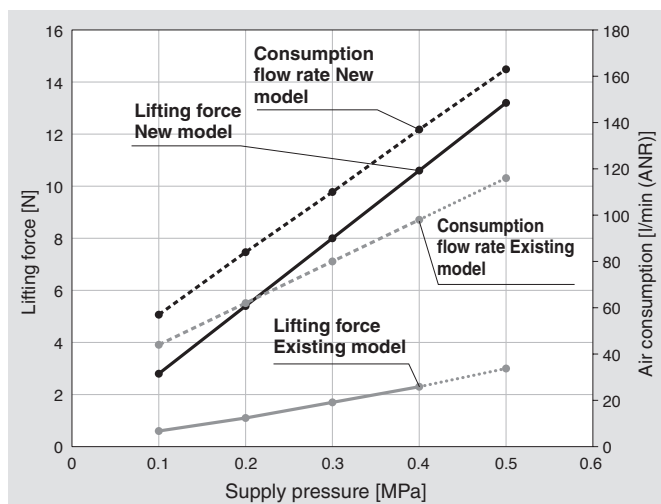

Construction and working principle

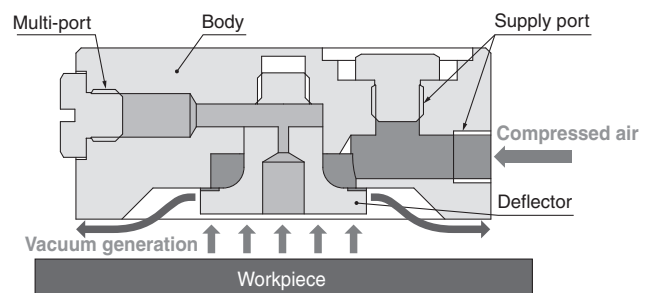

Application Examples



How to Order

XT661 - 4C - PN S - X427

- ①
- ②
- ③
- ④

① Outer body diameter

4C	Ø 40 mm
----	---------

② Stopper material

—	Without stopper
PN	NBR (Black)
PS	Silicone rubber (White)

③ Cover

—	None
V	With vibration suppression cover

④ Pressure sensor

—	None
S	With pressure sensor Part no.:PSE541-M5

* Can only be selected when "Without stopper" is selected for the stopper material

Specifications

Fluid	Air*1
Operating pressure	0.1 to 0.5 MPa
Ambient and operating temperatures	-5 to 60 °C (No freezing) With pressure sensor: 0 to 50 °C
Grease	Grease-free
Material	Body
	Vibration suppression cover
Weight	48.8 [g] (Basic type/Without plug)
Pressure sensor*3	PSE541-M5 Rated pressure range: 0 to -101 kPa

*1 Air purification rating: JIS B 8392-1 (ISO 8573-1) Quality degree: 4, 4.3 or higher

*2 Compliant with the FDA (U.S. Food and Drug Administration) regulation 21CFR§177. Compliant with the standards for "Synthetic resin apparatus and containers/packaging" (D 2) in Section 3 "Apparatus and Containers/Packaging" of the Food Sanitation Act, Article 1 8 "Specifications and Standards for Food and Food Additives, etc." (Ministry of Health and Welfare Notification No. 370, 1959)

*3 For pressure sensor details, refer to the PSE 5 4 0 series in the **Web Catalogue** and the Operation Manual.


XT661-X427




20-EU749-UK

XT661-X427


Lifting Force

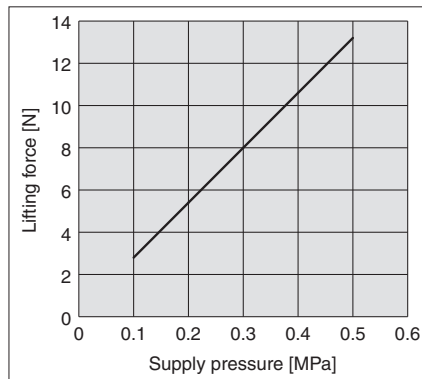

Consumption Flow Rate

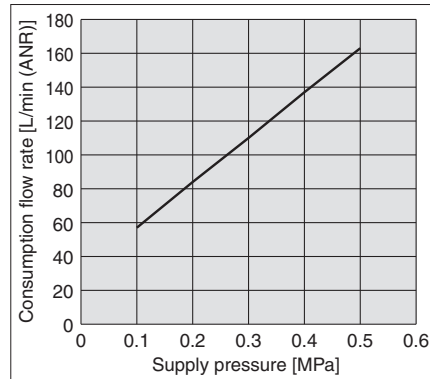


Lifting Force–Distance from the Workpiece

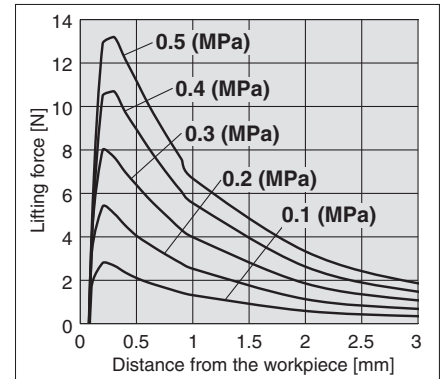

- * These graphs show the data when adsorbing smooth and non-permeable workpieces with a basic type model. Lifting force values when adsorbing workpieces with bumps or permeable workpieces will be lower than those shown in the graphs above.
- * For the lifting force when using a stopper or vibration suppression cover, use the following values as a guide for the distance from the workpiece.
With stopper: 1 mm, With vibration suppression cover: 1.5 mm

Dimensions

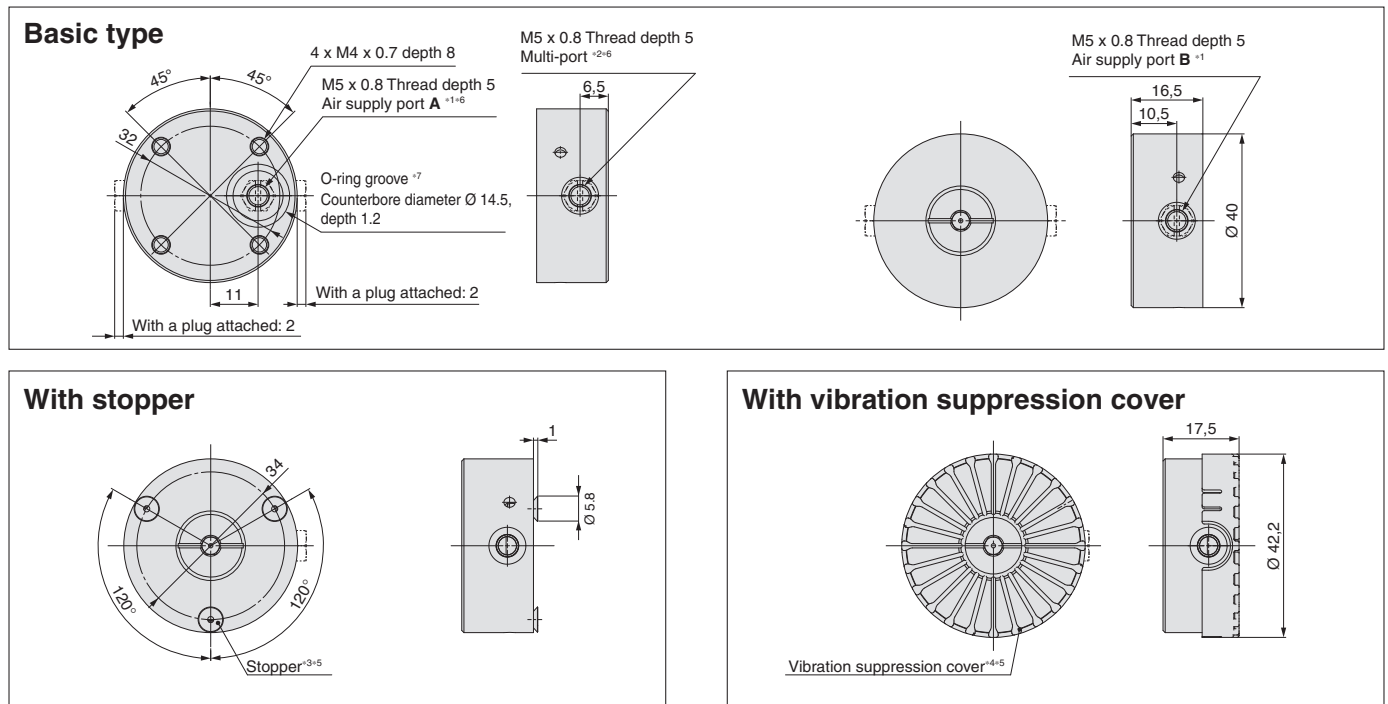

- *1 Supply air to either air supply port A or B. Seal the unused ports with plugs.
- *2 Seal the multi-port with a plug when not in use.
- *3 When using a stopper, the workpiece comes into contact with the stopper.
- *4 When using a vibration suppression cover, the workpiece comes into contact with the cover.
- *5 The stopper and cover cannot be used together.
- *6 The product is shipped with plugs in the air supply port A and multi-port.
- *7 The O-ring is not included. Attach an O-ring (14.5 x 11.5 x 1.5) if necessary.
- * The pressure sensor is shipped together with the product but does not come assembled.
- * The value of the pressure sensor differs depending on the workpiece. Customers should conduct a test with the actual product before use.

SMC Corporation

SMC CORPORATION
Akihabara UDX 15F, 4-14-1, Sotokanda, Chiyoda-ku, Tokyo 101-0021, JAPAN
Phone: 03-5207-8249 FAX: 03-5298-5362
SMC CORPORATION All Rights Reserved

European Marketing Centre (EMC)

Zuazobidea 14, 01015 Vitoria
Tel: +34 945-184 100 Fax: +34 945-184 124
URL <http://www.smc.eu>